

ENGINEERING CHANGE NOTICE Page 1 of 6	<input checked="" type="checkbox"/> DM <input type="checkbox"/> FM <input type="checkbox"/> TM	1a. ECN 720095 R 3 1b. Proj. W- - ECN
---	--	---

2. Request Information Record Information on the ECN-1 Form		3a. Design Inputs -Record Information on the ECN-2 Form		3b. Design References - Record Information on the ECN-3 Form		3c. Engineering Evaluation / Estimate / Approval to Proceed w/ the Design - Record Information on the ECN-4 Form		
4. Originator's Name, Organization, MSIN, & Phone No. B. M. Hanlon, Engineering Standards, R3-72, 373-2053				5. USQ Number No. TF - - <input checked="" type="checkbox"/> N/A Init. <i>Bmh</i> Date <i>4/24/03</i>		6. Date 04/24/03		
7. Title HNF-EP-0182, Rev. 180, Waste Tank Summary for Month Ending March 31, 2003		8. Bldg. / Facility No. 241G		9. Equipment / Component ID N/A		10. Approval Designator N/A		
11. Document Numbers Changed by this ECN (For FM or TM Changes Record Information on the ECN-5 Form) Sheet and Rev. HNF-EP-0182, Rev. 179			12. Design Basis Documents? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No		13. Safety Designation <input type="checkbox"/> SC <input type="checkbox"/> SS <input type="checkbox"/> GS <input checked="" type="checkbox"/> N/A		14. Expedited / Off-Shift ECN? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	
15a. Work Package Number N/A		15b. Modification Work Completed N/A Responsible Engineer / Date		15c. Restored to Original Status (TM) N/A Responsible Engineer / Date		16. Fabrication Support ECN? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No		

17. Description of the Change (Use ECN Continuation pages, as needed) Complete revision of HNF-EP-0182, Waste Tank Summary Report	
---	--

18. Justification of the Change (Use ECN Continuation pages, as needed) DOE-ORP requires this document to be revised and issued monthly		19. ECN Category <input checked="" type="checkbox"/> Direct Revision <input type="checkbox"/> Supplemental <u>ECN Revision Type</u> <input type="checkbox"/> Void/Cancel <input type="checkbox"/> Closure <input type="checkbox"/> Revision
---	--	--

20. Distribution (Name and MSIN) Distribution list attached following document	Release Stamp <div style="border: 2px solid black; padding: 10px; text-align: center;"> MAY 05 2003 DATE: HANFORD STA: 4 RELEASE ID: 8 </div>
--	---

ENGINEERING CHANGE NOTICE

Page 2 of 6

☒ DM

☐ FM

☐ TM

1a. ECN 720095 R 3

1b. Proj. W- -
ECN

21. Design Check

Record Information on the ECN-6 Form
N/A

22. Design Verification Required?

☐ Yes ☒ No

If Yes, as a minimum attach the one page checklist from TFC-ENG-DESIGN-P-17.

23. Closeout / Cancel / Void

☐ Yes ☒ No

If Yes, Record Information on the ECN-7 Form and attach form(s).

24. Revisions Planned (Include a brief description of the contents of each revision)

Document will be revised monthly in 2003

Note: All Revisions shall have the approvals of the affected organizations as identified in block 9 "Approval Designator," on page 1 of this ECN.

25a. Commercial Grade Item Dedication Numbers (associated with this design change)

N/A

25b. Engineering Data Transmittal Numbers (associated with this design change, e.g., new drawings, new documents)

N/A

26a. Design Cost Estimate

N/A

26b. Materials / Procurement Costs

N/A

26c. Estimated Labor Hours

N/A

27. Field Change Notice(s) Used? (Used for ECN Revisions only)

☐ Yes ☒ No

If Yes, Record Information on the ECN-8 Form attach form(s) and identify permanent changes.

NOTE: ECN Revisions are required to record and approve all FCN's issued during the field modification work process. If the FCN's have not changed the original design media then they are just incorporated into the ECN file via an ECN revision. If the FCN did change the original design media then the ECN Revision will include the necessary engineering changes to the original design media changes.

28. Approvals

Signature

Date

Signature

Date

Design Authority _____

Team Lead/Lead Engr. Bruce Hanlon 4/24/03

Resp. Engineer Bruce Hanlon 4/24/03

Resp. Manager M. A. Fitch 5/2/03

Quality Assurance _____

IS&H Engineer _____

NS&L Engineer _____

Environ. Engineer _____

Project Engineer _____

Design Checker X Ma (Guit) 5/2/03

Design Verifier _____

Operations _____

Radcon _____

Other _____

Other _____

Originator/Design Agent _____

Professional Engineer _____

Project Engineer _____

Quality Assurance _____

Safety _____

Designer _____

Environ. Engineer _____

Other _____

Other _____

DEPARTMENT OF ENERGY / OFFICE OF RIVER PROTECTION

Signature or a Control Number that tracks the Approval Signature

ADDITIONAL SIGNATURES

ECN - 5
DRAWING / DOCUMENT CHANGE LIST FORM

Sheet 1 of ECN - 5

Page 3 of 6

☒ DM

☐ FM

☐ TM

1a. ECN 720095 R 3

1b. Proj. W- -
ECN

List of Engineering Drawings/Documents to be Modified (Use the attached checklist for guidance)

Dwg./Doc. Number (Sheet/Page, Rev)	Title/Type	Shared	Existing Change Document Nos.
HNF-EP-0182, Rev. 179	Waste Tank Summary Report for Month Ending February 28, 2003	<input type="checkbox"/>	
		<input type="checkbox"/>	
		<input type="checkbox"/>	
		<input type="checkbox"/>	
		<input type="checkbox"/>	
		<input type="checkbox"/>	
		<input type="checkbox"/>	
		<input type="checkbox"/>	
		<input type="checkbox"/>	
		<input type="checkbox"/>	
		<input type="checkbox"/>	
		<input type="checkbox"/>	

Submitted to Document Service Center Prior to ECN Release?

☐ Yes ☒ No

Team Lead

BW Hanlon

Date

4/24/03

List of Non-Engineering Documents Needed to be Modified

Document Number/Revision, Sheet/Page (If Available)	Document Title	Document Owner (Organization)	Individual Notified	Method	Date Notified

List of Engineering Drawings/Documents to be Modified (Use the attached checklist for guidance)

Dwg./Doc. Number (Sheet/Page, Rev)	Title/Type	Shared	Existing Change Document Nos.		

ECN - 5 DRAWING / DOCUMENT CHANGE LIST FORM	<input checked="" type="checkbox"/> DM <input type="checkbox"/> FM <input type="checkbox"/> TM	1a. ECN 720095 R 3 1b. Proj. W- - ECN
Sheet 2 of ECN – 5	Page 4 of 6	

Drawings/Documents to be Modified Checklist			
System Design Description	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Operating Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Functional Design Criteria	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	System/Subsystem Specifications	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Functional Requirements	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Engineering Flow Diagram Drawing	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Operating Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	General Arrangement Drawing	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Criticality Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Material Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Conceptual Design Report	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Sampling Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Detailed Design Report	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Inspection Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Equipment Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Radiation Control Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Procurement Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Spare Parts List	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Construction Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Test Specification	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Vendor Information	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Test Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Operations / Maintenance Manual	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Acceptance Test Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Safety Analysis / FSAR / SAR / DSA	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Pre-Operational Test Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Technical Safety Requirement	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Operational Test Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Master Equipment List	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	ASME Coded Item / Vessel	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Safety Equipment List	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Human Factor Consideration	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Radiation Work Permit	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Automated Control Configuration Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Environmental Requirement	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Computer / Automated Control Software Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Environmental Permit	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Raceway / Cable Schedules	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Seismic / Stress / Structural Analysis	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Work Control Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Design Report	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Corrective Maintenance Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Interface Control Drawing	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Process Control Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Calibration Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Process Control Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Preventive Maintenance Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Flow Sheet	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Engineering Procedure	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Purchase Requisition	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Security Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	Hazards Analysis	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
Emergency Plan	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	JCS PM Activity Datasheet	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A		<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A

**ECN - 6
DESIGN CHECK LIST**

Sheet 1 of ECN - 6

Page 5 of 6

☒ DM
☐ FM
☐ TM

1a. ECN 720095 R 3

1b. Proj. W- -
ECN

Design Details/Attributes (to be filled out by the change originator) identified in the ECN.

1. Issue/Problem Statement included	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	21. Basis for Selected Alternative explained, including assumptions	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
2. Safety/Commitment/Programmatic Impacts identified – NEPA Documentation completed	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	22. Potential Component/System Impacts identified and resolved	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
3. System/Equipment/Personnel Impacts identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	23. Potential Software Impacts identified and resolved	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
4. Technical Evaluation included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	24. Potential Safety Impacts are identified and resolved (e.g., energized electrical equipment)	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
5. Compliance w/ Design Basis identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	25. Modification is Constructible and can be implemented	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
6. Assumptions/Sources clearly identified	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	26. Design considers Operational Impacts	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
7. Affected Documents and Databases clearly identified	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	27. Contamination Controls are planned	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
8. Inputs Verified	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	28. Pre-Installation/Mockup/Prototype Testing planned	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
9. Required Function(s) / changes clearly identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	29. Sketches/Drawings for Tools/Fabricated Components included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
10. Safety Basis/Commitments/Concerns evaluated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	30. Hardware Design described	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
11. Application of Industry Standards/Codes explained	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	31. Software/Firmware Design described	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
12. Proper Analytical Techniques employed	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	32. Inspections (per Codes & Standards) / Quality Checks included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
13. Interfaces evaluated and identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	33. Dimensions and Tolerances included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
14. Material/Component Compatibility evaluated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	34. Sketches/Drawings for Installation included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
15. ALARA/Radiological controls/chemical hazards evaluated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	35. Housekeeping/Personnel Safety Requirements identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
16. Human/Machine Interface evaluated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	36. Walkdown(s) performed/Labeling Correct	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
17. Program impacts evaluated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	37. Acceptance Test generated and Acceptance Criteria included	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
18. Design Basis Calculations updated	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	38. M&TE Requirements identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
19. Alternatives described/evaluated and address resolution of problem	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	39. Training/Qualification of Test Personnel identified	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
20. Impacts on Maintenance and OPS described	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	40. Safety and Hazards Analysis assessed	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A

Design Originator (Print/Sign)

B.M. Hanlon



Date

5/2/03

Italicized text items need to be addressed. Standard text items need to be addressed as applicable to the change as described.

ECN - 6 DESIGN CHECK LIST	<input checked="" type="checkbox"/> DM	1a. ECN 720095 R 3
	<input type="checkbox"/> FM	
Sheet 2 of ECN - 6	<input type="checkbox"/> TM	1b. Proj. W- - ECN

Design Check Method (Select method(s) and provide explanation of how to be performed):

☒ **Peer Check**

☐ **Design Check Team***

☐ **Other**

Design Check Explanation:

* Design check team members other than the originating organization normally should consist of personnel representing: Operations, Maintenance & Reliability Engineering, Maintenance Management, Maintenance Crafts, Safety, and Projects.

Design Check Details

<i>Design inputs correctly identified?</i> <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	<i>Design changes properly documented?</i> <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A
<i>Calculations checked and are correct?</i> <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	<i>Test procedures reviewed and are correct?</i> <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A
<i>Design assumptions are stated and verified?</i> <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A	<i>Is the design change adequate?</i> <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A
<i>Design criteria incorporated into the design?</i> <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	<i>Is the design change complete?</i> <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A
<i>Interfaces clearly identified in the design?</i> <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> N/A	<i>Is the design change correct?</i> <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> N/A
<i>EQRG pre-release review required?</i> <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	EQRG Pre-release Approval Date


Comments:

Document changes reviewed for consistency with source information and confirmed as correct. Document reviewed for editorial adequacy and correctness. ALL discrepancies corrected and changes incorporated by originator.

Reference TFC-ENG-DESIGN-P-17, Design Verification

Design Checker (Print/Sign)

M.A. Knight



Date

5/2/03

Italicized text items need to be addressed. Standard text items need to be addressed as applicable to the problem/issue described.

WASTE TANK SUMMARY REPORT FOR MONTH ENDING MARCH 31, 2003

BM HANLON

CH2M HILL Hanford Group, Inc.

Richland, WA 99352

U.S. Department of Energy Contract DE-AC27-99RL14047

EDT/ECN: ECN-720095 **A3** UC:

Cost Center:

Charge Code:

B&R Code:


Total Pages: ⁶
72 14


Key Words: REPORT, WASTE TANK SUMMARY

Abstract: See page iii of document

TRADEMARK DISCLAIMER. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

Printed in the United States of America. To obtain copies of this document, contact: Document Control Services, P.O. Box 950, Mailstop H6-08, Richland WA 99352, Phone (509) 372-2420; Fax (509) 376-4989.

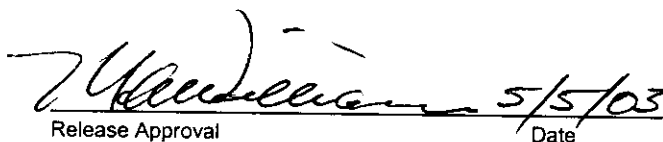
Release Approval Date

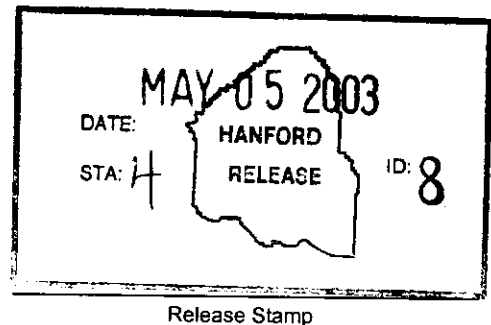

Approved For Public Release

RECORD OF REVISION

(1) Document Number

HNF-EP-0182

Page 1

(2) Title

WASTE TANK SUMMARY REPORT FOR MONTH ENDING MARCH 31, 2003

Change Control Record

(3) Revision

(4) Description of Change - Replace, Add, and Delete Pages

Authorized for Release

(5) Cog. Engr.

(6) Cog. Mgr.

Date

153

(7)

EDT-631372

BM Hanlon

JS Garfield

RS 180

Incorporation of ECN-720095, R-3

BM Hanlon
BM Hanlon

MA Fish
MA Fish 5/2/03

Waste Tank Summary Report for Month Ending March 31, 2003

Prepared for the U.S. Department of Energy
Assistant Secretary for Environmental Management

CH2MHILL
Hanford Group, Inc.

Richland, Washington

Contractor for the U.S. Department of Energy
Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

LEGAL DISCLAIMER

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.

Printed in the United States of America

Waste Tank Summary Report for Month Ending March 31, 2003

B. M. Hanlon
CH2M HILL Hanford Group, Inc.

Date Published
May 2003

Prepared for the U.S. Department of Energy
Assistant Secretary for Environmental Management

CH2MHILL
Hanford Group, Inc.

P. O. Box 1500
Richland, Washington

Contractor for the U.S. Department of Energy
Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

This page intentionally left blank.

WASTE TANK SUMMARY REPORT

B. M. Hanlon

ABSTRACT

This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and 60 smaller miscellaneous underground storage tanks and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of U.S. Department of Energy Order 435.1 (DOE-HQ, August 28, 2001, Radioactive Waste Management, U.S. Department of Energy-Washington, D.C.) requiring the reporting of waste inventories and space utilization for the Hanford Site Tank Farm tanks.

This page intentionally left blank.

TABLE OF CONTENTS

SUMMARY

I.	WASTE TANK STATUS	1
II.	WASTE TANK INVESTIGATIONS	1
III.	SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS	2

APPENDICES

APPENDIX A:	DOUBLE-SHELL TANKS MONTHLY SUMMARY TABLES.....	A-1
Table A-1.	Inventory and Status by Tank – Double-Shell Tanks	A-2
Table A-2.	Double-Shell Tank Space Allocation, Inventory, and Waste Receipts.....	A-4
Table A-3.	Double Shell Monitoring Frequency Status (28 Tanks)	A-5
APPENDIX B:	SINGLE-SHELL TANKS MONTHLY SUMMARY TABLES.....	B-1
Table B-1.	Inventory and Status by Tank – Single-Shell Tanks.....	B-2
Table B-2.	Single-Shell Tanks Stabilization Status Summary.....	B-13
Table B-3.	Single-Shell Tanks Interim Stabilization Status	B-14
Table B-4.	Single-Shell Tank Interim Stabilization Milestones	B-17
Table B-5.	Single Shell Tank Leak Volume Estimates (Sheet 1 of 6).....	B-19
Table B-6.	Single-Shell Tanks Monitoring Frequency Status (149 Tanks).....	B-25
APPENDIX C:	MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES	C-1
Table C-1.	East and West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities	C-2
Table C-2.	East Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities	C-3
Table C-3.	West Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities	C-4
APPENDIX D:	GLOSSARY OF TERMS	D-1
Table D-1.	Glossary of Terms	D-2
APPENDIX E:	TANK CONFIGURATION AND FACILITIES CHARTS.....	E-1
Figure E-1.	High-Level Waste Tank Configuration	E-2
Figure E-2.	Double-Shell Tank Instrumentation Configuration	E-3
Figure E-3.	Single-Shell Tank Instrumentation Configuration	E-4
Figure E-4.	200 East Tank Waste Contents	E-5/6
Figure E-5.	200 West Tank Waste Contents	E-7/8
Figure E-6.	Tank Farm Facilities Chart - 200 East	E-9/10
Figure E-7.	Tank Farm Facilities Chart - 200 West	E-11/12

METRIC CONVERSION CHART		
1 inch	=	2.54 centimeters
1 foot	=	30.48 centimeters
1 gallon	=	3.79 liters
1 ton	=	0.91 metric tons
$^{\circ}\text{F} = \left(\frac{9}{5} ^{\circ}\text{C} \right) + 32$		
1 Btu/h = 0.2931 watts (International Table)		

WASTE TANK SUMMARY REPORT

For Month Ending March 31, 2003

Note: Changes from the previous month are in **bold print**.

I. WASTE TANK STATUS

Double-Shell Tanks (DST)	28 double-shell	10/86 - date last DST tank was completed
Single-Shell Tanks (SST)	149 single-shell	1966 - date last SST tank was completed
Assumed Leaker Tanks	67 single-shell	07/93 - date last Assumed Leaker was identified
Sound Tanks	28 double-shell 82 single-shell	1986 - date DSTs determined sound 07/93 - date last SST determined Sound
Interim Stabilized Tanks ^a (IS)	133 single-shell	03/03 - date last IS occurred
Not Interim Stabilized ^b	16 single-shell	Tanks still to be Interim Stabilized
Isolated-Intrusion Prevention Completed (IP) ^c	99 single-shell	09/96 - date last IP occurred
Retrieval ^d	9 single-shell	10/02 - date effective
Misc. Underground Storage Tanks (MUST) and Special Surveillance Facilities (Active)	10 Tanks East Area 7 Tanks West Area	03/01 - last date a tank was added or removed from MUST list
Misc. Underground Storage Tanks (IMUST) and Special Surveillance Facilities (Inactive) ^e	18 Tanks East Area 25 Tanks West Area	11/01 - last date a tank was added or removed from IMUST list

^a Of the 133 tanks classified as Interim Stabilized, 65 are listed as Assumed Leakers. (See Table B-5)

^b One of these tanks is an Assumed Leaker (BY-106). (See Table B-5)

^c Nine tanks were recategorized as "Retrieval" (see note ^d below).

^d Tank Status for nine tanks (C-104, C-201, C-202, C-203, C-204, S-102, S-103, S-105 and S-106) was changed to "Retrieval," effective October 2002. (See Table B-1 footnotes – top of page)

^e Tables C-2 and C-3, the Inactive Miscellaneous Underground Storage Tanks (IMUST) now reflect only those tanks managed by CH2M HILL Hanford Group, Inc. (CH2M HILL).

II. WASTE TANK INVESTIGATIONS

This section includes all single- or double-shell tanks or catch tanks which are showing surface level or interstitial liquid level (ILL) decreases, or drywell radiation level increases in excess of established criteria.

A. Assumed Leakers or Assumed Re-leakers: (See Appendix D for definition of "Re-leaker")

This section includes all single- or double-shell tanks or catch tanks for which an off-normal or unusual occurrence report has been issued, or for which a waste tank investigation is in progress, for assumed leaks or re-leaks. Tanks/catch tanks will remain on this list until either
a) completion of Interim Stabilization, b) the updated occurrence report indicates that the tank/catch tank is not an assumed leaker, or c) the investigation is completed.

There are none at this time.

III. SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS

A. Single-Shell Tanks Interim Stabilized (See Table B-1 footnotes and Table B-3 footnotes (#17) for further information)

Tank 241-BY-105 was declared Interim Stabilized on March 7, 2003. Total Waste: 481 Kgallons; Supernatant: 0; DIL: 46.8 Kgallons; DLR: 46.8 Kgallons; PLR: 41.8 Kgallons; Sludge: 48.0 Kgallons; Saltcake: 433.0 Kgallons; total pumped: 45.4 Kgallons.

This confirms partial completion of a Consent Decree Milestone (Project Pumping Completion Date, 241-BY-105), as well as the partial completion of Milestone D-001-009-T01, which requires the completion of pumping of two tanks (BY-105 and BY-106) by June 30, 2003.

B. Single-Shell Tanks Saltwell Pumping (See Table B-1 footnotes for further information)

241-A-101 - Pumping began May 6, 2000. Pumping was shut down and restarted several times from August 2000 through January 2003 due to equipment problems. Pumping was restarted on February 4, 2003, and was shut down and restarted several times since then due to equipment problems. **A total of 14 Kgallons was pumped in March 2003; a total of 531 Kgallons has been pumped since the start of pumping in May 2000.**

241-AX-101 - Pumping began July 29, 2000. Pumping was shut down and restarted several times from August 2000 through January 2003. **Pumping was restarted on February 28, 2003, was shut down and restarted several times during March due to equipment problems; and was shut down as of March 31, 2003. A total of 2 Kgallons was pumped in March 2003; a total of 366 Kgallons has been pumped since the start of pumping in July 2000.**

241-BY-106 - Pumping began in August 1995 and was shut down in October 1995 due to an Unreviewed Safety Question (USQ) evaluation for flammable gas concerns. Pumping was restarted July 11, 2001. Pumping was shut down January 19, 2003, and remained shut down awaiting completion of the 244-BX transfer. In mid-February 2003 attempts were made to restart pumping, which were unsuccessful due to equipment problems. **Pumping was restarted in mid-March 2003. A total of 6 Kgallons was pumped in March 2003; a total of 134 Kgallons has been pumped from this tank since the start of pumping in August 1995.**

241-C-103 - Pumping began November 29, 2002, approximately five months ahead of schedule. Pumping was shut down on January 11, 2003, to replace a pit flush pressure valve; the valve was replaced January 16, 2003. Several restarts and shutdowns occurred in February 2003 due to other equipment problems. A total of 114 Kgallons has been pumped from this tank since the start of pumping in November 2002.

Pumping was completed on March 3, 2003, in anticipation of meeting interim stabilization criteria. A declaration memo stating that this tank has met interim stabilization criteria was sent to DOE-ORP on March 7, 2003. This completes Interim Stabilization Consent Decree Milestone D-001-14-T01, requiring the pumping of tank 241-C-103 to be completed by December 30, 2003.

241-S-101 - Pumping began July 27, 2002. Pumping was restarted on January 16, 2003, and was shut down on January 25, 2003, to support SY exhauster maintenance. Pumping remained shutdown in February 2003 due to equipment problems. **Pumping was restarted on March 30, 2003; a total of 1 Kgallon was pumped in March 2003; a total of 32 Kgallons has been pumped from this tank since the start of pumping in July 2002.**

241-S-102 - Pumping problems have forced many shutdowns. A total of 62 Kgallons has been pumped from this tank since the start of pumping in March 1999. A letter was sent to DOE-ORP in October 2002, requesting that this tank be removed from the Consent Decree stabilization requirements, and that the tank be considered for accelerated retrieval of the waste. See Table B-1 footnotes (top of page B-8) for more information.

241-S-107 - Pumping began September 4, 2002, and shut down in October 2002. **Pumping was restarted December 28, 2002; pumping was shut down and restarted several times since then due to equipment problems. A total of 3 Kgallons was pumped in March 2003; a total of 56 Kgallons has been pumped from this tank since the start of pumping in September 2002.**

241-S-111 - Pumping resumed December 18, 2001. (3 Kgallons were pumped in October 1975). Pumping was shut down and restarted several times from May 2002 to January 2003 due to equipment problems. Pumping was shut on January 25, 2003, due to the hydrogen concentration approaching the control limit. Pumping resumed in February 2003. **A total of 3 Kgallons was pumped in March 2003; a total of 78 Kgallons has been pumped from this tank since the start of pumping in October 1975 (includes 3 Kgallons pumped in 1975).**

241-S-112 - Pumping resumed September 21, 2002. (125 Kgallons were pumped in August 1978.) A total of 5 Kgallons was pumped in October 2002; a total of 133 Kgallons has been pumped from this tank since the start of pumping in August 1978. A letter was sent to DOE-ORP in October 2002, requesting that this tank be removed from the Consent Decree stabilization requirements, and that the tank be considered for accelerated retrieval of the waste. See Table B-1 footnotes (top of page B-8) for more information.

241-SX-101 - Pumping began November 22, 2000. A total of 32 Kgallons has been pumped from this tank since the start of pumping in November 2000. No pumping has occurred since November 2001. Pumping was attempted in July 2002; but the jet pump was found plugged. A Work Package has been prepared to replace the jet pump.

241-SX-102 - Pumping began December 15, 2001; a total of 1 Kgallon was pumped. Pumping was shut down on October 23, 2002, for a control system problem. The pump was restarted on January 30, 2003. **A total of 3 Kgallons was pumped in March 2003; a total of 76 Kgallons has been pumped since the start of pumping in December 2001.**

241-SX-103 - Pumping began October 26, 2000. A total of 134 Kgallons has been pumped from this tank since the start of pumping in October 2000.

This tank was placed under evaluation for meeting Interim Stabilization criteria on September 17, 2002.

241-U-107 - Pumping began September 29, 2001. A letter was sent to DOE-ORP in October 2002, requesting that this tank be removed from the Consent Decree stabilization requirements, and that the tank be considered for accelerated retrieval of the waste. See Table B-1 footnotes (top of page B-8) for further information. **A total of 2 Kgallons was pumped in March 2003; a total of 96 Kgallons has been pumped from this tank since the start of pumping in September 2001.**

Saltcake dissolution began on December 3, 2002, and was suspended on February 20, 2003. Any pumping during that time is associated with retrieval and is not included in interim stabilization pumping volumes. Waste volumes pumped during Saltcake Dissolution Proof of Concept work include both saltcake and water. The actual volume of waste removed from this tank will be calculated upon completion of the Saltcake Dissolution Proof of Concept Test.

241-U-108 - Pumping began December 2, 2001. Pumping was shut down on February 6, 2003, for U-Farm transfer line flushing. Attempts to restart pumping beginning on February 15, 2003, were unsuccessful due to equipment problems. **Pumping was restarted March 28, 2003. A total of 2 Kgallons was pumped in March 2003; a total of 63 Kgallons has been pumped from this tank since the start of pumping in December 2001.**

241-U-111 - Pumping began June 14, 2002. Pumping was shut down on January 5, 2003, and remained down due to transfer line restrictions between U-Farm and SY-Farm. Pumping was restarted and shut down several times during February 2003 due to equipment problems. No pumping since February 2003; a total of 86 Kgallons has been pumped from this tank since the start of pumping in June 2002.

This tank was placed under evaluation for meeting interim stabilization criteria as of March 27, 2003.

C. Waste Transfer from 244-AR Vault to Tank 241-AY-102

A letter was sent from CH2M HILL to DOE-ORP on March 24, 2003, requesting preliminary concurrence to proceed with plans for transfer of the 244-AR Vault waste into Tank 241-AY-102 in FY 2003. Approximately 30,000 gallons of dilute waste and flush water will be transferred. Concurrence is expected in early April 2003. CH2M HILL will first consolidate the wastes into one of the vault's four tanks where the material can be tested for compatibility with wastes in the double-shell tanks.

This page intentionally left blank.

APPENDIX A
DOUBLE-SHELL TANKS
MONTHLY SUMMARY TABLES

TABLE A-1. INVENTORY AND STATUS BY TANK - DOUBLE-SHELL TANKS

March 31, 2003

						WASTE VOLUMES				LAST SAMPLING EVENT			SEE FOOTNOTES FOR THESE CHANGES
TANK	TANK INTEGRITY	WASTE TYPE	EQUIVA- LENT WASTE INCHES	TOTAL WASTE (Kgal)	AVAIL. SPACE (1) (Kgal)	SUPER- NATANT LIQUID (Kgal)	SLUDGE (Kgal)	SALTCAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST CORE SAMPLE	LAST GRAB SAMPLE	LAST VAPOR SAMPLE	
241-AN TANK FARM STATUS													
AN-101	SOUND	DN	91.6	252	892	252	0	0	06/30/99		10/02	04/01	(a)
AN-102	SOUND	CC	392.0	1078	66	944	0	134	12/31/02	06/90	05/02		
AN-103	SOUND	DSS	348.4	958	186	499	0	459	06/30/99	02/00	09/95		
AN-104	SOUND	DSSF	382.9	1053	91	608	0	445	06/30/99	08/00			
AN-105	SOUND	DSSF	409.8	1127	17	589	0	538	01/31/03	12/01			
AN-106	SOUND	CC	59.6	164	980	147	0	17	06/30/99		07/02	06/01	
AN-107	SOUND	CC	393.1	1081	63	847	0	234	09/30/02	02/03	08/02	12/94	
7 DOUBLE-SHELL TANKS			TOTALS:	5713	2295	3886	0	1827					
241-AP TANK FARM STATUS													
AP-101	SOUND	DSSF	404.0	1111	33	1111	0	0	05/01/89		02/00	07/01	(b)
AP-102	SOUND	DN	66.5	183	978	160	23	0	05/31/02		12/01	03/01	
AP-103	SOUND	CC	325.5	895	249	895	0	0	05/31/96		10/02		
AP-104	SOUND	CC	401.1	1103	41	1103	0	0	10/13/88		03/03	11/00	
AP-105	SOUND	DSSF	410.9	1130	14	1041	0	89	06/30/99	03/02	09/96		
AP-106	SOUND	CP	413.8	1138	6	1138	0	0	10/13/88		05/98	05/01	
AP-107	SOUND	DN	84.7	233	911	233	0	0	10/13/88		07/02		
AP-108	SOUND	DN	414.5	1140	4	1140	0	0	10/13/88		01/03		
8 DOUBLE-SHELL TANKS			TOTALS:	6933	2236	6821	23	89					
241-AW TANK FARM STATUS													
AW-101	SOUND	DSSF	409.8	1127	17	731	0	396	01/31/03	02/03	07/00		
AW-102	SOUND	EVFD	30.9	85	1040	55	30	0	01/31/01		12/02		
AW-103	SOUND	DSSF/NCRW	400.0	1100	44	787	273	40	06/30/99	09/99	09/94		
AW-104	SOUND	DSSF	390.5	1074	70	851	66	157	06/30/99	09/01	01/03		
AW-105	SOUND	DN/NCRW	153.5	422	722	159	263	0	06/30/99	09/01	03/03		
AW-106	SOUND	SRCVR	350.9	965	179	726	0	239	06/30/99	03/01	12/02		
6 DOUBLE-SHELL TANKS			TOTALS:	4773	2072	3309	632	832					

TABLE A-1. INVENTORY AND STATUS BY TANK - DOUBLE-SHELL TANKS

March 31, 2003

						WASTE VOLUMES				LAST SAMPLING EVENT			SEE FOOTNOTES FOR THESE CHANGES
			EQUIVA- LENT	TOTAL	AVAIL. SPACE	SUPER- NATANT			SOLIDS	LAST	LAST	LAST	
TANK	TANK INTEGRITY	WASTE TYPE	WASTE INCHES	WASTE (Kgal)	(1) (Kgal)	LIQUID (Kgal)	SLUDGE (Kgal)	SALTCAKE (Kgal)	VOLUME UPDATE	CORE SAMPLE	GRAB SAMPLE	VAPOR SAMPLE	
<u>241-AY TANK FARM STATUS</u>													
AY-101	SOUND	DC	65.1	179	822	83	96	0	06/30/99	04/02	02/01		
AY-102	SOUND	DN	249.8	687	314	516	171	0	07/31/02	04/02	11/02	12/98	
2 DOUBLE-SHELL TANKS			TOTALS:	866	1136	599	267	0					
<u>241-AZ TANK FARM STATUS</u>													
AZ-101	SOUND	AW	360.0	990	11	938	52	0	06/30/98	08/00	06/00	04/00	
AZ-102	SOUND	AW	358.9	987	14	882	105	0	06/30/99	07/02	10/01		
2 DOUBLE-SHELL TANKS			TOTALS:	1977	25	1820	157	0					
<u>241-SY TANK FARM STATUS</u>													
SY-101	SOUND	CC	406.9	1119	25	844	0	275	06/30/99	03/99	11/02		
SY-102	SOUND	DN/PT	307.6	846	282	701	145	0	06/30/99	11/00	12/02	09/00	
SY-103	SOUND	CC	268.0	737	407	395	0	342	06/30/99	03/00			
3 DOUBLE-SHELL TANKS			TOTALS:	2702	714	1940	145	617					
GRAND TOTAL				22964	8478	18375	1224	3365					

Note: +/- 1 Kgal differences are the result of computer rounding

Maximum volume limits per OSD-T-151-00007, "Operating Specifications for Double-Shell Storage Tanks," Rev. I-0, dated October 2002.

Tank Farms

AN 1144 Kgal
 AP 1144 Kgal
 AW 1144 Kgal
 AY, AZ 1001 Kgal
 SY 1144 Kgal

Exceptions:

AP-102 1161 Kgal Per PM-02-060, 12/02 - see below
 AW-102 1125 Kgal
 SY-102 1128 Kgal

NOTE: Supernatant + Sludge (includes liquid) + Saltcake (includes liquid) = Total Waste

(1) Available Space volumes include restricted space

(a) BBI quarterly review resulted in changes to AN-102 (saltcake decreased and supernatant increased by 6 Kgal), effective December 31, 2002.

(b) Maximum Operating Liquid Level was changed from 1144 Kgal to 1161 Kgal for Tank AP-102, per Process Memo PM-02-060, dated December 2002.

**TABLE A-2. DOUBLE-SHELL TANK SPACE ALLOCATION, INVENTORY AND
WASTE RECEIPTS (ALL VOLUMES IN KGALS)
March 31, 2003**

TOTAL DST CAPACITY	
(**)NON-AGING =	27,438
AGING =	4,004
TOTAL=	31,442

MONTHLY INVENTORY CHANGE	
INVENTORY ON 03/31/03	22,964
INVENTORY ON 02/28/03	22,983
CHANGE =	-19

CALCULATION OF REMAINING SPACE	
TOTAL DST CAPACITY =	31,442
WASTE INVENTORY =	-22,964
DEDICATED OPERATIONAL SPACE =	-3,459
(*) RESTRICTED USAGE SPACE =	-2,093
EMERGENCY SPACE ALLOCATION =	-1,144
SPACE ALLOCATED FOR WASTE TREATMENT PLANT RETURNS =	-1,144
REMAINING AVAILABLE SPACE =	638

(*) Restricted Usage Space Adjusted in December 2002 to align with DOE requirements on Restricted Usage Space.

(**) Tank AP-102 Maximum Liquid Level Increased from 1144 to 1161 Kgallons in December 2002.

MARCH DST WASTE RECEIPTS					
FACILITY GENERATIONS		OTHER GAINS ASSOCIATED WITH		OTHER LOSSES ASSOCIATED WITH	
SALTWELL LIQUID (WEST)	27	SLURRY	2	SLURRY	-9
(*)SALTWELL LIQUID (EAST)	60	CONDENSATE	0	CONDENSATE	-4
TANK FARMS	15	INSTRUMENTATION	0	INSTRUMENTATION	0
242A FLUSH & POT DUMP	37	UNKNOWN	3	UNKNOWN	-5
TOTAL =	139	TOTAL=	5	TOTAL=	-18

(*) Does not include BY-106 transfer to 244-BX (6 Kgal SWL + 10 Kgal H2O)

PROJECTED VERSUS ACTUAL WASTE VOLUMES						
	ACTUAL DST WASTE RECEIPTS	PROJECTED DST WASTE RECEIPTS (1)	MISC. DST CHANGES (+/-)	WVR	NET DST CHANGE	TOTAL DST VOLUME
10/02	119	N/A	-18	0	101	23,292
11/02	106	N/A	-11	-417	-322	22,970
12/02	213	N/A	-16	0	197	23,167
01/03	115	N/A	0	-306	-201	22,966
02/03	152	N/A	2	-137	17	22,983
03/03	139	N/A	-13	-145	-19	22,964
04/03	0	N/A	0	0	0	22,964
05/03	0	N/A	0	0	0	22,964
06/03	0	N/A	0	0	0	22,964
07/03	0	N/A	0	0	0	22,964
08/03	0	N/A	0	0	0	22,964
09/03	0	N/A	0	0	0	22,964

(1) The "PROJECTED DST WASTE RECEIPTS" and "WVR" numbers will be updated once the Performance Based Incentive (PBI) agreement is in place with processing schedules and assumptions defined.

(2) Total Waste Volume Reduction (WVR) through the 242A Evaporator since restart on 4/15/94 = 12,693 Kgals.

TABLE A-3. DOUBLE-SHELL TANKS MONITORING FREQUENCY STATUS (28 Tanks)
March 31, 2003

<u>Legend:</u>	
E	ENRAF Level Gauge
D, W, Q	Daily, Weekly, Quarterly

All data were collected in accordance with Technical Safety Requirement (TSR) and Operating Specification Documents (OSD).

Tank	Surface Level Device (1)	Frequency	Thermocouple Tree Risers (2)	Temperature Frequency	Annulus Leak Detector Probes	Leak Detector Frequency
AN-101	E	D	4A*	W	3	D
AN-102	E	D	4A*	W	3	D
AN-103	E	D	4A*, 15A*	W	3	D
AN-104	E	D	4A*, 15A*	W	3	D
AN-105	E	D	4A*, 15A*	W	3	D
AN-106	E	D	4A*	W	3	D
AN-107	E	D	4A*	W	3	D
AP-101	E	D	4	W	3	D
AP-102	E	D	4	W	3	D
AP-103	E	D	4	W	3	D
AP-104	E	D	4	W	3	D
AP-105	E	D	4	W	3	D
AP-106	E	D	4	W	3	D
AP-107	E	D	4	W	3	D
AP-108	E	D	4	W	3	D
AW-101	E	D	6*, 17*	W	3	D
AW-102	E	D	6*	W	3	D
AW-103	E	D	6*	W	3	D
AW-104	E	D	6*	W	3	D
AW-105	E	D	6*	W	3	D
AW-106	E	D	6*	W	3	D
AY-101	E	D	Multiple*	W	3	D
AY-102	E	D	Multiple*	W	3	D
AZ-101	E	D	Multiple*	W	3	D
AZ-102	E	D	Multiple*	W	3	D
SY-101	E (3)	D	17B*, 17C*	W	3	D
SY-102	E	D	4A*	W	3	D
SY-103	E	D	4A*, 17B*	W	3	D

Footnotes:

1. All DST ENRAFs are connected to TMACS for continuous remote monitoring. All equipment connected to TMACS collects data multiple times per day regardless of required frequency.
2. Thermocouple tree risers followed by an asterisk (*) are connected to TMACS for continuous remote monitoring. AY and AZ farms have too many thermocouple elements to list individually. Most are monitored electronically.
3. SY-101 has two ENRAF surface level devices (in Risers 1A and 1C).

This page intentionally left blank.

APPENDIX B
SINGLE-SHELL TANKS
MONTHLY SUMMARY TABLES

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

March 31, 2003

The SST volume estimates were derived from the Best-Basis Inventory baselining task, dated January 1, 2002, and represent the official waste volume estimates for Hanford's waste storage tanks. The interstitial liquid estimates for pumpable liquid remaining (PLR) and drainable linterstitial liquid (DIL) were calculated from these volumes using the waste phase drainable porosities per Updated Liquid Volume Estimates (HNF-2978 and RPP-5556). BBI quarterly adjustments are ongoing and are reflected below where applicable.

Sludge and Saltcake volumes include any Retained Gas, with the exception of AX-101.

				WASTE VOLUMES										PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES
TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	SUPER- NATANT	DRAINABLE INTERSTITIAL	PUMPED THIS MONTH	TOTAL PUMPED	DRAINABLE LIQUID REMAINING	PUMPABLE LIQUID REMAINING	SLUDGE (Kgal)	CAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST	LAST		
				LIQUID (Kgal)	LIQUID (Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)				IN-TANK PHOTO	IN-TANK VIDEO		
241-A TANK FARM STATUS																
A-101	SOUND	/PI	428	-	-	14	531	-	-	4	424	03/31/03	08/21/85	(a)		
A-102	SOUND	IS/PI	40	3	9	0	40	11	2	0	37	01/31/03	07/20/89			
A-103	ASMD LKR	IS/IP	371	5	87	0	111	91	84	2	364	01/01/02	12/28/88			
A-104	ASMD LKR	IS/IP	28	0	0	0	0	4	0	28	0	01/27/78	06/25/86			
A-105	ASMD LKR	IS/IP	37	0	0	0	0	0	0	37	0	10/31/00	08/20/86			
A-106	SOUND	IS/IP	79	0	9	0	0	9	1	50	29	01/01/02	08/19/86			
6 TANKS - TOTALS			983							121	854					
241-AX TANK FARM STATUS																
AX-101	SOUND	/PI	322	-	-	2	366	-	-	3	319	03/31/03	08/18/87	(b)		
AX-102	ASMD LKR	IS/IP	30	0	0	0	13	0	0	6	24	01/01/02	06/05/89			
AX-103	SOUND	IS/IP	108	0	22	0	0	22	10	8	100	01/01/02	08/13/87			
AX-104	ASMD LKR	IS/IP	7	0	0	0	0	0	0	7	0	01/01/02	08/18/87			
4 TANKS - TOTALS			467							24	443					
241-B TANK FARM STATUS																
B-101	ASMD LKR	IS/IP	109	0	20	0	0	20	16	28	81	01/01/02	05/19/83			
B-102	SOUND	IS/IP	32	4	7	0	0	11	4	0	28	06/30/99	08/22/85			
B-103	ASMD LKR	IS/IP	56	0	10	0	0	10	2	1	55	01/01/02	10/13/88			
B-104	SOUND	IS/IP	374	0	45	0	0	45	41	309	65	01/01/02	10/13/88			
B-105	ASMD LKR	IS/IP	290	0	20	0	0	20	16	28	262	01/01/02	05/19/88			
B-106	SOUND	IS/IP	122	1	8	0	0	9	2	121	0	01/01/02	02/28/85			
B-107	ASMD LKR	IS/IP	161	0	23	0	0	23	18	86	75	01/01/02	02/28/85			
B-108	SOUND	IS/IP	91	0	19	0	0	19	15	27	64	01/31/03	05/10/85			
B-109	SOUND	IS/IP	125	0	23	0	0	23	19	50	75	01/01/02	04/02/85			
B-110	ASMD LKR	IS/IP	245	1	27	0	0	28	23	244	0	01/01/02	03/17/88			
B-111	ASMD LKR	IS/IP	242	1	23	0	0	24	20	241	0	01/01/02	06/26/85			
B-112	ASMD LKR	IS/IP	35	3	2	0	0	5	1	15	17	01/01/02	05/29/85			
B-201	ASMD LKR	IS/IP	30	0	5	0	0	5	0	30	0	01/01/02	11/12/86		06/23/95	
B-202	SOUND	IS/IP	29	0	4	0	0	4	0	29	0	01/01/02	05/29/85		06/15/95	
B-203	ASMD LKR	IS/IP	52	1	5	0	0	6	1	51	0	01/01/02	11/13/86			
B-204	ASMD LKR	IS/IP	51	1	5	0	0	6	1	50	0	01/01/02	10/22/87			
16 TANKS - TOTALS			2044							1310	722					

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

March 31, 2003

The SST volume estimates were derived from the Best-Basis Inventory baselining task, dated January 1, 2002, and represent the official waste volume estimates for Hanford's waste storage tanks. The interstitial liquid estimates for pumpable liquid remaining (PLR) and drainable interstitial liquid (DIL) were calculated from these volumes using the waste phase drainable porosities per Updated Liquid Volume Estimates (HNF-2978 and RPP-5556).

BBI quarterly adjustments are ongoing and are reflected below where applicable.

Sludge and Saltcake volumes include Retained Gas.

				WASTE VOLUMES										PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES
TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	SUPER- NATANT	DRAINABLE INTERSTITIAL	PUMPED THIS MONTH	TOTAL PUMPED	DRAINABLE LIQUID REMAINING	PUMPABLE LIQUID REMAINING	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST	LAST		
				LIQUID (Kgal)	LIQUID (Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)				IN-TANK PHOTO	IN-TANK VIDEO		
241-BX TANK FARM STATUS																
BX-101	ASMD LKR	IS/IP/CCS	48	0	4	0	0	4	0	48	0	01/01/02	11/24/88	11/10/94		
BX-102	ASMD LKR	IS/IP/CCS	112	0	0	0	0	0	0	112	0	04/28/82	09/18/85			
BX-103	SOUND	IS/IP/CCS	73	11	4	0	0	15	11	62	0	11/29/83	10/31/86	10/27/94		
BX-104	SOUND	IS/IP/CCS	100	3	4	0	17	7	3	97	0	01/01/02	09/21/89			
BX-105	SOUND	IS/IP/CCS	72	5	4	0	15	9	5	67	0	01/01/02	10/23/86			
BX-106	SOUND	IS/IP/CCS	38	0	4	0	14	4	0	38	0	08/01/95	05/19/88	07/17/95		
BX-107	SOUND	IS/IP/CCS	347	0	37	0	23	37	33	347	0	09/18/90	09/11/90			
BX-108	ASMD LKR	IS/IP/CCS	31	0	4	0	0	4	0	31	0	01/31/01	05/05/94			
BX-109	SOUND	IS/IP/CCS	193	0	25	0	8	25	20	193	0	09/17/90	09/11/90			
BX-110	ASMD LKR	IS/IP/CCS	205	1	35	0	2	36	31	65	139	01/01/02	07/15/94	10/13/94		
BX-111	ASMD LKR	IS/IP/CCS	189	0	6	0	117	6	2	32	157	01/01/02	05/19/94	02/28/95		
BX-112	SOUND	IS/IP/CCS	164	1	9	0	4	10	7	163	0	01/01/02	09/11/90			
12 TANKS - TOTALS			1572							1255	296					
241-BY TANK FARM STATUS																
BY-101	SOUND	IS/IP	370	0	24	0	36	24	20	37	333	01/01/02	09/19/89		(c) (d)	
BY-102	SOUND	IS/PI	277	0	40	0	159	40	33	0	277	05/01/95	09/11/87	04/11/95		
BY-103	ASMD LKR	IS/PI	417	0	58	0	96	58	53	9	408	01/31/03	09/07/89	02/24/97		
BY-104	SOUND	IS/IP	358	0	51	0	330	51	46	45	313	01/01/02	04/27/83			
BY-105	ASMD LKR	IS/PI	481	0	47	0	45	47	42	48	433	03/31/03	07/01/86			
BY-106	ASMD LKR	/PI	490	-	-	6	134	-	-	32	458	03/31/03	11/04/82			
BY-107	ASMD LKR	IS/IP	271	0	42	0	56	42	37	15	256	01/31/03	10/15/86			
BY-108	ASMD LKR	IS/IP	222	0	33	0	28	33	26	40	182	01/01/02	10/15/86			
BY-109	SOUND	IS/PI	277	0	37	0	157	37	32	24	253	01/01/02	06/18/97			
BY-110	SOUND	IS/IP	366	0	20	0	213	20	15	43	323	01/01/02	07/26/84			
BY-111	SOUND	IS/IP	302	0	14	0	313	14	6	0	302	01/01/02	10/31/86			
BY-112	SOUND	IS/IP	286	0	24	0	116	24	12	2	284	03/31/02	04/14/88			
12 TANKS - TOTALS			4117							295	3822					

HNF-EP-0182, Rev. 180

B-3

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

March 31, 2003

The SST volume estimates were derived from the Best-Basis Inventory baselining task, dated January 1, 2002, and represent the official waste volume estimates for Hanford's waste storage tanks. The interstitial liquid estimates for pumpable liquid remaining (PLR) and drainable interstitial liquid (DIL) were calculated from these volumes using the waste phase drainable porosities per Updated Liquid Volume Estimates (HNF-2978 and RPP-5556)

BBI quarterly adjustments are ongoing and are reflected below where applicable.

Sludge and Saltcake volumes include Retained Gas. Tank Status for C-104, C-202 through C-204, S-102, S-103, S-105, and S-106 changed to "Retrieval."

Sludge and Surfactant Volumes Include Retained Gas. Tank Status for C-104, C-202 through C-204, S-102, S-103, S-105, and S-106 changed to Removal.																
				WASTE VOLUMES										PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES
TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	SUPER- NATANT LIQUID (Kgal)	DRAINABLE INTERSTITIAL LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	PUMPABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO		
241-C TANK FARM STATUS																
C-101	ASMD LKR	IS/IP	88	0	4	0	0	4	0	88	0	11/29/83	11/17/87	(e)		
C-102	SOUND	IS/IP	316	0	62	0	47	62	55	316	0	09/30/95	05/18/76		08/24/95	
C-103	SOUND	/PI	90	-	-	0	114	-	-	90	0	03/31/03	07/28/87			
C-104	SOUND	IS/R	259	0	29	0	0	29	25	259	0	01/01/02	07/25/90			
C-105	SOUND	IS/PI	132	0	10	0	0	10	6	132	0	02/29/00	08/05/94		08/30/95	
C-106	SOUND	/PI	29	20	20	0	0	20	0	9	0	03/31/03	08/05/94		08/08/94	
C-107	SOUND	IS/IP	248	0	30	0	41	30	25	248	0	01/01/02	00/00/00			
C-108	SOUND	IS/IP	66	0	4	0	0	4	0	66	0	02/24/84	12/05/74		11/17/94	
C-109	SOUND	IS/IP	64	0	4	0	0	4	0	64	0	01/31/03	01/30/76			
C-110	ASMD LKR	IS/IP	178	1	37	0	16	38	30	177	0	06/14/95	08/12/86		05/23/95	
C-111	ASMD LKR	IS/IP	58	0	4	0	0	4	0	58	0	01/31/03	02/25/70		02/02/95	
C-112	SOUND	IS/IP	104	0	6	0	0	6	1	104	0	09/18/90	09/18/90			
C-201	ASMD LKR	IS/R	1	0	0	0	0	0	0	1	0	01/01/02	12/02/86			
C-202	ASMD LKR	IS/R	1	0	0	0	0	0	0	1	0	01/19/79	12/09/86			
C-203	ASMD LKR	IS/R	3	0	0	0	0	0	0	3	0	01/31/03	12/09/86			
C-204	ASMD LKR	IS/R	2	0	0	0	0	0	0	2	0	01/31/03	12/09/86			
16 TANKS - TOTALS			1639								1618	0				
241-S TANK FARM STATUS																
S-101	SOUND	/PI	393	-	-	1	32	-	-	122	271	03/31/03	03/18/88	(f)		
S-102	SOUND	/R	439	-	-	0	62	-	-	22	417	12/31/02	03/18/88	(g)		
S-103	SOUND	IS/R	238	1	45	0	24	46	39	9	228	01/31/03	06/01/89	01/28/00		
S-104	ASMD LKR	IS/IP	288	0	49	0	0	49	45	132	156	12/20/84	12/12/84			
S-105	SOUND	IS/R	406	0	42	0	114	42	33	2	404	01/01/02	04/12/89			
S-106	SOUND	IS/R	455	0	26	0	204	26	18	0	455	02/28/01	03/17/89	01/28/00		
S-107	SOUND	/PI	320	-	-	3	56	-	-	300	20	03/31/03	03/12/87	(h)		
S-108	SOUND	IS/PI	550	0	4	0	200	4	0	5	545	01/01/02	03/12/87	12/03/96		
S-109	SOUND	IS/PI	533	0	16	0	34	16	12	13	520	06/30/01	12/31/98			
S-110	SOUND	IS/PI	389	0	30	0	203	30	27	96	293	01/01/02	03/12/87	12/11/96		
S-111	SOUND	/PI	457	-	-	3	78	-	-	75	382	03/31/03	08/10/89	(i)		
S-112	SOUND	/PI	614	-	-	0	133	-	-	6	608	01/31/03	03/24/87	(j)		
12 TANKS - TOTALS			5082								782	4299				

B-4

HNF-EP-0182, Rev. 180

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

March 31, 2003

The SST volume estimates were derived from the Best-Basis Inventory baselining task, dated January 1, 2002, and represent the official waste volume estimates for Hanford's waste storage tanks. The interstitial liquid estimates for pumpable liquid remaining (PLR) and drainable interstitial liquid (DIL) were calculated from these volumes using the waste phase drainable porosities per Updated Liquid Volume Estimates (HNF-2978 and RPP-5556).

BBI quarterly adjustments are ongoing and are reflected below where applicable.

Sludge and Saltcake volumes include Retained Gas.

				WASTE VOLUMES								PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES
TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	SUPER- NATANT LIQUID (Kgal)	DRAINABLE INTERSTITIAL LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	PUMPABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO
241-SX TANK FARM STATUS														
SX-101	SOUND	/PI	413	-	-	0	32	-	-	144	269	08/31/02	03/10/89	(k)
SX-102	SOUND	/PI	429	-	-	3	76	-	-	55	374	03/31/03	01/07/88	(l)
SX-103	SOUND	/PI	491	-	-	0	134	-	-	78	413	03/31/03	12/17/87	(m)
SX-104	ASMD LKR	IS/PI	446	0	48	0	231	48	39	136	310	04/30/00	09/08/88	02/04/98
SX-105	SOUND	IS /PI	375	0	39	0	153	39	35	63	312	12/31/02	06/15/88	
SX-106	SOUND	IS/PI	396	0	37	0	148	37	31	0	396	01/31/03	06/01/89	
SX-107	ASMD LKR	IS/IP	95	0	7	0	0	7	3	79	16	01/01/02	03/06/87	
SX-108	ASMD LKR	IS/IP	73	0	0	0	0	0	0	73	0	01/01/02	03/06/87	
SX-109	ASMD LKR	IS/IP	241	0	0	0	0	0	0	58	183	01/01/02	05/21/86	
SX-110	ASMD LKR	IS/IP	56	0	0	0	0	0	0	29	27	01/01/02	02/20/87	
SX-111	ASMD LKR	IS/IP	115	0	11	0	0	11	7	76	39	01/01/02	06/09/94	
SX-112	ASMD LKR	IS/IP	75	0	6	0	0	6	2	56	19	01/01/02	03/10/87	
SX-113	ASMD LKR	IS/IP	19	0	0	0	0	0	0	19	0	01/01/02	03/18/88	
SX-114	ASMD LKR	IS/IP	155	0	30	0	0	30	26	41	114	01/31/02	02/26/87	
SX-115	ASMD LKR	IS/IP	4	0	0	0	0	0	0	4	0	01/01/02	03/31/88	
15 TANKS - TOTALS:			3383							911	2472			

241-T TANK FARM STATUS															
T-101	ASMD LKR	IS/PI	100	0	16	0	25	16	12	37	63	01/01/02	04/07/93		
T-102	SOUND	IS/IP	32	13	3	0	0	16	13	19	0	08/31/84	06/28/89		
T-103	ASMD LKR	IS/IP	27	4	3	0	0	7	4	23	0	11/29/83	07/03/84		
T-104	SOUND	IS/PI	317	0	31	0	150	31	27	317	0	11/30/99	06/29/89	10/07/99	
T-105	SOUND	IS/IP	98	0	5	0	0	5	0	98	0	05/29/87	05/14/87		
T-106	ASMD LKR	IS/IP	22	0	0	0	0	0	0	22	0	01/01/01	06/29/89		
T-107	ASMD LKR	IS/PI	173	0	34	0	11	34	28	173	0	05/31/96	07/12/84	05/09/96	
T-108	ASMD LKR	IS/IP	16	0	4	0	0	4	0	5	11	01/01/01	07/17/84		

B-5

HNF-EP-0182, Rev. 180

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

March 31, 2003

The SST volume estimates were derived from the Best-Basis Inventory baselining task, dated January 1, 2002, and represent the official waste volume estimates for Hanford's waste storage tanks. The interstitial liquid estimates for pumpable liquid remaining (PLR) and drainable interstitial liquid (DIL) were calculated from these volumes using the waste phase drainable porosities per Updated Liquid Volume Estimates (HNF-2978 and RPP 5556).

BBI quarterly adjustments are ongoing and are reflected below where applicable.

Sludge and Saltcake volumes include Retained Gas.

				WASTE VOLUMES								PHOTOS/VIDES		SEE		
TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	SUPER-NATANT LIQUID (Kgal)	DRAINABLE INTERSTITIAL LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	PUMPABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	CAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO	FOOTNOTES FOR THESE CHANGES	
T-109	ASMD LKR	IS/IP	62	0	11	0	0	11	4	0	62	01/01/02	02/25/93			
T-110	SOUND	IS/PI	370	1	48	0	50	48	43	369	0	03/31/02	07/12/84	10/07/99		
T-111	ASMD LKR	IS/PI	447	0	38	0	10	38	35	447	0	01/01/02	04/13/94	02/13/95		
T-112	SOUND	IS/IP	67	7	4	0	0	11	7	60	0	04/28/82	08/01/84			
T-201	SOUND	IS/IP	31	2	4	0	0	6	2	29	0	01/01/02	04/15/86			
T-202	SOUND	IS/IP	21	0	3	0	0	3	0	21	0	07/12/81	07/06/89			
T-203	SOUND	IS/IP	37	0	5	0	0	5	0	37	0	01/01/02	08/03/89			
T-204	SOUND	IS/IP	37	0	5	0	0	5	0	37	0	01/01/02	08/03/89			
16 TANKS - TOTALS			1857								1694	136				

241-TX TANK FARM STATUS

TX-101	SOUND	IS/IP/CCS	91	0	7	0	0	7	3	74	17	01/01/02	10/24/85		
TX-102	SOUND	IS/IP/CCS	217	0	27	0	94	27	16	2	215	03/31/03	10/31/85		
TX-103	SOUND	IS/IP/CCS	145	0	18	0	68	18	11	0	145	01/01/02	10/31/85		
TX-104	SOUND	IS/IP/CCS	68	2	9	0	4	12	7	34	32	01/01/02	10/16/84		
TX-105	ASMD LKR	IS/IP/CCS	576	0	25	0	122	25	14	8	568	01/01/02	10/24/89		
TX-106	SOUND	IS/IP/CCS	348	0	37	0	135	37	30	5	343	03/31/02	10/31/85		
TX-107	ASMD LKR	IS/IP/CCS	29	0	7	0	0	7	0	0	29	01/31/03	10/31/85		
TX-108	SOUND	IS/IP/CCS	129	0	8	0	14	8	1	6	123	01/01/02	09/12/89		
TX-109	SOUND	IS/IP/CCS	363	0	6	0	72	6	2	363	0	01/01/02	10/24/89		
TX-110	ASMD LKR	IS/IP/CCS	467	0	14	0	115	14	10	37	430	01/01/02	10/24/89		
TX-111	SOUND	IS/IP/CCS	365	0	10	0	98	10	6	43	322	01/01/02	09/12/89		
TX-112	SOUND	IS/IP/CCS	634	0	26	0	94	26	21	0	634	01/01/02	11/19/87		
TX-113	ASMD LKR	IS/IP/CCS	639	0	18	0	19	18	14	93	546	01/01/02	04/11/83	09/23/94	
TX-114	ASMD LKR	IS/IP/CCS	532	0	17	0	104	17	11	4	528	01/01/02	04/11/83	02/17/95	
TX-115	ASMD LKR	IS/IP/CCS	554	0	25	0	99	25	15	9	545	01/31/03	06/15/88		
TX-116	ASMD LKR	IS/IP/CCS	598	0	21	0	24	21	17	66	532	12/31/02	10/17/89		
TX-117	ASMD LKR	IS/IP/CCS	481	0	10	0	54	10	5	29	452	01/01/02	04/11/83		
TX-118	SOUND	IS/IP/CCS	256	0	31	0	89	31	27	0	256	01/01/02	12/19/79		
18 TANKS - TOTALS			6492							773	5717				

HNF-EP-0182, Rev. 180

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

March 31, 2003

The SST volume estimates were derived from the Best-Basis Inventory baselining task, dated January 1, 2002, and represent the official waste volume estimates for Hanford's waste storage tanks. The interstitial liquid estimates for pumpable liquid remaining (PLR) and drainable interstitial liquid (DIL) were calculated from these volumes using the waste phase drainable porosities per Updated Liquid Volume Estimates (HNF-2978 and RPP-5556).

BBI quarterly adjustments are ongoing and are reflected below where applicable.

Sludge and Saltcake volumes include Retained Gas.

				WASTE VOLUMES										PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES
TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	SUPER- NATANT	DRAINABLE INTERSTITIAL	PUMPED THIS MONTH	TOTAL PUMPED	DRAINABLE LIQUID REMAINING	PUMPABLE LIQUID REMAINING	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO		
				LIQUID (Kgal)	LIQUID (Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)							
241-TY TANK FARM STATUS																
TY-101	ASMD LKR	IS/IP/CCS	119	0	2	0	8	2	0	72	47	01/31/03	08/22/89			
TY-102	SOUND	IS/IP/CCS	69	0	13	0	7	13	6	0	69	01/01/02	07/07/87			
TY-103	ASMD LKR	IS/IP/CCS	155	0	23	0	12	23	19	103	52	01/01/02	08/22/89			
TY-104	ASMD LKR	IS/IP/CCS	44	1	4	0	0	5	1	43	0	03/31/02	11/03/87			
TY-105	ASMD LKR	IS/IP/CCS	231	0	12	0	4	12	10	231	0	04/28/82	09/07/89			
TY-106	ASMD LKR	IS/IP/CCS	16	0	1	0	0	1	0	16	0	01/01/02	08/22/89			
6 TANKS - TOTALS			634							465	168					
241-U TANK FARM STATUS																
U-101	ASMD LKR	IS/IP	24	0	4	0	0	4	0	24	0	01/01/02	06/19/79			
U-102	SOUND	IS /PI	327	1	37	0	87	38	34	43	283	12/31/02	06/08/89			
U-103	SOUND	IS/PI	417	1	33	0	99	34	28	11	405	12/31/02	09/13/88			
U-104	ASMD LKR	IS/IP	122	0	0	0	0	0	0	122	0	01/01/02	08/10/89			
U-105	SOUND	IS/PI	353	0	44	0	88	44	40	32	321	03/30/01	07/07/88			
U-106	SOUND	IS/PI	172	3	36	0	39	38	31	0	169	01/31/03	07/07/88			
U-107	SOUND	/PI	309	-	-	2	96	-	-	15	294	03/31/03	10/27/88	(n)		
U-108	SOUND	/PI	405	-	-	2	63	-	-	29	376	03/31/03	09/12/84	(o)		
U-109	SOUND	IS/PI	401	0	47	0	78	47	43	35	366	04/30/02	07/07/88			
U-110	ASMD LKR	IS/PI	176	0	16	0	0	16	1	176	0	01/01/02	12/11/84			
U-111	SOUND	/PI	254	-	-	0	86	-	-	25	229	03/31/03	06/23/88	(p)		
U-112	ASMD LKR	IS/IP	45	0	4	0	0	4	0	45	0	02/10/84	08/03/89			
U-201	SOUND	IS/IP	5	1	1	0	0	2	1	4	0	08/15/79	08/08/89			
U-202	SOUND	IS/IP	5	1	0	0	0	1	1	4	0	01/31/03	08/08/89			
U-203	SOUND	IS/IP	5	1	0	0	0	1	1	4	0	01/31/03	06/13/89			
U-204	SOUND	IS/IP	4	1	0	0	0	1	1	3	0	01/01/02	06/13/89			
16 TANKS - TOTALS			3024							572	2443					
GRAND TOTAL			31294							9820	21372					

Notes: (1) The total waste volume includes a volume of retained gas that was calculated from tank measurements. Five tanks are affected: A-101, S-102, S-111, U-103, and U-109.

Gas in AX-101 is assumed to have dissipated since pumping began.

(2) +/- 1 Kgal difference in volumes is due to rounding

HNF-EP-0182, Rev. 180

TABLE B-1. INVENTORY AND STATUS BY TANK – SINGLE-SHELL TANKS
March 31, 2003

Footnotes:

Stabilization information is from WHC-SD-RE-TI-178, "SST Stabilization Record," latest revision, or from the SST Stabilization Project, or the System Engineer.

Initial estimated Pumpable Liquid volumes (below) are based on HNF-2978, Rev. 4, "Updated Pumpable Liquid Volume Estimates and Jet Pump Operations for Interim Stabilization of Remaining Single-Shell Tanks," dated June 30, 2002.

Best Basis Inventory (BBI) 2003 1st Qtr review resulted in volume changes to the following tanks effective December 31, 2002: A-101, AX-101, BY-106, C-103, S-101, S-102, S-111, SX-105, TX-116, U-102, U-107, and U-111 (S-107 and U-108 were evaluated but no changes resulted).

BBI 2003 2nd Qtr review is ongoing and volume changes are included as applicable.

1 Kgal adjustments were made to tanks A-103, B-108, BY-103, BY-107, C-103, C-109, C-111, S-101, S-103, SX-106, TX-102, TX-104, TX-107, TX-115, TY-101, U-106, U-107, U-111, U-202, and U-203, to match the Tank Transfer Database (TXFR), January 31, 2003.

HNF-2978, Rev. 4, resulted in changes to the following tanks, effective June 30, 2002: A-101, AX-101, BY-105, BY-106, C-103, S-101, S-102, S-107, S-111, S-112, SX-101, SX-102, SX-103, U-107, U-108, and U-111.

Tank Status for C-104, C-201, C-202, C-203, C-204, S-102, S-103, S-105, and S-106 was changed from Intrusion Prevention to "Retrieval" effective October 2002.

Letter to DOE-ORP, CHG-0203601 R1, dated October 15, 2002, requests that tanks S-102, S-112, and U-107 be removed from the Consent Decree stabilization requirements, and that the tanks be considered for accelerated retrieval of the waste. CH2M HILL recommends that waste retrieval and pumping commence prior to achieving the interim stabilization endpoint, as currently defined in the Interim Stabilization Consent Decree. This initiative will achieve the objective of early removal of waste from aging Single-Shell Tanks and will require an amendment to the Interim Stabilization Consent Decree.

(a) A-101 Initial estimated Pumpable Liquid volume: 610 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began on May 6, 2000. No pumping occurred from July 12, 2000, until January 17, 2002, when pumping resumed. Pumping was shut down March 27, 2002, due to high transfer line pressure; pumping resumed April 20, 2002.

Volumes reported in May 2002 and subsequent months reflect an error associated with the readings from the flowmeter (approximately a 1% deviation - the flowmeter is reading high). The final amount of waste transferred at the end of saltwell pumping will be adjusted to correct for this error; until then the volumes reported will be the actual volumes on the procedure data sheets.

The BBI quarterly update for December 31, 2002, indicates that this tank included interstitial liquid and gas, and it is assumed that the gas was dissipated during pumping; volumes have been adjusted to reflect this change. The total waste volume was reduced by 99 Kgal. **In March 2003, the BBI did a reevaluation and added the retained gas back into the saltcake resulting in an increase in the saltcake and total waste.**

Pumping was shut down on December 19, 2002, due to transducer failure. After three failed transducers were replaced shutdown continued due to failure of two valves in the A-B valve pit. No pumping occurred in January 2003. Pumping was restarted in February 2003.

Final volumes will be determined at completion of Interim Stabilization.

(b) AX-101 Initial estimated Pumpable Liquid volume: 365 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began July 29, 2000, shut down on August 11, 2000, and resumed March 22, 2001. Pumping was shut down April 3, 2001, due to failure of the transfer line. Pumping resumed

February 1, 2002, and was shut down again March 28, 2002, due to alarm #40 Power Monitor. Pumping was resumed April 9, 2002.

Volumes reported in May 2002 and subsequent months reflect an error associated with the readings from the flowmeter (approximately a 1% deviation - the flowmeter was reading high). The final amount of waste transferred at the end of saltwell pumping will be adjusted to correct for this error; until then the volumes reported will be the actual volumes on the procedure data sheets.

The BBI quarterly update for December 31, 2002, indicates that this tank included interstitial liquid and gas, and it is assumed that the gas was dissipated during pumping; volumes have been adjusted to reflect this change. The total waste volume was reduced by 46 Kgal.

Pumping was shut down on January 14, 2003, in support of A-101 pit work, and was restarted in February 2003.

Final volumes will be determined at completion of Interim Stabilization.

- (c) BY-105 **This tank was declared Interim Stabilized on March 7, 2003.**

Total Waste: 481.0 Kgallons
Supernatant : 0 Kgallons
DIL: 46.8 Kgallons
DLR: 46.8 Kgallons
PLR: 41.8 Kgallons
Sludge: 48.0 Kgallons
Saltcake: 433.0 Kgallons
Total Pumped: 45.4 Kgallons

See Table B-3, footnote #17 for further information

- (d) BY-106 Initial estimated Pumpable Liquid volume: 103 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping was originally started August 10, 1995, and shut down October 17, 1995, due to an Unreviewed Safety Question (USQ) for flammable gas concerns.

Pumping was restarted July 11, 2001. Pumping was shut down August 11, 2001, due to transfer line leak detectors not meeting all operability requirements of the TSR. Compensatory actions were established to allow resumption of pumping. Additionally, field work for Project W-314, "Tank Farm Upgrades," took the primary transfer route out of service. Pumping resumed November 13, 2001. No pumping occurred between December 2001 and August 2002; DCRT waste had to be transferred to tank AP-102 before pumping could resume. Pumping was restarted, shut down, and restarted several times during August 2002. Pumping was shut down on August 30, 2002, because the DCRT was full: awaiting BX-244 transfer to AP-102. Pumping was shut down and restarted several times in early October 2002, and was shut down on October 9, 2002, to support maintenance work. Pumping was restarted November 16, 2002. Pumping was shut down on February 1, 2003, to await completion of the 244-BX transfer. Attempts were made in mid-February to restart pumping but were unsuccessful due to equipment problems. **Pumping was restarted on February 28, was shut down and restarted several times during March due to equipment problems; and was shut down as of March 31, 2003.**

Final volumes will be determined at completion of Interim Stabilization

- (e) C-103 Initial estimated Pumpable Liquid volume: 80 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping was started on November 29, 2002, five months ahead of schedule. This is the last tank scheduled to begin pumping under the Interim Stabilization Consent Decree.

Pumping was shut down on January 11, 2003, to replace a pit flush pressure valve; the valve was replaced January 16, 2003. Several shutdowns and restarts occurred since January 2003 due to other equipment problems.

Pumping was completed on March 3, 2003, in anticipation of meeting interim stabilization criteria. A declaration memo stating that this tank has met interim stabilization criteria was sent to DOE-ORP on March 7, 2003. This completes Interim Stabilization Consent Decree Milestone D-001-14-T01, requiring the pumping of tank 241-C-103 to be completed by December 30, 2003.

- (f) S-101 Initial estimated Pumpable Liquid volume: 77 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began July 27, 2002. Pumping was shut down and restarted several times in August 2002; pumping was shut down on August 7, 2002. Pumping was shut down and restarted several times in October 2002; shut down on October 23, 2002, due to an alarm for the Programmable Logic Controller Communication (PLCC) link failing.

After being shutdown in October 2002, pumping was restarted on January 16, 2003, and was shut down on January 25, 2003, to support SY exhaustor maintenance. Pumping remained shutdown in February 2003 due to equipment problems. **Pumping was restarted on March 30, 2003.**

Final volumes will be determined at completion of Interim Stabilization.

- (g) S-102 Initial estimated Pumpable Liquid volume: 156 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began March 18, 1999. Many pumping problems occurred over the following months, and the pump was replaced several times. Pumping was interrupted again in June 2000. No pumping occurred until May 10, 2002, when pumping resumed. The pump was manually shut down May 18, 2002. A Lock and Tag was hung to support Saltwell Tie-in work scheduled. Pumping resumed June 30, 2002. Pumping was shut down on October 15, 2002, because the analog/mechanical water meter is not advancing, and there is no way to track dilution additions until the water meter is repaired. A letter was sent to DOE-ORP on October 15, 2002 - see top of page B-8 for further information.

Final volumes will be determined at completion of Interim Stabilization

- (h) S-107 Initial estimated Pumpable Liquid volume: 61 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began on September 4, 2002. Pumping was shut down and restarted several times in October 2002; pumping shut down on October 17, 2002, due to a high bearing temperature. Failed recirculation line check valves are suspected. Pumping was restarted on December 28, 2002; and was shut down and restarted several times from December 28 through December 31, 2002, due to alarms from various sources. Pumping was restarted January 1, 2003; pumping was shut down and restarted several times since then due to equipment problems.

- (i) S-111 Initial estimated Pumpable Liquid volume: 147 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began December 18, 2001. (Additionally, 3 Kgal were pumped in October 1975) Pumping was shut down on October 1, 2002 to support an S-complex outage. No pumping occurred in October 2002. Pumping was restarted on November 27, 2002. Pumping was shut down and restarted several times in January 2003, due to various equipment problems. Pumping was shut down on January 25, 2003, due to hydrogen concentration approaching control limit; pumping resumed in February 2003.

Final volumes will be determined at completion of Interim Stabilization.

- (j) S-112 Initial estimated Pumpable Liquid volume: 67 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping resumed on September 21, 2002. (Initial saltwell pumping took place in August 1978, with a total of 125 Kgal being pumped at that time.) A letter was sent to DOE-ORP on October 15, 2002 - see top of page B-8 for further information.

- (k) SX-101 Initial estimated Pumpable Liquid volume: 80 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began November 22, 2000. Pumping was shutdown in December 2002 due to failure of the pump. Pumping resumed September 21, 2001, following replacement of the saltwell pump and the lower piping. No pumping has occurred since November 2001. Attempts were made to restart pumping in July 2002; pumping remains down because jet/foot valve assembly is plugged. Work Package WS-02-646 has been prepared for the jet pump replacement.

Final volumes will be determined at completion of Interim Stabilization.

- (l) SX-102 Initial estimated Pumpable Liquid volume: 106 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began December 15, 2001. Pumping was shut down on August 14, 2002, in support of S-107 field work. Pumping was manually shut down on October 23, 2002, due to an alarm for the PLCC failure alarm in S-101 not shutting the pump down. An automatic filling dilution tank system was installed and operating procedures were updated. The pump was restarted on January 30, 2003.

Final volumes will be determined at completion of Interim Stabilization.

- (m) SX-103 Initial estimated Pumpable Liquid volume: 175 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began October 26, 2000. Pumping was shut down April 22, 2001, due to leak detector and subsequent shielding problems in the pump pit. Pumping resumed September 14, 2001. Pumping was shut down on August 14, 2002, in support of S-107 field work. Pumping was restarted September 1, 2002, and was shut down on September 17, 2002.

This tank was placed under evaluation for meeting Interim Stabilization criteria on September 17, 2002.

Final volumes will be determined at completion of Interim Stabilization

- (n) U-107 Initial estimated Pumpable Liquid volume: 115 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began September 29, 2001. Pumping was shut down on September 11, 2002. The pump had failed, and was replaced on October 21, 2002. A letter was sent to DOE-ORP on October 15, 2002 - see top of page B-8 for further information.

Saltcake dissolution began on December 3, 2002, and was suspended on February 20, 2003. Any pumping during that time is associated with retrieval and is not included in interim stabilization pumping volumes. All volumes of waste pumped from tank U-107 during Saltcake Dissolution Proof of Concept Test include both saltcake and water. The actual volume of waste removed from this tank will be calculated upon completion of the Saltcake Dissolution Proof of Concept Test.

Total volume pumped from February 21 through February 28, 2003, after saltcake dissolution was suspended, has been included in interim stabilization pumping volumes.

Final volumes will be determined at completion of Interim Stabilization

- (o) U-108 Initial estimated Pumpable Liquid volume: 120 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began December 2, 2001. No pumping occurred in April 2002; pumping remains down due to a partially plugged transfer line. Pumping was restarted briefly on May 18, 2002. The pump shut down several times due to alarming and was restarted in bypass mode. From May 18 to May 31, 2002, various Trouble Alarms were intermittently activated. During June 2002, this pump was restarted and shut down several times. As of June 30, 2002, it was still shut down due to transfer line restrictions. Pumping resumed in July 2002. Pumping was shut down on September 30, 2002, for planned SY exhaustor outage. Pumping was restarted and shut down several times in October 2002. Pumping was restarted November 3, 2002, and was shut down on February 6, 2003, for U-Farm transfer line flushing. **Pumping was restarted March 28, 2003.**

Final volumes will be determined at completion of Interim Stabilization.

- (p) U-111 Initial estimated Pumpable Liquid volume: 77 Kgal (HNF-2978, Rev. 4, effective June 30, 2002)

Pumping began on June 14, 2002. Pumping was shut down and restarted several times in October 2002. Pumping was shut down on January 5, 2003, and remains down due to transfer line restrictions between U-Farm and SY-Farm. Pumping was restarted and shut down several times in February 2003 due to equipment problems.

This tank was placed under evaluation for meeting interim stabilization criteria as of March 27, 2003.

Final volumes will be determined at completion of Interim Stabilization.

TABLE B-2. SINGLE-SHELL TANKS STABILIZATION STATUS SUMMARY

March 31, 2003

Partial Interim Isolated (PI)		Intrusion Prevention Completed (IP)		Interim Stabilized (IS)	
<u>EAST AREA</u>		<u>EAST AREA</u>	<u>WEST AREA</u>	<u>EAST AREA</u>	<u>WEST AREA</u>
A-101		A-103	S-104	A-102	S-103
A-102		A-104		A-103	S-104
		A-105	SX-107	A-104	S-105
AX-101		A-106	SX-108	A-105	S-106
			SX-109	A-106	S-108
BY-102		AX-102	SX-110		S-109
BY-103		AX-103	SX-111	AX-102	S-110
BY-105		AX-104	SX-112	AX-103	
BY-106			SX-113	AX-104	SX-104
BY-109		B-FARM - 16 tanks	SX-114		SX-105
		BX-FARM - 12 tanks	SX-115	B-FARM - 16 tanks	SX-106
				BX-FARM - 12 tanks	SX-107
C-103					SX-108
C-105		BY-101	T-102	BY-101	SX-109
C-106		BY-104	T-103	BY-102	SX-110
East Area	11	BY-107	T-105	BY-103	SX-111
		BY-108	T-106	BY-104	SX-112
<u>WEST AREA</u>		BY-110	T-108	BY-105	SX-113
S-101		BY-111	T-109	BY-107	SX-114
S-107		BY-112	T-112	BY-108	SX-115
S-108			T-201	BY-109	
S-109		C-101	T-202	BY-110	
S-110		C-102	T-203	BY-111	T-Farm - 16 tanks
S-111		C-107	T-204	BY-112	TX-Farm - 18 tanks
S-112		C-108			TY-Farm - 6 tanks
		C-109	TX-FARM - 18 tanks	C-101	
SX-101		C-110		C-102	U-101
SX-102		C-111	TY-FARM - 6 tanks	C-104	U-102
SX-103		C-112		C-105	U-103
SX-104			U-101	C-107	U-104
SX-105			U-104	C-108	U-105
SX-106			U-112	C-109	U-106
			U-201	C-110	U-109
T-101			U-202	C-111	U-110
T-104			U-203	C-112	U-112
T-107			U-204	C-201	U-201
T-110		East Area	50	West Area	52
T-111				Total	102
U-102		<u>Retrieval (R)</u>		East Area	61
U-103				West Area	72
U-105				Total	133
U-106		<u>East Area</u>	<u>West Area</u>	<u>Controlled, Clean, and Stable (CCS)</u>	
U-107		C-104	S-102	<u>East Area</u>	<u>West Area</u>
U-108		C-201	S-103	BX-Farm - 12 Tanks	TX-Farm - 18 Tanks
U-109		C-202	S-105		TY Farm - 6 Tanks
U-110		C-203	S-106	East Area	12
U-111		C-204		West Area	24
West Area	26	East Area	5	Total	36
Total	37				
		West Area	4		
		Total	9		

CCS activities have been deferred until funding is available.

TABLE B-3. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS

March 31, 2003

Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method	Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method	Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method
A-101	SOUND	N/A		C-101	ASMD LKR	11/83	AR	T-108	ASMD LKR	11/78	AR
A-102	SOUND	08/89	SN	C-102	SOUND	09/95	JET(2)	T-109	ASMD LKR	12/84	AR
A-103	ASMD LKR	06/88	AR	C-103	SOUND	N/A		T-110	SOUND	01/00	JET(5)
A-104	ASMD LKR	09/78	AR(3)	C-104	SOUND	09/89	SN	T-111	ASMD LKR	02/95	JET
A-105	ASMD LKR	07/79	AR	C-105	SOUND	10/95	AR	T-112	SOUND	03/81	AR(2)(3)
A-106	SOUND	08/82	AR	C-106	SOUND	N/A		T-201	SOUND	04/81	AR (3)
AX-101	SOUND	N/A		C-107	SOUND	09/95	JET	T-202	SOUND	08/81	AR
AX-102	ASMD LKR	09/88	SN	C-108	SOUND	03/84	AR	T-203	SOUND	04/81	AR
AX-103	SOUND	08/87	AR	C-109	SOUND	11/83	AR	T-204	SOUND	08/81	AR
AX-104	ASMD LKR	08/81	AR	C-110	ASMD LKR	05/95	JET	TX-101	SOUND	02/84	AR
B-101	ASMD IKR	03/81	SN	C-111	ASMD LKR	03/84	SN	TX-102	SOUND	04/83	JET
B-102	SOUND	08/85	SN	C-112	SOUND	09/90	AR	TX-103	SOUND	08/83	JET
B-103	ASMD IKR	02/85	SN	C-201	ASMD LKR	03/82	AR	TX-104	SOUND	09/79	SN
B-104	SOUND	06/85	SN	C-202	ASMD LKR	08/81	AR	TX-105	ASMD LKR	04/83	JET
B-105	ASMD IKR	12/84	AR	C-203	ASMD LKR	03/82	AR	TX-106	SOUND	06/83	JET
B-106	SOUND	03/85	SN	C-204	ASMD LKR	09/82	AR	TX-107	ASMD LKR	10/79	AR
B-107	ASMD LKR	03/85	SN	S-101	SOUND	N/A		TX-108	SOUND	03/83	JET
B-108	SOUND	05/85	SN	S-102	SOUND	N/A		TX-109	SOUND	04/83	JET
B-109	SOUND	04/85	SN	S-103	SOUND	04/00	JET (6)	TX-110	ASMD LKR	04/83	JET
B-110	ASMD LKR	12/84	AR	S-104	ASMD LKR	12/84	AR	TX-111	SOUND	04/83	JET
B-111	ASMD LKR	06/85	SN	S-105	SOUND	09/88	JET	TX-112	SOUND	04/83	JET
B-112	ASMD LKR	05/85	SN	S-106	SOUND	02/01	JET (10)	TX-113	ASMD LKR	04/83	JET
B-201	ASMD LKR	08/81	AR (3)	S-107	SOUND	N/A		TX-114	ASMD LKR	04/83	JET
B-202	SOUND	05/85	AR(2)	S-108	SOUND	12/96	JET	TX-115	ASMD LKR	09/83	JET
B-203	ASMD LKR	06/84	AR	S-109	SOUND	06/01	JET (13)	TX-116	ASMD LKR	04/83	JET
B-204	ASMD LKR	06/84	AR	S-110	SOUND	01/97	JET	TX-117	ASMD LKR	03/83	JET
BX-101	ASMD LKR	09/78	AR(3)	S-111	SOUND	N/A		TX-118	SOUND	04/83	JET
BX-102	ASMD LKR	11/78	AR	S-112	SOUND	N/A		TY-101	ASMD LKR	04/83	JET
BX-103	SOUND	11/83	AR(2)(3)	SX-101	SOUND	N/A		TY-102	SOUND	09/79	AR
BX-104	SOUND	09/89	SN	SX-102	SOUND	N/A		TY-103	ASMD LKR	02/83	JET
BX-105	SOUND	03/81	SN	SX-103	SOUND	N/A		TY-104	ASMD LKR	11/83	AR
BX-106	SOUND	07/95	SN	SX-104	ASMD LKR	04/00	JET (7)	TY-105	ASMD LKR	02/83	JET
BX-107	SOUND	09/90	JET	SX-105	SOUND	08/02	JET (16)	TY-106	ASMD LKR	11/78	AR
BX-108	ASMD LKR	07/79	SN	SX-106	SOUND	05/00	JET (8)	U-101	ASMD LKR	09/79	AR
BX-109	SOUND	08/90	JET	SX-107	ASMD LKR	10/79	AR	U-102	SOUND	06/02	JET (15)
BX-110	ASMD LKR	08/85	SN	SX-108	ASMD LKR	08/79	AR	U-103	SOUND	09/00	JET (9)
BX-111	ASMD LKR	03/95	JET	SX-109	ASMD LKR	05/81	AR	U-104	ASMD LKR	10/78	AR
BX-112	SOUND	09/90	JET	SX-110	ASMD LKR	08/79	AR	U-105	SOUND	03/01	JET (11)
BY-101	SOUND	05/84	JET	SX-111	ASMD LKR	07/79	SN	U-106	SOUND	03/01	JET (12)
BY-102	SOUND	04/95	JET	SX-112	ASMD LKR	07/79	AR	U-107	SOUND	N/A	
BY-103	ASMD LKR	11/97	JET(2)	SX-113	ASMD LKR	11/78	AR	U-108	SOUND	N/A	
BY-104	SOUND	01/85	JET	SX-114	ASMD LKR	07/79	AR	U-109	SOUND	04/02	JET (14)
BY-105	ASMD LKR	03/03	JET	SX-115	ASMD LKR	09/78	AR(3)	U-110	ASMD LKR	12/84	AR
BY-106	ASMD LKR	N/A		T-101	ASMD LKR	04/93	SN	U-111	SOUND	N/A	
BY-107	ASMD LKR	07/79	JET	T-102	SOUND	03/81	AR(2)(3)	U-112	ASMD LKR	09/79	AR
BY-108	ASMD LKR	02/85	JET	T-103	ASMD LKR	11/83	AR	U-201	SOUND	08/79	AR
BY-109	SOUND	07/97	JET	T-104	SOUND	11/99	JET(4)	U-202	SOUND	08/79	SN
BY-110	SOUND	01/85	JET	T-105	SOUND	06/87	AR	U-203	SOUND	08/79	AR
BY-111	SOUND	01/85	JET	T-106	ASMD LKR	08/81	AR	U-204	SOUND	08/79	SN
BY-112	SOUND	06/84	JET	T-107	ASMD LKR	05/96	JET				

LEGEND:				
AR	= Administratively interim stabilized			
JET	= Saltwell jet pumped to remove drainable interstitial liquid			
SN	= Supernatant pumped (Non-Jet pumped)			
N/A	= Not yet interim stabilized			
ASMD				
LKR	= Assumed Leaker			
				Interim Stabilized Tanks
				Not Yet Interim Stabilized
				Total Single-Shell Tanks
				133
				16
				149

TABLE B-3. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS

Footnotes: (in chronological order)

- (1) These dates indicate when the tanks were actually interim stabilized. In some cases, the official interim stabilization documents were issued at a later date.
- (2) Although tanks BX-103, T-102, and T-112 met the interim stabilization administrative procedure at the time they were stabilized, they no longer meet the recently updated administrative procedure. The tanks were re-evaluated in 1996 and letter 9654456, J. H. Wicks to J. K. McClusky, DOE-RL, dated September 30, 1996, was issued which recommended that no further pumping be performed on these tanks, based on an economic evaluation.

Document RPP-5556, Rev. 0, "Updated Drainable Interstitial Liquid Volume Estimates for 119 Single-Shell Tanks Declared Stabilized," J. G. Field, February 7, 2000, states that five tanks no longer meet the stabilization criteria (BX-103, T-102, and T-112 exceed the supernatant criteria, and BY-103 and C-102 exceed the Drainable Interstitial Liquid [DIL] criteria).

An intrusion investigation was completed on tank B-202 in 1996 because of a detected increase in surface level. As a result of this investigation, it was determined that this tank no longer meets the recently updated administrative procedure for 200 series tanks.

- (3) Earlier versions of HNF-SD-RE-TI-178, "SST Stabilization Record," indicated that original Interim Stabilization data are missing on four tanks: B-201, T-102, T-112, and T-201. HNF-SD-RE-TI-178, Rev. 7, dated February 9, 2001, added three additional tanks to those missing stabilization data: A-104, BX-101, and SX-115.
- (4) Tank T-104 was declared Interim Stabilized on November 19, 1999. In-tank video taken October 7, 1999, shows the surface is clearly sludge-type waste with no saltcake present. There is no visible supernatant on the surface. Waste surface appears level across tank with numerous cracks. There is a minimal collapsed area around the saltwell screen, with no visible bottom.
- (5) Tank T-110 was declared Interim Stabilized on January 5, 2000, after a major equipment failure. An in-tank video taken October 7, 1999 (pumping was discontinued on August 12, 1999), showed the surface of this tank as smooth, brown-tinted sludge with visible cracks.
- (6) Tank S-103 was declared Interim Stabilized on April 18, 2000. The surface is a rough, black and brown-colored waste with yellow patches of saltcake visible throughout. The surface appears to be damp, but not saturated, and shows irregular cracking typically seen with surfaces beginning to dry out. A pool of supernatant (10 feet in diameter, 5 feet deep, 1.0 Kgallons) is visible from video observations.
- (7) Tank SX-104 was declared Interim Stabilized on April 26, 2000, after a major equipment failure. The surface is a rough, yellowish gray saltcake waste with an irregular surface of visible cracks and shelves that were created as the surface dried out. The waste surface appears to be dry and shows no standing liquid within the tank.
- (8) Tank SX-106 was declared Interim Stabilized on May 5, 2000. The surface is a smooth, white-colored saltcake waste. The surface level slopes slightly from the tank sidewall down to a large depression in the center of the tank. A second depression surrounds both saltwell screens and an abandoned Liquid Observation Well (LOW). The waste surfaces appear dry and show no standing liquid within the tank.

- (9) Tank U-103 was declared Interim Stabilized on September 11, 2000. The surface is a brown colored waste with irregular patches of white salt crystal. Approximately 30% of the waste surface is covered by the salt formations. The surface level slopes slightly from the tank sidewall down to the first of two depressions in the center of the tank. The waste surface appears dry and shows signs of drying and cracking due to saltwell pumping. LOW readings indicate an average adjusted ILL of 60.2 inches. There is a small pool of supernatant estimated to be 500 gallons.
- (10) Tank S-106 was declared Interim Stabilized on February 1, 2001. The surface is a rough, brown and yellow-colored saltcake waste with an irregular surface of mounds and saltcake crystals that were created as the surface was dried out. The waste surface appears to be dry and shows no standing liquid within the tank. There is no evidence of supernatant from video observations. The waste surface slopes gradually from the tank sidewall to the depression in the center of the tank. The depression surrounds both of the saltwell screens, but does not extend around the temperature probe and ENRAF devices.
- (11) Tank U-105 was declared Interim Stabilized on March 29, 2001, after a major equipment failure. The surface is a brown colored waste with irregular patches of white salt crystal. Approximately 15% of the surface is covered by the salt formations. The surface level slopes to the first of two depressions in the center of the tank; the first depression is cone shaped and estimated to be 22 feet in diameter. The second depression, inside the first, is cylindrically shaped and has a diameter of approximately 10 feet. Both depressions are centered on the saltwell screen. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is no visible liquid in the tank.
- (12) Tank U-106 was declared Interim Stabilized on March 9, 2001. The surface is a dark brown/yellow colored waste that is covered with many stalagmite-type crystals growing on the surface. The crystals cover approximately 75% of the waste surface. The waste surface is irregular, appears dry, and shows only minimal signs of cracking due to saltwell pumping. The supernatant pool is estimated to be 13.3 feet in diameter based on the visible portion of the saltwell screen. The pool is centered on the saltwell screen.
- (13) Tank S-109 was declared Interim Stabilized on June 11, 2001. The surface is primarily a white colored salt crystal with small patches of dark salt visible due to saltwell/sampling activities. Approximately 95% of the waste surface is covered by the salt formations. The surface level slopes slightly from the tank sidewall down to a depression in the center of the tank. The waste surface appears rough and dry and shows signs of cracking and slumping due to saltwell pumping.
- (14) Tank U-109 was declared Interim Stabilized on April 5, 2002. The declaration letter to DOE was issued on June 20, 2002. The surface is primarily a brown colored waste with irregular patches of white salt crystal. Approximately 70% of the waste surface is covered by the salt formations. The surface level slopes slightly from the tank sidewall down to a depression in the center of the tank. The depression is cone shaped and is centered on the saltwell screen. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is no visible liquid within the tank.
- (15) Tank U-102 was declared Interim Stabilized on June 19, 2002. The declaration letter to DOE was issued June 28, 2002. The surface is primarily a gray-brown colored cracked waste with irregular patches of white salt crystal. Approximately 50% of the waste surface is covered by the salt formations. The surface level slopes slightly from the tank sidewall down to a depression in the center of the tank. The depression is cone shaped and is centered on the saltwell screen. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is approximately a 5-foot wide pool of visible liquid within the saltwell screen depression.
- (16) Tank SX-105 was declared Interim Stabilized on August 1, 2002; the declaration letter to DOE was issued August 20, 2002. The surface is a rough, yellowish-gray saltcake waste with an irregular surface of visible cracks and shelves due to saltwell pumping. The waste surface appears to be dry and shows no standing water within the tank. The waste surface slopes gradually from the tank sidewall to the center of the tank. There are no large depressions in or around the center of the tank.

- (17) **Tank BY-105 was declared Interim Stabilized on March 7, 2003; the declaration letter to DOE was issued March 25, 2003. An in-tank video was taken January 5, 2003. The surface is a rough, yellowish brown saltcake waste with an irregular surface of visible lumps and shelves that were created as the surface was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water within the tank. A large hole around the saltwell screen shows no evidence of supernatant liquid.**

This page intentionally left blank.

TABLE B-4. SINGLE-SHELL TANK INTERIM STABILIZATION MILESTONES
March 31, 2003

New single-shell tank interim stabilization milestones were negotiated in 1999 and are identified in the "Consent Decree." The Consent Decree was approved on August 16, 1999.

CONSENT DECREE
Attachments A-1 and A-2

The following table is the schedule for pumping liquid waste from the remaining twenty-nine (29) single-shell tanks. This schedule is enforceable pursuant to the terms of the Decree except for the "Projected Pumping Completion Dates," which are estimates only and not enforceable. Also, this schedule does not include tank C-106.

Tank Designation	Project Pumping Start Date	Actual Pumping Start Date	Projected Pumping Completion Date	Interim Stabilization Date
1. T-104	Already initiated	March 24, 1996	May 30, 1999	November 19, 1999
2. T-110	Already initiated	May 12, 1997	May 30, 1999	January 5, 2000
3. SX-104	Already initiated	September 26, 1997	December 30, 2000	April 26, 2000
4. SX-106	Already initiated	October 6, 1998	December 30, 2000	May 5, 2000
5. S-102	Already initiated	March 18, 1999	March 30, 2001	
6. S-106	Already initiated	April 16, 1999	March 30, 2001	February 1, 2001
7. S-103	Already initiated	June 4, 1999	March 30, 2001	April 18, 2000
8. U-103 *	June 15, 2000	September 26, 1999	April 15, 2002	September 11, 2000
9. U-105 *	June 15, 2000	December 10, 1999	April 15, 2002	March 29, 2001
10. U-102 *	June 15, 2000	January 20, 2000	April 15, 2002	June 19, 2002
11. U-109 *	June 15, 2000	March 11, 2000	April 15, 2002	April 5, 2002
12. A-101	October 30, 2000	May 6, 2000	September 30, 2003	
13. AX-101	October 30, 2000	July 29, 2000	September 30, 2003	
14. SX-105	March 15, 2001	August 8, 2000	February 28, 2003	August 1, 2002
15. SX-103	March 15, 2001	October 26, 2000	February 28, 2003	
16. SX-101	March 15, 2001	November 22, 2000	February 28, 2003	
17. U-106 *	March 15, 2001	August 24, 2000	February 28, 2003	March 9, 2001
18. BY-106	July 15, 2001	July 11, 2001	June 30, 2003	
19. BY-105	July 15, 2001	July 11, 2001	June 30, 2003	March 7, 2003
20. U-108	December 30, 2001	December 2, 2001	August 30, 2003	
21. U-107	December 30, 2001	September 29, 2001	August 30, 2003	
22. S-111	December 30, 2001	December 18, 2001	August 30, 2003	
23. SX-102	December 30, 2001	December 15, 2001	August 30, 2003	
24. U-111	November 30, 2002	June 14, 2002	September 30, 2003	
25. S-109	November 30, 2002	September 23, 2000	September 30, 2003	June 11, 2001
26. S-112	November 30, 2002	September 21, 2002	September 30, 2003	
27. S-101	November 30, 2002	July 27, 2002	September 30, 2003	
28. S-107	November 30, 2002	September 4, 2002	September 30, 2003	
29. C-103	Pumping operations began in this tank on November 29, 2002, approximately five months ahead of the scheduled start date of April 2003. It is the final tank to begin pumping operations specified in this Decree. Pumping was completed in this tank on March 3, 2003, in anticipation of meeting interim stabilization criteria. (see footnote #5, next page.)			

* Tanks containing organic complexants.

Completion of Interim Stabilization. DOE will complete interim stabilization of all 29 single-shell tanks listed above by September 30, 2004.

Percentage of Pumpable Liquid Remaining to be Removed:

93% of Total Liquid	9/30/1999 (1)
38% of Organic Complexed Pumpable Liquids	9/30/2000 (2)
5% of Organic Complexed Pumpable Liquids	9/30/2001 (3)
18% of Total Liquid	9/30/2002 (4)
2% of Total Liquid	9/30/2003

The "percentage of pumpable liquid remaining to be removed" is calculated by dividing the volume of pumpable liquid remaining to be removed from tanks not yet interim stabilized by the sum of the total amount of liquid that has been pumped and the pumpable liquid that remains to be pumped from all tanks.

- (1) The Pumpable Liquid Remaining was reduced to 88% by September 30, 1999. Reference LMHC-9957926 R1, D. I. Allen, LHMC, to D. C. Bryson, DOE-ORP, dated October 26, 1999.
- (2) The Complexed Pumpable Liquid Remaining was reduced to 38% by September 15, 2000. Reference CHG-0004752, R. F. Wood, CHG, to J. J. Short, DOE-ORP, dated September 13, 2000.
- (3) Reference CHG-0104859, R. F. Wood, CHG, to J. S. O'Connor, DOE-ORP, dated September 20, 2001: this reference states that tanks U-102 and U-109 appear to have met the interim stabilization criteria, thereby reducing the Complexed Pumpable Liquid Remaining to zero. Reference CHG-0202630, dated June 20, 2002, declared tank U-109 Interim Stabilized and confirmed the completion of Consent Decree milestone, Attachment A, Item 11, as well as the partial completion of milestone D-001-004-T01. Reference CHG-0202901, dated June 28, declared tank U-102 Interim Stabilized and confirmed the completion of Consent Decree milestone, Attachment A, Item 10, as well as the partial completion of milestone D-001-004-T01.
- (4) Reference CHG-0204571, J. C. Fulton, CHG, to J. E. Rasmussen, DOE-ORP, dated September 26, 2002: this reference states that Consent Decree Milestone D-001-12V "The Percentage of Pumpable Liquid Remaining to be Removed Will be Equal To or Less Than 18% of Total Liquid," will be completed by September 30, 2002. Reference CHG-204636, R. F. Wood, CHG, to J. S. O'Connor, DOE-ORP, dated September 30, 2002: this reference states that the milestone was met on September 28, 2002. The percentage of pumpable liquid remaining was 17.94% or less than 550 Kgallons.
- (5) **Reference CH2M-0300891, E. S. Aromi, CH2M HILL Hanford Group, Inc., to R. J. Schepens, DOE-ORP, dated March 7, 2003; this reference states that Interim Stabilization Consent Decree Milestone D-001-14-T01, requiring the pumping of tank 241-C-103 to be completed by December 30, 2003, has been met, approximately 10 months ahead of schedule.**

TABLE B-5. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 1 of 6)

March 31, 2003

Tank Number	Date Declared Confirmed or Assumed Leaker (3)	Volume Gallons (2)	Associated KiloCuries 137 Cs (9)	Interim Stabilized Date (11)	Leak Estimate	
					Updated	Reference
241-A-103	1987	5500 (8)		06/88	1987	(j)
241-A-104	1975	500 to 2500	0.8 to 1.8 (q)	09/78	1983	(a)(q)
241-A-105 (1)	1963	10000 to 277000	85 to 760 (b)	07/79	1991	(b)(c)
241-AX-102	1988	3000 (8)		09/88	1989	(h)
241-AX-104	1977	-- (6)		08/81	1989	(g)
241-B-101	1974	-- (6)		03/81	1989	(g)
241-B-103	1978	-- (6)		02/85	1989	(g)
241-B-105	1978	-- (6)		12/84	1989	(g)
241-B-107	1980	8000 (8)		03/85	1986	(d)(f)
241-B-110	1981	10000 (8)		03/85	1986	(d)
241-B-111	1978	-- (6)		06/85	1989	(g)
241-B-112	1978	2000		05/85	1989	(g)
241-B-201	1980	1200 (8)		08/81	1984	(e)(f)
241-B-203	1983	300 (8)		06/84	1986	(d)
241-B-204	1984	400 (8)		06/84	1989	(g)
241-BX-101	1972	-- (6)		09/78	1989	(g)
241-BX-102	1971	70000	50 (l)	11/78	1986	(d)
241-BX-108	1974	2500	0.5 (l)	07/79	1986	(d)
241-BX-110	1976	-- (6)		08/85	1989	(g)
241-BX-111	1984 (13)	-- (6)		03/95	1993	(g)
241-BY-103	1973	<5000		11/97	1983	(a)
241-BY-105	1984	-- (6)		N/A	1989	(g)
241-BY-106	1984	-- (6)		N/A	1989	(g)
241-BY-107	1984	15100 (8)		07/79	1989	(g)
241-BY-108	1972	<5000		02/85	1983	(a)
241-C-101	1980	20000 (8)(10)		11/83	1986	(d)
241-C-110	1984	2000		05/95	1989	(g)
241-C-111	1968	5500 (8)		03/84	1989	(g)
241-C-201 (4)	1988	550		03/82	1987	(i)
241-C-202 (4)	1988	450		08/81	1987	(i)
241-C-203	1984	400 (8)		03/82	1986	(d)
241-C-204 (4)	1988	350		09/82	1987	(i)
241-S-104	1968	24000 (8)		12/84	1989	(g)
241-SX-104	1988	6000 (8)		04/00	1988	(k)
241-SX-107	1964	<5000		10/79	1983	(a)
241-SX-108 (5)(14)	1962	2400 to 35000	17 to 140 (m)(q)(t)	08/79	1991	(m)(q)(t)
241-SX-109 (5)(14)	1965	<10000	<40 (n)(t)	05/81	1992	(n)(t)
241-SX-110	1976	5500 (8)		08/79	1989	(g)
241-SX-111 (14)	1974	500 to 2000	0.6 to 2.4 (l)(q)(t)	07/79	1986	(d)(q)(t)
241-SX-112 (14)	1969	30000	40 (l)(t)	07/79	1986	(d)(t)
241-SX-113	1962	15000	8 (l)	11/78	1986	(d)
241-SX-114	1972	-- (6)		07/79	1989	(g)
241-SX-115	1965	50000	21 (o)	09/78	1992	(o)
241-T-101	1992	7500 (8)		04/93	1992	(p)
241-T-103	1974	<1000 (8)		11/83	1989	(g)
241-T-106	1973	115000 (8)	40 (l)	08/81	1986	(d)
241-T-107	1984	-- (6)		05/96	1989	(g)
241-T-108	1974	<1000 (8)		11/78	1980	(f)
241-T-109	1974	<1000 (8)		12/84	1989	(g)
241-T-111	1979, 1994 (12)	<1000 (8)		02/95	1994	(f)(r)
241-TX-105	1977	-- (6)		04/83	1989	(g)
241-TX-107 (5)	1984	2500		10/79	1986	(d)
241-TX-110	1977	-- (6)		04/83	1989	(g)
241-TX-113	1974	-- (6)		04/83	1989	(g)
241-TX-114	1974	-- (6)		04/83	1989	(g)
241-TX-115	1977	-- (6)		09/83	1989	(g)
241-TX-116	1977	-- (6)		04/83	1989	(g)
241-TX-117	1977	-- (6)		03/83	1989	(g)
241-TY-101	1973	<1000 (8)		04/83	1980	(f)
241-TY-103	1973	3000	0.7 (l)	02/83	1986	(d)
241-TY-104	1981	1400 (8)		11/83	1986	(d)
241-TY-105	1960	35000	4 (l)	02/83	1986	(d)
241-TY-106	1959	20000	2 (l)	11/78	1986	(d)
241-U-101	1959	30000	20 (l)	09/79	1986	(d)
241-U-104	1961	55000	0.09 (l)	10/78	1986	(d)
241-U-110	1975	5000 to 8100 (8)	0.05 (q)	12/84	1986	(d)(q)
241-U-112	1980	8500 (8)		09/79	1986	(d)
67 Tanks		<750,000 - 1,050,000 (7)				

N/A = not applicable (not yet interim stabilized)

TABLE B-5. SINGLE-SHELL TANKS LEAK VOLUME ESTIMATES

Footnotes:

- (1) Current estimates [see Reference (b)] are that 610 Kgallons of cooling water was added to tank A-105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with Dangerous Waste Regulations [Washington Administrative Code 173-303-070 (2)(a)(ii), as amended, Washington State Department of Ecology, 1990, Olympia, Washington], any of this cooling water that has been added and subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991, the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water which leaked should be much less than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 to 277 Kgallons) is based on the following (see References):

1. Reference (b) contains an estimate of 5 to 15 Kgallons for the initial leak prior to August 1968.
2. Reference (b) contains an estimate of 5 to 30 Kgallons for the leak while the tank was being sluiced from August 1968 to November 1970.
3. Reference (b) contains an estimate of 610 Kgallons of cooling water added to the tank from November 1970 to December 1978, but it was estimated that the leakage was small during this period. This reference contains the statement "Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water." This results in a low estimate of zero gallons leakage from November 1970 to December 1978.
4. Reference (c) contains an estimate the 378 to 410 Kgallons evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 Kgallons of cooling water leakage from November 1970 to December 1978.

	<u>Low Estimate</u>	<u>High Estimate</u>
Prior to August 1968	5,000	15,000
August 1968 to November 1970	5,000	30,000
November 1970 to December 1978	0	232,000
Totals	10,000	277,000

- (2) These leak volume estimates do not include (with some exceptions), such things as: (a) cooling/raw water leaks, (b) intrusions (rain infiltration) and subsequent leaks, (c) leaks inside the tank farm but not through the tank liner (surface leaks, pipeline leaks, leaks at the joint for the overflow or fill lines, etc.), and (d) leaks from catch tanks, diversion boxes, encasements, etc.
- (3) In many cases, a leak was suspected long before it was identified or confirmed. For example, Reference (d) shows that tank U-104 was suspected of leaking in 1956. The leak was confirmed in 1961. This report lists the "assumed leaker" date of 1961. Using present standards, tank U-104 would have been declared an assumed leaker in 1956. In 1984, the criteria designations of "suspected leaker," "questionable integrity," "confirmed leaker," "declared leaker," and "borderline and dormant" were merged into one category now reported as "assumed leaker." See Reference (f) for explanation of when, how long, and how fast some of the tanks leaked. It is highly likely that there have been undetected leaks from single-shell tanks because of the nature of their design and instrumentation.
- (4) The leak volume estimate date for these tanks is before the declared leaker date because the tank was in a suspected leaker or questionable integrity status; however, a leak volume had been estimated prior to the tank being reclassified.

- (5) The increasing radiation levels in drywells and laterals associated with these three tanks could be indicating continuing leak or movement of existing radionuclides in the soil. There is no conclusive way to confirm these observations. (Repeat spectral drywell scans are not part of the current Tank Farm leak detection program but can be run on request a special needs arise. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface. There are currently no functioning laterals and no plan to prepare them for use).
- (6) Methods were used to estimate the leak volumes from these 19 tanks based on the assumption that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in footnote (9). For more details see Reference (g). The total leak volume estimate for these tanks is 150 Kgallons (rounded to the nearest Kgallon), for an average of approximately 8 Kgallons for each of 19 tanks.
- (7) The total has been rounded to the nearest 50 Kgallons. Upper bound values were used in many cases in developing these estimates. It is likely that some of these tanks have not actually leaked.
- (8) Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.
- (9) The curie content shown is as listed in the reference document and is not decayed to a consistent date; therefore, a cumulative total is inappropriate.
- (10) Tank C-101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a minimum heel in December 1969. In 1970, the tank was classified as a "questionable integrity" tank. Liquid level data show decreases in level throughout the 1970s and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a "confirmed leaker" in January 1980. See References (q) and (r); refer to Reference (s) for information on the potential for there to have been leaks from other C-farm tanks (specifically, C-102, C-103, and C-109).
- (11) These dates indicate when the tanks were declared to be interim stabilized. In some cases, the official interim stabilization documents were issued at a later date. Also, in some cases, the field work associated with interim stabilization was completed at an earlier date.
- (12) Tank T-111 was declared an "assumed re-leaker" on February 28, 1994, due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization completed on February 22, 1995.
- (13) Tank BX-111 was declared an "assumed re-leaker" in April 1993. Preparations for pumping were delayed, following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.
- (14) The leak volume and curie release estimates on tanks SX-108, SX-109, SX-111, and SX-112 have been re-evaluated using a Historical Leak Model [see Reference (t)]. In general, the model estimates are much higher than the values listed in the table, both for volume and curies released. The values listed in the table do not reflect this revised estimate because, "In particular, it is worth emphasizing that this report was never meant to be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the issue of leak inventories with a new and different methodology." (This quote is from the first page of the referenced report).
- (15) In July 1998, the Washington State Department of Ecology (Ecology) directed the U.S. Department of Energy (DOE) to develop corrective action plans for eight single-shell tank farms (B/BX/BY/S/SX/T/TX/TY) where groundwater contamination likely originated from tank farm operations. A Tri-Party Agreement milestone (M-45 series) was developed that established a formalized approach for evaluating impacts on groundwater quality of loss of tank wastes to the vadose zone underlying these tank farms. Planning documents have been completed for the B, BX, BY, S, SX, T, TX, and TY tank farms. The phase 1 field investigation was completed in the B, BX, BY, S, and SX tank farms. Field work was

completed for the TX tank farm and is underway in the T and TY tank farms. Documentation preparation for field characterization of the remaining four single-shell tank farms is underway.

SST Vadose Zone Project drilling and testing activities near tank BX-102 were completed in March 2001. A borehole (299-E33-45) was drilled through the postulated uranium plume resulting from the 1951 tank BX-102 overfill event to confirm the presence of uranium, define its present depth, and survey other contaminants of interest such as Tc-99. Thirty-five split-spoon samples were collected for laboratory analyses. This borehole was decommissioned after collection and analysis of groundwater samples.

Borehole W33-46, adjacent to tank B-110, was drilled to a depth of approximately 190 feet in July 2001. Soil samples were collected for analysis as part of the tank farm vadose zone characterization activities. During decommissioning, this borehole was completed as a vadose zone monitoring structure. Work was accomplished in cooperation with scientists from Idaho National Engineering and Environmental Laboratory and Pacific Northwest National Laboratory. This borehole is now the first fully instrumented vadose zone hydrographic monitoring structure to be completed in a Hanford site tank farm.

On July 31, 2002, the Washington State Department of Ecology issued a letter-directive in response to RPP-10757 which suggested a path forward in dealing with the high ⁹⁹Tc activity in groundwater at well 299-W23-19 near tank SX-115. No formal remediation is required, however, extensive purging of the well is to be done concurrent with quarterly sampling. In addition, an array of specific conductivity probes is to be placed in the well to monitor the electrical properties of the water (⁹⁹Tc activity is directly proportional to nitrate concentration, and nitrate concentration is proportional to electrical conductivity). A data logger with remote reading capability will be installed together with the specific conductivity probes. Because large volumes of water are to be removed, and because the aquifer is incapable of supporting a high-rate pump, the capability for pumping this well from outside the tank farm fence (to allow non-tank farm trained personnel to operate the pumping system) is to be installed by March 2003.

References:

- (a) Murthy, K. S., et al., June 1983, *Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site*, Washington, PNL-4688, Pacific Northwest Laboratory, Richland, Washington.
- (b) WHC, 1991a, *Tank 241-A-105 Leak Assessment*, WHC-MR-0264, Westinghouse Hanford Company, Richland, Washington.
- (c) WHC, 1991b, *Tank 241-A-105 Evaporation Estimate 1970 Through 1978*, WHC-EP-0410, Westinghouse Hanford Company, Richland, Washington.
- (d) Smith, D. A., January 1986, *Single-Shell Tank Isolation Safety Analysis Report*, SD-WM-SAR-006, Rev. 1, Rockwell Hanford Operations, Richland, Washington.
- (e) McCann, D. C., and T. S. Vail, September 1984, *Waste Status Summary*, RHO-RE-SR-14, Rockwell Hanford Operations, Richland, Washington.
- (f) Catlin, R. J., March 1980, *Assessment of the Surveillance Program of the High-Level Waste Storage Tanks at Hanford*, Office of Environmental Compliance and Review, for the U.S. Department of Energy, Washington D.C.
- (g) Baumhardt, R. J., May 15, 1989, Letter to R. E. Gerton, U.S. Department of Energy-Richland Operations Office, *Single-Shell Tank Leak Volumes*, 8901832B R1, Westinghouse Hanford Company, Richland, Washington.
- (h) WHC, 1990a, Occurrence Report, *Surface Level Measurement Decrease in Single-Shell Tank 241-AX-102*, WHC-UO-89-023-TF-05, Westinghouse Hanford Company, Richland, Washington.
- (i) Groth, D. R., July 1, 1987, Internal Memorandum to R. J. Baumhardt, *Liquid Level Losses in Tanks 241-C-201, -202 and -204*, 65950-87-517, Westinghouse Hanford Company, Richland, Washington.
- (j) Groth, D. R., and G. C. Owens, May 15, 1987, Internal Memorandum to J. H. Roecker, *Tank 103-A Integrity Evaluation*, Rockwell Hanford Operations, Richland, Washington.
- (k) Dunford, G. L., July 8, 1988, Internal Memorandum to R. K. Welty, *Engineering Investigation: Interstitial Liquid Level Decrease in Tank 241-SX-104*, 13331-88-416, Westinghouse Hanford Company, Richland, Washington.
- (l) ERDA, 1975, *Final Environmental Statement Waste Management Operations, Hanford Reservation, Richland, Washington*, ERDA-1538, 2 vols., U.S. Energy Research and Development Administration, Washington, D.C.
- (m) WHC, 1992a, *Tank 241-SX-108 Leak Assessment*, WHC-MR-0300, Westinghouse Hanford Company, Richland, Washington.
- (n) WHC, 1992b, *Tank 241-SX-109 Leak Assessment*, WHC-MR-0301, Westinghouse Hanford Company, Richland, Washington.
- (o) WHC, 1992c, *Tank 241-SX-115 Leak Assessment*, WHC-MR-0302, Westinghouse Hanford Company, Richland, Washington.
- (p) WHC, 1992d, Occurrence Report, *Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing*, RL-WHC-TANKFARM-1992-0073, Westinghouse Hanford Company, Richland, Washington.

- (q) WHC, 1990b, *A History of the 200 Area Tank Farms*, WHC-MR-0132, Westinghouse Hanford Company, Richland, Washington.
- (r) WHC, 1993, *Assessment of Unsaturated Zone Radionuclide Contamination Around Single-Shell Tanks 241-C-105 and 241-C-106*, WHC-SD-EN-TI-185, REV OA, Westinghouse Hanford Company, Richland, Washington.
- (s) WHC, 1994, Occurrence Report, *Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker*, RL-WHC-TANKFARM-1994-0009, Westinghouse Hanford Company, Richland, Washington.
- (t) HNF, 1998, Agnew, S. F., and R. A. Corbin, August 1998, *Analysis of SX Farm Leak Histories - Historical Leak Model (HLM)*, HNF-3233, Rev. 0, Los Alamos National Laboratory, Los Alamos, New Mexico.

TABLE B-6. SINGLE-SHELL TANKS MONITORING FREQUENCY STATUS (149 tanks)

March 31, 2003

Legend:

E	ENRAF Level Gauge
MT	Manual Tape
FIC	Food Instrument Corporation Level Gauge
L	Liquid Observation Well
D, W, Q, Req.	Daily, Weekly, Quarterly, Request
O/C	Out of Compliance with TSR or OSD
O/S	Out of Service

All data were collected in accordance with Technical Safety Requirement (TSR) and Operating Specification Specification Documents (OSD).

Tank	Surface Level Device (1)	Surface Level Frequency	Liquid Observation Well (LOW)	LOW Frequency	Thermocouple Tree Risers (1)	Temperature Frequency	Dome Elevation Frequency
A-101	E*	Q	L (2)	W	12*	6 mo.	2 yr
A-102	E*	Q			7	6 mo.	2 yr
A-103	E*	Q	L	W	15	6 mo.	2 yr
A-104	E*	Q			17	6 mo.	2 yr
A-105	E*	Q			9,15,16,17,19,22	6 mo.	2 yr
A-106	E*	Q	L	W	14	6 mo.	2 yr
AX-101	E*	Q	L	W	9B*	6 mo.	1 yr
AX-102	E*	Q			9C*	6 mo.	1 yr
AX-103	E*	Q	L	W	9B*	6 mo.	1 yr
AX-104	E*	Q			9C	6 mo.	1 yr
B-101	E*	Q			9	6 mo.	2 yr
B-102	E*	D			4	6 mo.	2 yr
B-103	E*	Q			4*	6 mo.	2 yr
B-104	E*	Q	L	W	5	6 mo.	2 yr
B-105	E* (O/S) (4)	Q	L	W	15	6 mo.	2 yr
B-106	E*	D			4	6 mo.	2 yr
B-107	E*	Q	L	W	3	6 mo.	2 yr
B-108	E*	Q	L	W	5	6 mo.	2 yr
B-109	E*	Q			1	6 mo.	2 yr
B-110	E*	Q	L	W	8	6 mo.	2 yr
B-111	E*	Q	L	W	8	6 mo.	2 yr
B-112	E*	D			1	6 mo.	2 yr
B-201	E*	D			1	6 mo.	
B-202	E*	D			1	6 mo.	
B-203	E*	D			1	6 mo.	
B-204	E*	D			1	6 mo.	
BX-101	E*	D			2*	6 mo.	2 yr
BX-102	E*	Q			8*	6 mo.	2 yr
BX-103	E*	D			1*	6 mo.	2 yr
BX-104	E*	D				N/A	2 yr
BX-105	E*	Q			7*	6 mo.	2 yr
BX-106	E*	Q			1*,7*	6 mo.	2 yr
BX-107	E*	D			4*	6 mo.	2 yr
BX-108	E*	Q			5*	6 mo.	2 yr
BX-109	E*	Q	L	W	3*,5*	6 mo.	2 yr
BX-110	E*	Q	L	W	1*	6 mo.	2 yr
BX-111	E*	Q	L	W	1* (O/S) (7)	6 mo.	2 yr
BX-112	E*	D			1* (O/S) (7)	6 mo.	2 yr
BY-101	MT	Q	L	W	1*	6 mo.	1 yr
BY-102	E*	Q	L	W		N/A	1 yr
BY-103	E*	Q	L	W	1*,5* (O/S) (9)	6 mo.	1 yr
BY-104	MT	Q	L	W	1*,10B*	6 mo.	1 yr
BY-105	MT	Q	L	W	1*,10C*	6 mo.	1 yr
BY-106	MT	Q	L	W	1*	6 mo.	1 yr
BY-107	MT	Q	L	W	1*,5*	6 mo.	1 yr
BY-108	MT	Q	L	W	3*,8*	6 mo.	1 yr
BY-109	E	Q	L	W		N/A	1 yr
BY-110	E	Q	L	W	1*,10A*	6 mo.	1 yr
BY-111	E	Q	L	W	14*	6 mo.	1 yr
BY-112	MT	Q	L	W	2*	6 mo.	1 yr
C-101	E*	Q			2*	6 mo.	2 yr
C-102	E*	Q			7*	6 mo.	2 yr
C-103	E*	D			1*	6 mo.	2 yr
C-104	E*	Q			7*	6 mo.	2 yr

Tank	Surface Level Device (1)	Surface Level Frequency	Liquid Observation Well (LOW)	LOW Frequency	Thermocouple Tree Risers (1)	Temperature Frequency	Dome Elevation Frequency
C-105	E*	Q			1*	6 mo.	2 yr
C-106	E*	Q			8*	Weekly	2 yr
C-107	E*	D			5*	6 mo.	2 yr
C-108	E*	Q			1*,5*	6 mo.	2 yr
C-109	E*	Q			3*,8*	6 mo.	2 yr
C-110	E*	D			8*	6 mo.	2 yr
C-111	E*	Q			5*,6*	6 mo.	2 yr
C-112	E*	Q			1*,8*	6 mo.	2 yr
C-201	MT	Q			6*	6 mo.	
C-202	E	Q			6*	6 mo.	
C-203	MT	Q			6*	6 mo.	
C-204	MT	Q			N/A		
S-101	E*	D	L	W	14*	6 mo.	2 yr
S-102	E*	Q	L	W	3*	6 mo.	2 yr
S-103	E*	D	L	W	4*	6 mo.	2 yr
S-104	E*	Q	L	W	4*	6 mo.	2 yr
S-105	E* (O/S) (10)	Q	L	W	4*	6 mo.	2 yr
S-106	E*	Q	L	W	2*	6 mo.	2 yr
S-107	E*	D	L	W	4*	6 mo.	2 yr
S-108	E*	Q	L	W	4* (O/S) (11)	6 mo.	2 yr
S-109	E*	Q	L	W	4*	6 mo.	2 yr
S-110	E*	Q	L	W	4*	6 mo.	2 yr
S-111	E*	D	L	W	4*	6 mo.	2 yr
S-112	E*	Q	L	W	4*	6 mo.	2 yr
SX-101	E*	Q	L	W	15*	6 mo.	1 yr
SX-102	E*	Q	L (O/S) (5)	W	16*	6 mo.	1 yr
SX-103	E*	Q	L	W	2*	Weekly	1 yr
SX-104	E*	Q	L	W	2*	6 mo.	1 yr
SX-105	E*	Q	L	W	2*	6 mo.	1 yr
SX-106	E*	Q	L	W	16*	6 mo.	1 yr
SX-107	E*	Q			10*,14* (O/S) (8) 10*,19* (O/S) (8)	Weekly	1 yr
SX-108	E*	Q			10*,19*	Weekly	1 yr
SX-109	E*	Q			12*,20*	Weekly	1 yr
SX-110	E*	Q			10*,19*	Weekly	1 yr
SX-111	E*	Q			10*,19*	Weekly	1 yr
SX-112	E*	Q			3*	6 mo.	1 yr
SX-113	E*	Q			10*,19*	Weekly	1 yr
SX-114	E*	Q			10*,19*	Weekly	1 yr
SX-115	E	Q			N/A	N/A	1 yr
T-101	E*	Q			8*	6 mo.	2 yr
T-102	E*	Q			N/A	N/A	2 yr
T-103	E*	Q			8*	6 mo.	2 yr
T-104	E*	Q		W	4*	6 mo.	2 yr
T-105	E*	Q	L		N/A	N/A	2 yr
T-106	E*	Q			8*	6 mo.	2 yr
T-107	E*	D			4*,5*	6 mo.	2 yr
T-108	E*	D			4*	6 mo.	2 yr
T-109	E*	Q	L	W	8*	6 mo.	2 yr
T-110	E*	Q	L	W	8*	6 mo.	2 yr
T-111	E*	Q	L	W	5*	6 mo.	2 yr
T-112	E*	D	L		8*	6 mo.	2 yr
T-201	E*	D			5*	6 mo.	
T-202	E*	D			5*	6 mo.	
T-203	E*	Q			8*	6 mo.	
T-204	E*	Q			8*	6 mo.	
TX-101	E*	D	L	W	N/A	N/A	1 yr
TX-102	E*	Q			4*	6 mo.	1 yr
TX-103	E*	Q			4*	6 mo.	1 yr
TX-104	E*	Q			4*	6 mo.	1 yr
TX-105	E*	Q	L (failed)	W	4*	6 mo.	1 yr
TX-106	E*	Q	L	W	4*	6 mo.	1 yr
TX-107	E*	Q			4*	6 mo.	1 yr
TX-108	E*	Q	L	Request (3)	4*	6 mo.	1 yr
TX-109	E*	Q	L	W	8*	6 mo.	1 yr
TX-110	E*	Q	L	W	N/A	N/A	1 yr
TX-111	E*	Q	L	W	8*	6 mo.	1 yr
TX-112	E*	Q	L	W	8*	6 mo.	1 yr
TX-113	E*	Q	L	W	8*	6 mo.	1 yr
TX-114	E*	Q	L	W	N/A	N/A	1 yr
TX-115	E*	Q	L	W	3*	6 mo.	1 yr

Tank	Surface Level Device (1)	Surface Level Frequency	Liquid Observation Well (LOW)	LOW Frequency	Thermocouple Tree Risers (1)	Temperature Frequency	Dome Elevation Frequency
TX-116	LOW	O (O/S) (6)	L (O/C) (6)	W		N/A	1 yr
TX-117	E*	Q	L	W		N/A	1 yr
TX-118	E*	Q	L	W	1*,3*	6 mo.	1 yr
TY-101	E*	Q			3*,4*	6 mo.	2 yr
TY-102	E*	D			4*	6 mo.	2 yr
TY-103	E*	Q	L	W	4*,7*	6 mo.	2 yr
TY-104	E*	D			3*,4*	6 mo.	2 yr
TY-105	E*	Q	L	W	3*	6 mo.	2 yr
TY-106	E*	Q			2*	6 mo.	2 yr
U-101	E	D			2*	6 mo.	2 yr
U-102	E	Q	L	W	1*	6 mo.	2 yr
U-103	E*	Q	L	W	1*	6 mo.	2 yr
U-104	E	Q				N/A	2 yr
U-105	E*	Q	L	W	1*	6 mo.	2 yr
U-106	E*	Q	L	W	1*	6 mo.	2 yr
U-107	E*	D	L	W	1*	6 mo.	2 yr
U-108	E*	Q	L	W	1*	6 mo.	2 yr
U-109	E*	Q	L	W	1*	6 mo.	2 yr
U-110	E	Q	L	W	1*	6 mo.	2 yr
U-111	E	Q	L	W	5*	6 mo.	2 yr
U-112	MT	Q			5*	6 mo.	2 yr
U-201	MT	D			4*	6 mo.	
U-202	MT	D			4*	6 mo.	
U-203	E	Q			4*	6 mo.	
U-204	E	D			4*	6 mo.	

Footnotes:

- Any ENRAF (E) or thermocouple tree riser that is followed by an asterisk (*) is connected to TMACS for continuous remote monitoring. If there is no asterisk, only manual readings are obtained. Any equipment connected to TMACS collects data multiple times per day, regardless of required frequency.
- A-101 LOW riser was damaged during saltwell pumping in February 2002. The LOW has failed and dip tube readings are being taken on saltwell pumping (SWP) data sheets. The LOW is not required for leak detection during SWP activity per OSD-T-151-00031; when the SWP activity is complete, the LOW be required to be functional. Weight factor and specific gravity readings are currently being taken. **Beginning March 12, 2003, scans are being taken in an existing drywell, eliminating the requirement to install a replacement LOW.**
- TX-108 LOW is only monitored on request. Last reading was July 1994.
- B-105 ENRAF electronic data are inconsistent. The ENRAF is in "fail mode." The LOW is the primary leak detection device for this tank.
- SX-102 LOW is O/S as of 7/17/02. A sharp increase in radiation levels was detected inside the LOW; Problem Evaluation Request (PER) 2002-3914 was issued. Weight factor and specific gravity readings are required weekly in this tank when the saltwell pump is not operating to avoid an OSD violation. Last dip tube reading February 3, 2003. The automatic ENRAF provides daily readings. **Saltwell pumped March 1 and 2, and March 24, 2003.**
- TX-116 LOW was breached in August 2002. The ENRAF failed during the LOW installation in March 2002. The ENRAF was removed when the LOW was breached and replaced in October 2002. The new LOW was not installed in time for the 4th quarter reading for OSD-T-151-00031 compliance. **This tank has incurred an LOW OSD violation; PER 2003-0964 was issued, requiring a functional LOW to be installed in April 2003. The LOW is the primary leak detection device. The ENRAF was O/S on March 24, 2003, and has been removed to support lancing and sampling.**
- BX-111 and BX-112 temperature electronic recording units have failed; they need to be replaced.
- SX-107 temperatures are inconsistent in TMACS since September 23, 2002. SX-108 temperatures are inconsistent since March 7, 2002; the semiannual reading was last taken July 2, 2002. Manual readings are taken weekly in both tanks.

Footnotes (continued)

9. BY-103 temperature electronic recording unit failed in Riser 5 on October 26, 2002. Weekly readings are being taken by Instrument Technicians.
10. S-105 ENRAF failed on January 29, 2003. **It has been flushed and recalibrated and is expected to be back in service in early April 2003.** The LOW is the primary leak detection device.
11. S-108 temperature electronic recording unit failed March 3, 2002. Semiannual temperature readings were taken in July 2003 and January 2003.

APPENDIX C

MISCELLANEOUS UNDERGROUND STORAGE TANKS
AND SPECIAL SURVEILLANCE FACILITIES

**TABLE C-1. EAST AND WEST AREA MISCELLANEOUS UNDERGROUND STORAGE TANKS
AND SPECIAL SURVEILLANCE FACILITIES**

ACTIVE - still running transfers through the associated diversion boxes or pipeline encasements

March 31, 2003

<u>FACILITY</u>	<u>LOCATION</u>	<u>PURPOSE (receives waste from:)</u>	<u>WASTE (Gallons)</u>	<u>MONITORED BY</u>	<u>REMARKS</u>
EAST AREA					
241-A-302-A	A Farm	A-151 DB	651	SACS/ENRAF/TMACS	Pumped to AW-105, 7/00
241-ER-311	B Plant	ER-151, ER-152 DB	3509	SACS/ENRAF/Manually	Pumped to AP-108, 7/01
241-AZ-151	AZ Farm	AZ-702 condensate	7817	SACS/ENRAF/TMACS	Volume changes daily - pumped to AZ-101 or AZ-102 as needed
241-AZ-154	AZ Farm		25	SACS/MT	
244-BX-TK/SMP	BX Complex	DCRT - Receives from several farms	24025	SACS/MT	Transferred to AP-102, 2/11 and 2/19/03
244-A-TK/SMP	A Complex	DCRT - Receives from several farms	8837	MCS/SACS/WTF	Received transfer from BY-106, 3/03
A-350	A Farm	Collects drainage	331	MCS/SACS/WTF	WTF - Data validity uncertain since 4/02 (not primary leak detection method)
AR-204	AY Farm	Tanker trucks from various facilities	675	DIP TUBE	WTF (uncorrected). Pumped as needed
A-417	A Farm		14696	SACS/WTF	Alarms on SACS-pumped to AP-108, 7/00
CR-003-TK/SUMP	C Farm	DCRT	2984	MT/ZIP CORD	WTF returned to service 2/7/03. Pumped to AP-102 on 3/4/03
WEST AREA					
241-TX-302-C	TX Farm	TX-154 DB	175	SACS/ENRAF	Zip cord in sump O/S; water intrusion, 1/98
241-U-301-B	U Farm	U-151, U-152, U-153, U-252 DB	7920	SACS/ENRAF/Manually	TMACS
241-UX-302-A	U Plant	UX-154 DB	1390	SACS/ENRAF/Manually	Returned to service 12/30/93
241-S-304	S Farm	S-151 DB	135	SACS/ENRAF/Manually	Pumped to 244-S, 1/12/03; rain intrusion 2/03
244-S-TK/SMP	S Farm	From Single-Shell Tanks for transfer to SY-102	26401	SACS/Manually	Replaced S-302-A in 10/91; ENRAF installed 7/98. Sump not alarming.
244-TX-TK/SMP	TX Farm	From Single-Shell Tanks and Plutonium Finishing Plant for transfer to SY-102	10782	SACS/Manually	WTF (uncorrected). Received waste from UX-302-A, 1/12/03. Received waste from 219-S, 1/16/03.
Vent Station Catch Tank		Cross Site Transfer Line	426	SACS/Manually	MT. Steam jet transfer from tank D-5, 241-Z facility, 1/9/03. Transferred to SY-102, 2/27/03

Total Active Facilities	17
--------------------------------	-----------

LEGEND:	DB -	Diversion Box
	DCRT -	Double-Contained Receiver Tank
	TK, SMP -	Tank, Sump
	ENRAF -	Surface Level Measurement Devices
	MT -	Manual Tape - Surface Level Measurement Device
	Zip Cord -	Surface Level Measurement Device
	WTF-	Weight Factor - can be recorded as WTF, CWF (corrected) and WTF (uncorrected)
	SACS -	Surveillance Automated Control System
	MCS -	Monitor and Control System
	Manually -	Not connected to any automated system
	O/S -	Out of Service

HNFE-EP-0182, Rev. 180

**TABLE C-2. EAST AREA INACTIVE MISCELLANEOUS UNDERGROUND STORAGE TANKS AND
SPECIAL SURVEILLANCE FACILITIES (CURRENTLY MANAGED BY TANK FARM CONTRACTOR)**

INACTIVE - no longer receiving waste transfers

March 31, 2003

<u>FACILITY</u>	<u>LOCATION</u>	<u>RECEIVED WASTE FROM: (or descrip.)</u>	<u>WASTE (Gallons)</u>	<u>MONITORED BY</u>	<u>REMARKS</u>
209-E-TK-111	209 E Bldg	Decon Catch Tank	Unknown	NM	Removed from service 1988
241-A-302-B	A Farm	A-152 DB	5837	SACS/MT	Isolated 1985, Project B-138 Interim Stabilized 1990, Rain intrusion
241-AX-151	N of PUREX	PUREX	Unknown	NM	Isolated 1985
241-AX-152	AX Farm	AX-152 DB	0	SACS/MT	Declared Assumed Leaker; pumped to AY-102 3/1/01, no longer being used
241-B-301-B	B Farm	B-151, B-152, B-153, B-252 DB	22250	NM	Isolated 1985 (1)
241-B-302-B	B Farm	B-154 DB	4930	NM	Isolated 1985 (1)
241-BX-302-A	BX Farm	BR-152, BX-153, BXR-152, BYR-152 DB	840	NM	Isolated 1985 (1)
241-BX-302-B	BX Farm	BX-154 DB	1040	NM	Isolated 1985 (1)
241-BX-302-C	BX Farm	BX-155 DB	870	NM	Isolated 1985 (1)
241-BY-ITS2-Tk 1	BY Farm	Vapor condenser	Unknown	NM	Isolated
241-BY-ITS2-Tk 2	BY Farm	Heater Flush Tank	Unknown	NM	Stabilized 1977
241-C-301-C	C Farm	C-151, C-152, C-153, C-252 DB	10470	NM	Isolated 1985 (1)
241-ER-311A	SW B Plant	ER-151 DB	Empty	NM	Abandoned in place 1954
244-AR Vault	A Complex	Between farms & B-Plant	Unknown	NM	Not actively being used, systems activated for final clean out.
244-BXR-TK/SMP-001	BX Farm	Transfer lines	7200	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-002	BX Farm	Transfer lines	2180	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-003	BX Farm	Transfer lines	1810	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-011	BX Farm	Transfer lines	7100	NM	Interim Stabilization 1985 (1)

Total East Area Inactive Facilities	18
--	-----------

LEGEND:	DB -	Diversion Box
	MT -	Manual Tape
	SACS -	Surveillance Automated Control System
	TK, SMP -	Tank, Sump
	NM -	Not Monitored

(1) SOURCE: WHC-SD-WM-TI-356, "Waste Storage Tank Status & Leak Detection Criteria," Rev. 0, September 30, 1988

HNF-EP-0182, Rev. 180

**TABLE C-3. WEST AREA INACTIVE MISCELLANEOUS UNDERGROUND STORAGE TANKS AND
SPECIAL SURVEILLANCE FACILITIES (CURRENTLY MANAGED BY TANK FARM CONTRACTOR)**

INACTIVE - no longer receiving waste transfers

March 31, 2003

<u>FACILITY</u>	<u>LOCATION</u>	<u>RECEIVED WASTE FROM: (or descrip)</u>	<u>WASTE (Gallons)</u>	<u>MONITORE BY</u>	<u>REMARKS</u>
213-W-TK-1	E of 213-W Compactor Facility	Water Retention Tank	Unknown	NM	Contains only water
231-W-151-001	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
231-W-151-002	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
241-S-302	S Farm	240-S-151 DB	8235	SACS/ENRAF	Assumed Leaker EPDA 85-04
241-S-302-A	S Farm	241-S-151 DB	0		Assumed Leaker TF-EFS-90-042
Partially filled with grout 2/91, determined still to be an assumed leaker after leak test. Manual FIC readings are unobtainable due to dry grouted surface. CASS monitoring system retired 2/23/99; intrusion readings discontinued. S-304 replaced S-302-A					
241-S-302-B	S Farm	S Encasements	Empty	NM	Isolated 1985 (1)
241-SX-302 (SX-304)	SX Farm	SX-151 DB, 151 TB	Unknown	NM	Isolated 1987
241-T-301	T Farm	DB T-151, -151, -153, -252	Unknown	NM	Isolated 1985 (241-T-301B)
241-TX-302	TX Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TX-302-X-B	TX Farm	TX Encasements	Unknown	NM	Isolated 1985 (1)
241-TX-302-B	TX Farm	TX-155 DB	3283	SACS/ENRAF	New ENRAF installed 9/10/02
241-TX-302-B(R)	E. of TX Farm	TX-155 DB	Unknown	NM	Isolated
241-TY-302-A	TY Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TY-302-B	TY Farm	TY Encasements	Empty	NM	Isolated 1985 (1)
241-Z-8	E. of Z Plant	Recuplex waste	Unknown	NM	Isolated, 1974, 1975
242-T-135	T Evaporator	T Evaporator	Unknown	NM	Isolated
242-TA-R1	T Evaporator	Z Plant waste	Unknown	NM	Isolated
243-S-TK-1	N. of S Farm	Personnel Decon. Facility	Empty	NM	Isolated
244-TXR-TK/SMP-001	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-002	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-003	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-UR-001 Vault TK	U-Farm	Tank, Sump and Cell	4220	NM	Stabilized 1985
244-UR-002 Vault TK	U-Farm	Tank, Sump and Cell	1400	NM	Stabilized 1985
244-UR-003 Vault Tk	U-Farm	Tank, Sump and Cell	5996	NM	Stabilized 1985
244-UR-004 Vault Tk	U-Farm	Tank, Sump and Cell	Empty	NM	Stabilized 1985

Total West Area Inactive Facilities	25
--	-----------

LEGEND:	DB, TB -	Diversion Box, Transfer Box
	CASS -	Computer Automated Surveillance System
	FIC, ENRAF -	Surface Level Measurement Devices
	MT -	Manual Tape - Surface Level Measurement Device
	TK, SMP -	Tank, Sump
	SACS -	Surveillance Automated Control System
	R -	Replacement
	NM -	Not Monitored

(1) SOURCE: WHC-SD-WM-TI-356, "Waste Storage Tank Status & Leak Detection Criteria," Rev. 0, September 30, 1988

HNF-EP-0182, Rev. 180

APPENDIX D
GLOSSARY OF TERMS

TABLE D-1. GLOSSARY OF TERMS

1. DEFINITIONS

WASTE TANKS - General

Waste Tank Safety Issue

A potentially unsafe condition in the handling of waste material in underground storage tanks that requires corrective action to reduce or eliminate the unsafe condition. There are currently no waste tank safety issues.

Characterization

Characterization is understanding the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste.

WASTE TYPES

Aging Waste (AW)

High level, first cycle solvent extraction waste from the PUREX plant (NCAW).

Concentrated Complexant (CC)

Concentrated product from the evaporation of dilute complexed waste.

Concentrated Phosphate Waste (CP)

Waste originating from the decontamination of the N Reactor in the 100 N Area. Concentration of this waste produces concentrated phosphate waste.

Dilute Complexed Waste (DC)

Characterized by a high content of organic carbon including organic complexants: ethylenediaminetetraacetic acid (EDTA), citric acid, and hydroxyethyl-ethylenediaminetriacetic acid (HEDTA), were the major complexants used. Main sources of DC waste in the DST system are saltwell liquid inventory (from SSTs).

Dilute Non-Complexed Waste (DN)

Low activity liquid waste originating from S and T Plants, the 300 and 400 Areas, PUREX facility (decladding supernatant and miscellaneous wastes), 100 N Area (sulfate waste), B Plant, saltwells, and PFP (supernatant).

Drainable Interstitial Liquid (DIL)

Interstitial liquid that is not held in place by capillary forces and will, therefore, migrate or move by gravity.

Double-Shell Slurry (DSS)

Waste that exceeds the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. For reporting purposes, DSS is considered a solid.

Double-Shell Slurry Feed (DSSF)

Waste concentrated just before reaching the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. This form is not as concentrated as DSS.

Evaporator Feed Tank (EVFD)

Dilute waste staged for evaporation; waste type will vary (usually DN or DC).

Slurry Receiver Tank (SRCVR)

Concentrated waste produced by evaporation; waste type will vary (usually DSSF or CC).

Supernatant Liquid

The liquid above the solids or in large liquid pools covered by floating solids in waste storage tanks.

INTERIM STABILIZATION (Single-Shell Tanks only)

Interim Stabilized (IS)

A tank which contains less than 50 Kgallons of drainable interstitial liquid and less than 5 Kgallons of supernatant. If the tank was jet pumped to achieve interim stabilization, then the jet pump flow or saltwell screen inflow must also have been at or below 0.05 gpm before interim stabilization criteria are met.

Jet Pump

The jet pump system includes 1) a jet assembly with foot valve mounted to the base of two pipes that extend from the top of the well casing to near the bottom of the well casing inside the saltwell screen, 2) a centrifugal pump to supply power fluid to the down-hole jet assembly, 3) flexible or rigid transfer jumpers, 4) a flush line, and 5) a flowmeter. The jumpers contain piping, valves, and pressure and limit switches.

The centrifugal pump and jet assembly are needed to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-foot elevation rise. The power fluid passes through a nozzle in the jet assembly and acts to convert fluid pressure head to velocity head, thereby reducing the pressure in the jet assembly chamber. The reduction in pressure allows the interstitial liquid to enter the jet assembly chamber and mix with the power fluid. Velocity head is converted to pressure head above the nozzle, lifting power fluid, and interstitial liquid to the pump pit. Pumping rates vary from 0.05 to about 4 gpm.

Saltwell Screen

The saltwell system is a 10-inch diameter saltwell casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into the 12-inch tank riser located in the pump pit. The stainless steel screen portion of the system will extend through the tank waste to near the bottom of the tank. The saltwell screen portion of the casing is an approximately 10-foot length of 300 Series, 10-inch diameter, stainless steel pipe with screen openings (slots) of 0.05 inches.

Emergency Pumping Trailer

A 45-foot tractor-type trailer is equipped to provide storage space and service facilities for emergency pumping equipment: this consists of two dedicated jet pump jumpers and two jet pumps, piping and dip tubes for each, two submersible pumps and attached piping, and a skid-mounted Weight Factor Instrument Enclosure with an air compressor and electronic recording instruments. The skid also contains a power control station for the pumps, pump pit leak detection, and instrumentation. A rack for over 100 feet of overground double-contained piping is also in the trailer.

INTRUSION PREVENTION (ISOLATION) (Single-Shell Tanks only)

Partially Interim Isolated (PI)

The administrative designation reflecting the completion of the physical effort required for Interim Isolation except for isolation of risers and piping that is required for jet pumping or for other methods of stabilization.

Interim Isolated (II)

The administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. In June 1993 the term "Interim Isolation" was replaced by "Intrusion Prevention."

Intrusion Prevention (IP)

Intrusion Prevention is the administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. Under no circumstances are electrical or instrumentation devices disconnected or disabled during the intrusion prevention process (with the exception of the electrical pump).

Retrieval (R)

The process of removing, to the maximum extent practical, all the waste from a given underground storage tank. The retrieval process is selected specific to each tank and accounts for the waste type stored and the access and support systems available. Generally, retrieval is focused on removal of solids from the tank.

Final Closure

Final closure of the operable units (tank farms) shall be defined as regulatory approval of completion of closure actions and commencement of post-closure actions. For the purposes of this agreement (Hanford Federal Facility Agreement and Consent Order Change Control Form, Change Number M-45-02-03), all units located within the boundary of each tank farm will be closed in accordance with Washington Administrative Code 173-303-610. In evaluating closure operations for single-shell tanks, contaminated soil, and ancillary equipment, the Washington State Department of Ecology and the Washington State Environmental Protection Agency will consider cost, technical practicability, and potential exposure to radiation. Closure of all units within the boundary of a given tank farm will be addressed in a closure plan for single-shell tanks.

TANK INTEGRITY

Sound

The integrity classification of a waste storage tank for which surveillance data indicate no loss of liquid attributed to a breach of integrity.

Assumed Leaker

The integrity classification of a waste storage tank for which surveillance data indicate a loss of liquid attributed to a breach of integrity.

Assumed Re-Leaker

A condition that exists after a tank has been declared as an "assumed leaker" and then the surveillance data indicate a new loss of liquid attributed to a breach of integrity.

TANK INVESTIGATION

Intrusion

A term used to describe the infiltration of liquid into a waste tank.

SURVEILLANCE INSTRUMENTATION

Drywells

Historically, the drywells were monitored with gross logging tools as part of a secondary leak monitoring system. In some cases, neutron-moisture sensors were used to monitor moisture in the soil as a function of well depth, which could be indicative of tank leakage. The routine gross gamma logging data were stored electronically from 1974 through 1994. The routine gross gamma logging program ended in 1994. A program was initiated in 1995 to log each of the available drywells in each tank farm with a spectral gamma logging system. The spectral gamma logging system provides quantitative values for gamma-emitting radionuclides. The baseline spectral gamma logging database is available electronically.

Repeat spectral drywell scans are not part of the established Tank Farm leak detection program, but they can be run on request if special needs arise. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface.

Laterals

Laterals are horizontal drywells positioned under single-shell waste storage tanks to detect radionuclides in the soil which could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are 4-inch inside diameter steel pipes located 8 to 10 feet below the tank's concrete base.

There are three laterals per tank. Laterals are located only in A and SX farms. There are currently no functioning laterals and no plan to prepare them for use.

Surface Levels

The surface level measurements in all waste storage tanks are monitored by manual or automatic conductivity probes, and recorded and transmitted or entered into the Surveillance Analysis Computer System.

Automatic FIC

An automatic waste surface level measurement device is manufactured by the Food Instrument Corporation (FIC). The instrument consists of a conductivity electrode (plummet) connected to a calibrated steel tape, a steel tape reel housing and a controller that automatically raises and lowers the plummet to obtain a waste surface level reading. The controller can provide a digital display of the data and until February 1999, the majority of the FICs transmitted readings to the Computer Automated Computer Surveillance System (CASS). Since CASS retirement, all FIC gauges are read manually. FICs are being replaced by ENRAF detectors (see below).

ENRAF 854 ATG Level Detector

FICs and some manual tapes are in the process of being replaced by the ENRAF ATG 854 level detector. The ENRAF gauge, fabricated by ENRAF Incorporated, determines waste level by detecting variations in the weight of a displacer suspended in the tank waste. The displacer is connected to a wire wound onto a precision measuring drum. A change in the waste level causes a change in the weight of the displacer which will be detected by the force transducer. Electronics within the gauge causes the servo motor to adjust the position of the displacer and compute the tank level based on the new position of the displacer drum. The gauge displays the level in decimal inches. The first few ENRAFs that received remote reading capability transmit liquid level data via analog output to the TMACS. The remaining ENRAFs and future installations will transmit digital level data to TMACS via an ENRAF Computer Interface Unit (CIU). The CIU allows fully remote communication with the gauge, minimizing tank farm entry.

Annulus

The annulus is the space between the inner and outer shells on DSTs only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where conductivity probes are installed. The annulus conductivity probes and radiation detectors are the primary means of leak detection for all DSTs.

Liquid Observation Well (LOW)

In-tank liquid observation wells are used for monitoring the ILL in single-shell tanks. The wells are usually constructed of fiberglass or TEFZEL-reinforced epoxy-polyester resin (TEFZEL is a trademark of E. I. du Pont de Nemours & Company). There are a few LOWs constructed of steel. LOWs are sized to extend to within 1 inch of the bottom of the waste tank, are sealed at their bottom ends, and have a nominal outside diameter of 3.5 inches. Gamma and neutron probes are used to monitor changes in the ILL, and can indicate intrusions or leakage by increases or decreases in the ILL. There are 70 LOWs installed in SSTs that contain or are capable of containing greater than 50 Kgallons of drainable interstitial liquid. All of the LOWs are monitored weekly with the exception of TX-108 which is monitored by request only. Two LOWs installed in DSTs SY-102 and AW-103 are used for special, rather than routine, surveillance purposes only.

Thermocouple (TC)

A thermocouple is a thermoelectric device used to measure temperature. More than one thermocouple element on a device (probe) is called a thermocouple tree. In DSTs there may be one or more thermocouple trees in risers in the primary tank. In addition, in DSTs only, there are TC elements installed in the insulating concrete, the lower primary tank knuckle, the secondary tank concrete foundation, and in the outer structural concrete.

These monitor temperature gradients within the concrete walls, bottom of the tank, and the domes. In SSTs, one or more thermocouples may be installed directly in a tank, although some SSTs do not have any trees

installed. A single TC element may be installed in a riser or lowered down an existing riser or LOW. There are also four thermocouple laterals beneath tank 105-A in which temperature readings are taken in 34 TC elements.

In-tank Photographs and Videos

In-tank photographs and videos may be taken to aid in resolving in-tank measurement anomalies and determine tank integrity. Photographs and videos help determine sludge and liquid levels by visual examination.

ACRONYMS - Waste Type acronyms begin on Page D-2

<u>BBI</u>	Best Basis Inventory
<u>CCS</u>	Controlled, Clean, and Stable (tank farms)
<u>CH2M HILL</u>	CH2M HILL Hanford Group, Inc.
<u>DCRT</u>	Double-Contained Receiver Tank
<u>DST</u>	Double-Shell Tank
<u>FSAR</u>	Final Safety Analysis Report effective October 18, 1999
<u>Gal</u>	Gallon
<u>GPM</u>	Gallons Per Minute
<u>II</u>	Interim Isolated
<u>Kgal</u>	Kilogallons
<u>IP</u>	Intrusion Prevention Completed
<u>IS</u>	Interim Stabilized
<u>MT/FIC/ ENRAF</u>	Manual Tape, Food Instrument Corporation, ENRAF Corporation (surface level measurement devices)
<u>OSD</u>	Operating Specifications Document
<u>PI</u>	Partial Interim Isolated
<u>PER</u>	Problem Evaluation Request
<u>PFP</u>	Plutonium Finishing Plant
<u>SAR</u>	Safety Analysis Report
<u>SHMS</u>	Standard Hydrogen Monitoring System
<u>SST</u>	Single-Shell Tank
<u>SWL</u>	Salt Well Liquid
<u>TFXR</u>	Tank Transfer Database

<u>TMACS</u>	Tank Monitor and Control System
<u>TPA</u>	Hanford Federal Facility Consent and Compliance Order, "Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy," as amended (Tri-Party Agreement)
<u>TSR</u>	Technical Safety Requirement
<u>USQ</u>	Unreviewed Safety Question

Additional definitions (used in the SST Inventory columns) follow: (IL, DIL, DLR, PLR, etc.)

2. INVENTORY AND STATUS BY TANK – COLUMN VOLUME CALCULATIONS AND DEFINITIONS FOR TABLE B-1 (Single-Shell Tanks only)

COLUMN HEADING	COLUMN VOLUME CALCULATIONS (Underlined)/DEFINITIONS
Total Waste	<u>Solids volume plus Supernatant Liquid.</u> Solids include sludge and saltcake (see definitions below).
Supernatant Liquid (1)	<u>May be either measured or estimated.</u> Supernatant is either the estimated or measured liquid floating on the surface of the waste or under a floating solids crust. In-tank photographs or videos are useful in estimating the liquid volumes; liquid floating on solids and core sample data are useful in estimating large liquid pools under a floating crust.
Drainable Interstitial Liquid (DIL) (1)	<u>This is initially calculated.</u> Drainable interstitial liquid is calculated based on the saltcake and sludge volumes, using calculated porosity values from past pumping or actual data for each tank. Interstitial liquid is liquid that fills the interstitial spaces of the solids waste. The sum of the interstitial liquid contained in saltcake and sludge minus an adjustment for capillary height is the initial volume of drainable interstitial liquid.
Pumped This Month	<u>Net total gallons of liquid pumped from the tank during the month.</u> If supernatant is present, pump production is first subtracted from the supernatant volume. The remainder is then subtracted from the drainable interstitial liquid volume.
Total Pumped (1)	<u>Cumulative net total gallons of liquid pumped from 1979 to date.</u>
Drainable Liquid Remaining (DLR) (1)	<u>Supernatant plus Drainable Interstitial Liquid.</u> The total Drainable Liquid Remaining is the sum of drainable interstitial liquid and supernatant.
Pumpable Liquid Remaining (PLR) (1)	<u>Drainable Liquid Remaining minus unpumpable volume.</u> Not all drainable interstitial liquid is pumpable.
Sludge	<u>Solids formed during sodium hydroxide additions to waste.</u> Sludge was usually in the form of suspended solids when the waste was originally received in the tank from the waste generator. In-tank photographs or videos may be used to estimate the volume.
Saltcake	<u>Results from crystallization and precipitation after concentration of liquid waste, usually in an evaporator.</u> If saltcake is layered over sludge, it is only possible to measure total solids volume. In-tank photographs or videos may be used to estimate the saltcake volume.
Solids Volume Update	<u>Indicates the latest update of any change in the solids volume.</u>

COLUMN HEADING	COLUMN VOLUME CALCULATIONS (Underlined)/DEFINITIONS
Solids Update Source - See Footnote	<u>Indicates the source or basis of the latest solids volume update.</u>
Last In-Tank Photo	<u>Date of last in-tank photographs taken.</u>
Last In-Tank Video	<u>Date of last in-tank video taken.</u>
See Footnotes for These Changes	<u>Indicates any change made the previous month.</u> A footnote explanation for the change follows the Inventory and Status by Tank Appendix (Table B-1).

(1) Volumes for supernatant, DIL, DLR, and PLR are not shown in these columns until interim stabilization is completed. Total gallons pumped, total waste, sludge, and saltcake volumes are shown and adjusted based on actual pumping volumes.

APPENDIX E
TANK CONFIGURATION AND FACILITIES CHARTS

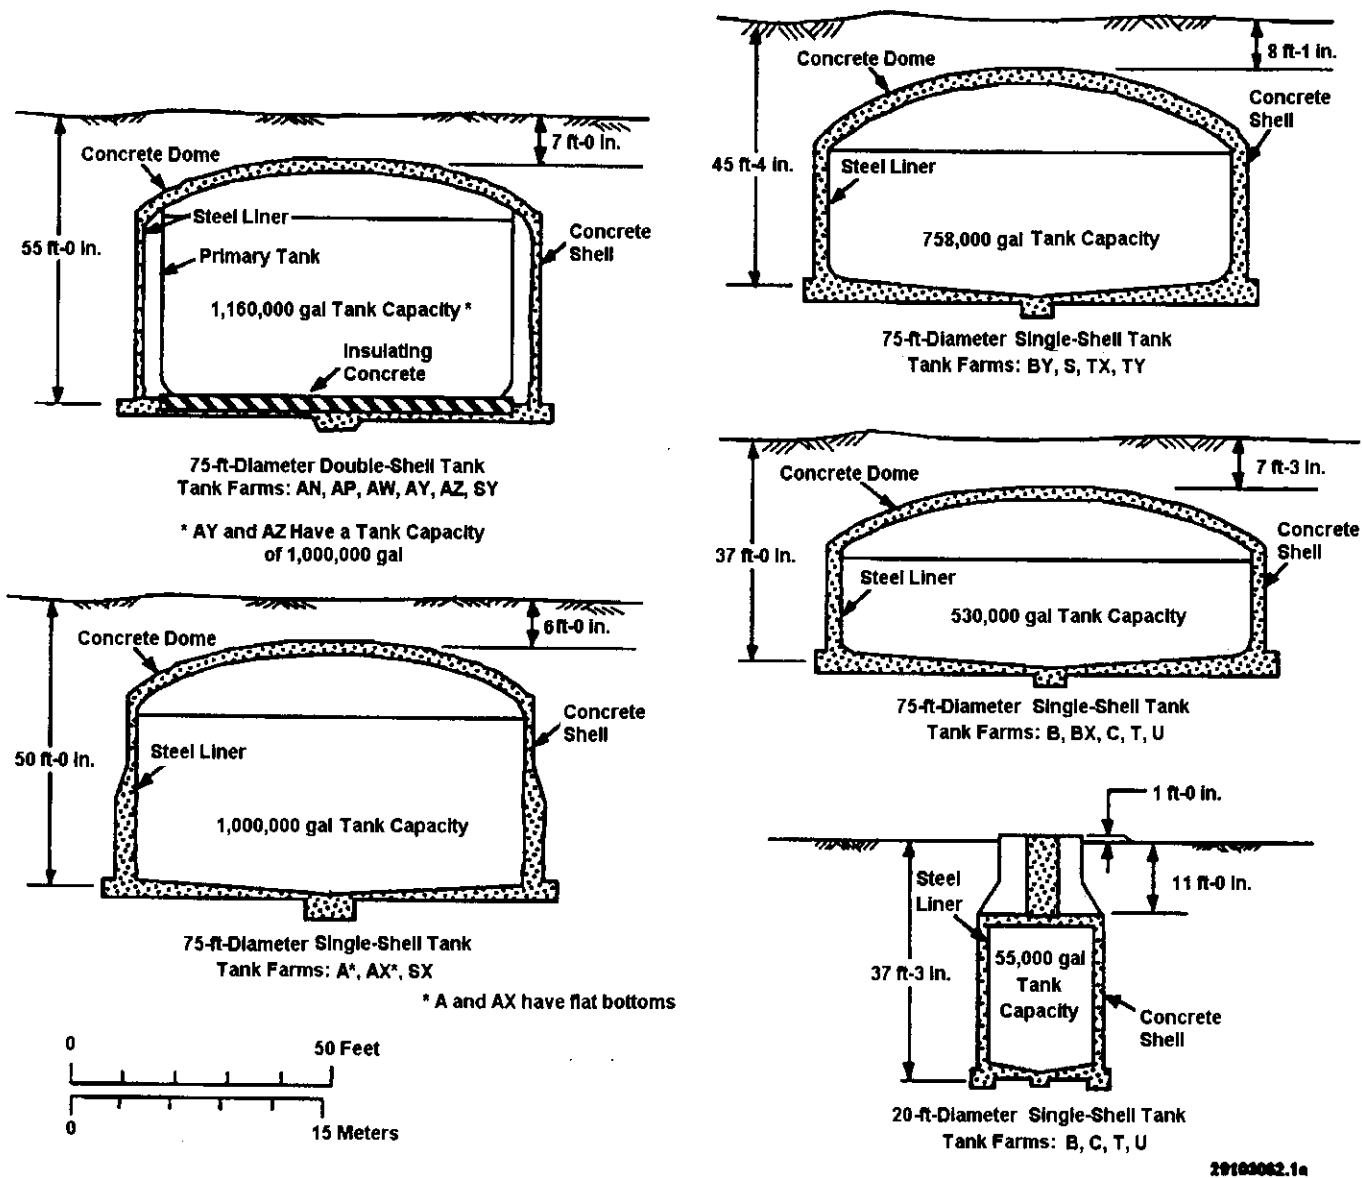


Figure E-1. High-Level Waste Tank Configurations

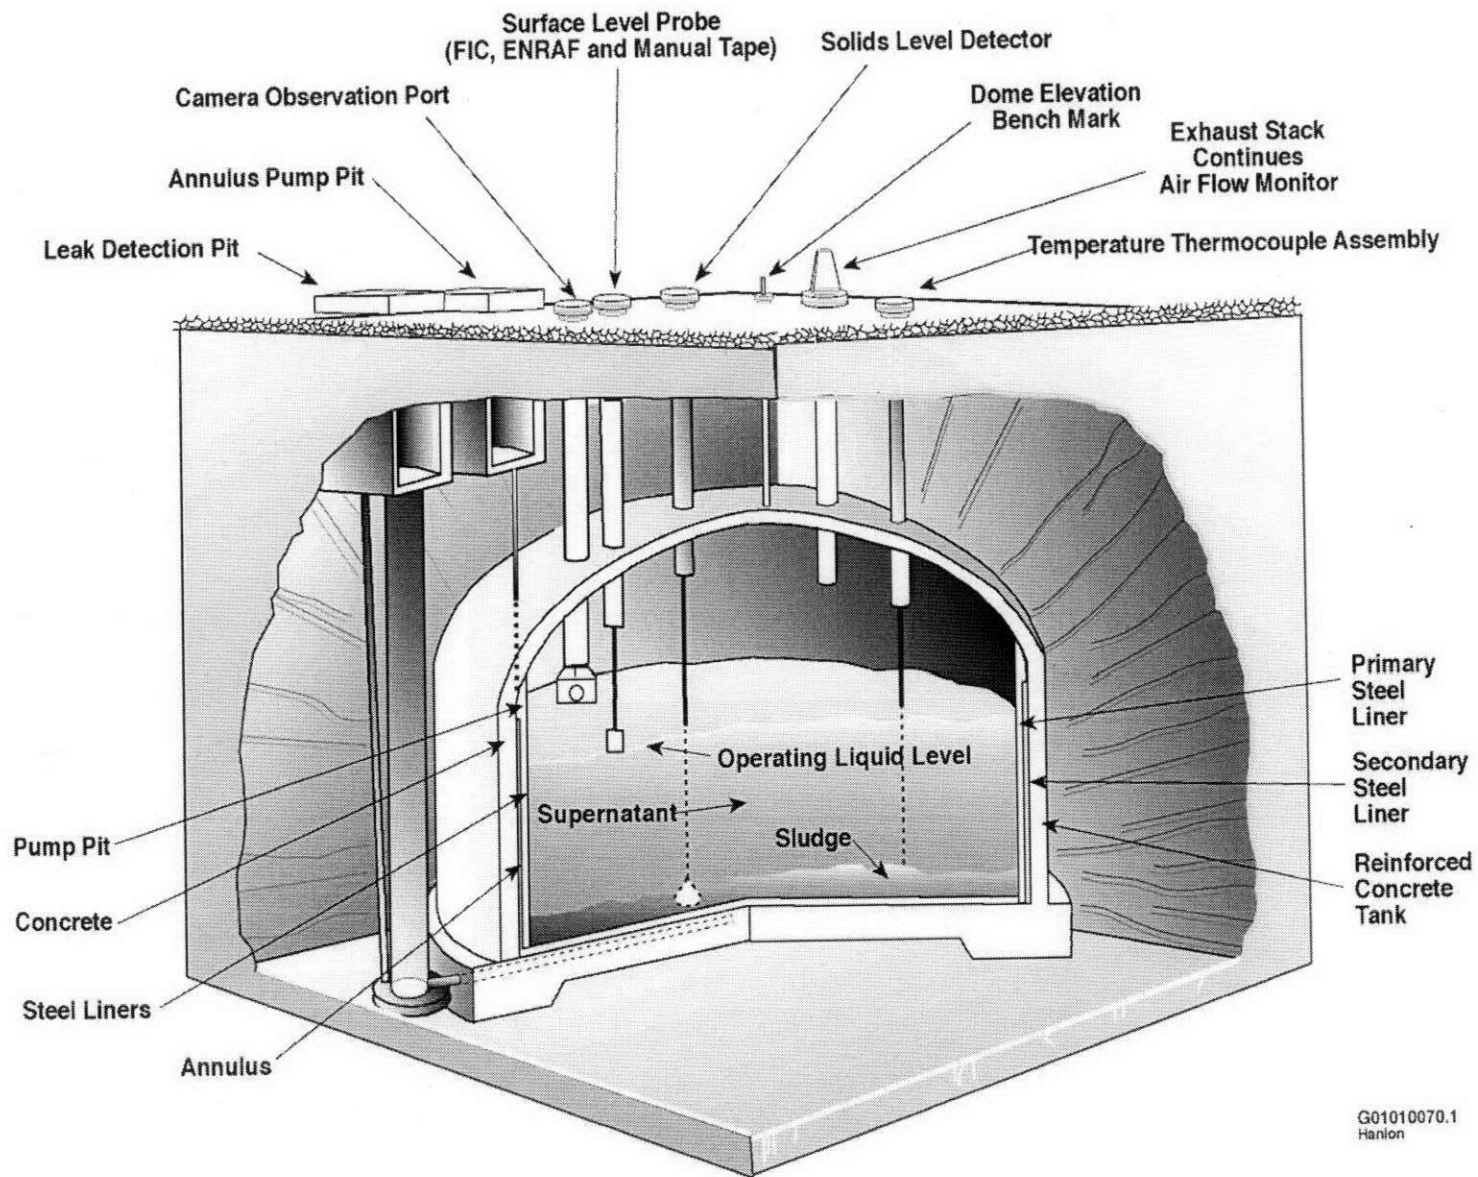


Figure E-2. Double-Shell Tank Instrumentation Configuration

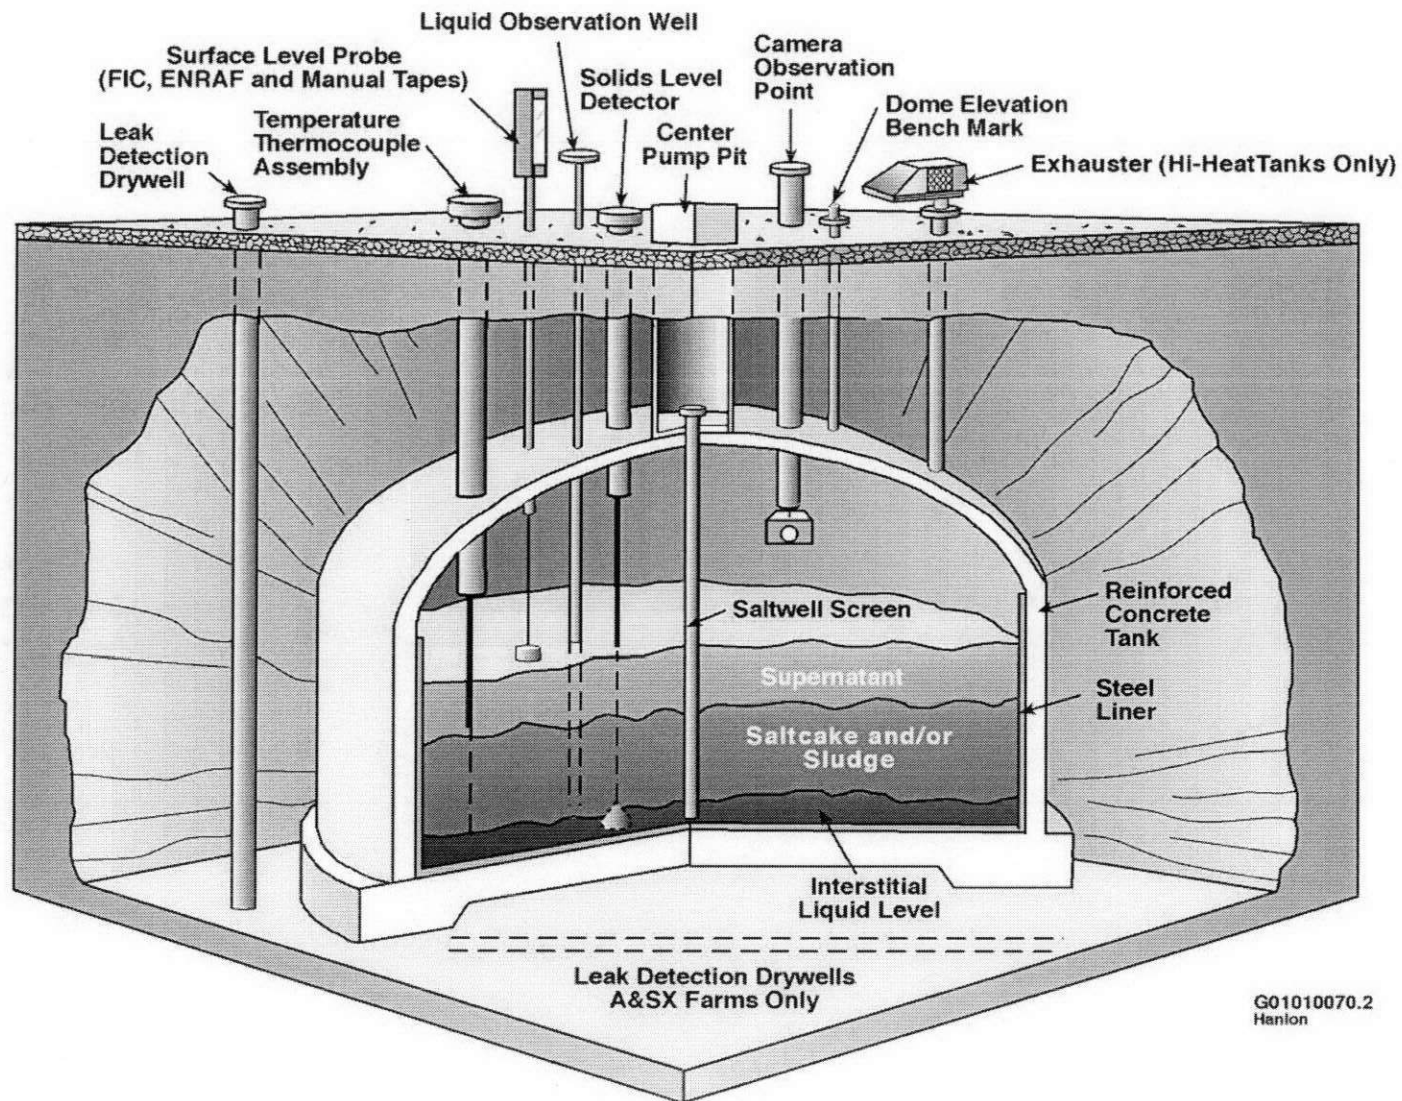


Figure E-3. Single-Shell Tank Instrumentation Configuration

DISTRIBUTION

March 31, 2003

Number of copies

OFFSITE - USA

2

Congress of the United States

U.S. Senate
717 Hart Senate Building
Washington D.C. 20510

Senator Ron Wyden

U.S. House of Representatives
1323 Longworth House Office Building
Washington D. C. 20515

Congressman Richard "Doc" Hastings, 4th District
Atten: Jeff Markey

3

U.S. Department of Energy-Headquarters

1000 Independence Avenue, SW
Washington, D. C. 20585

Harry Calley	EM-38	Cloverleaf Bldg.
William M. Levitan	EM-1	FORS/5A-014

U.S. Department of Energy-Headquarters

19901 Germantown Rd
Germantown, MD 20874

Kurt Juroff	EM-44
-------------	-------

1

Washington State Department of Ecology

Nuclear Waste Program
P. O. Box 47600
Olympia, WA 98504-7600

Roger Stanley

1

Washington State Department of Health

Radiation Protection
7171 Cleanwater Lane
P. O. Box 47827
Olympia, WA 98504-7827

Allen W. Conklin

1

Oregon State Office of Energy

625 Marion St. NE, Suite 1
Salem, OR 97301

Dirk Dunning

Do not remove from distribution without permission from ODOE

1 **MACTEC**
8310 Centerbrook Place
Alexandra, VA 22308

Stanley Blacker, Vice President

Do not remove from distribution without permission from addressee

1 **CH2M HILL**
6060 S. Willow Drive
Greenwood Village, CO 80111-5142

Dr. Bob Iotti, President and General Manager

1 **John Marvin, Inc.**
12122 N. Guinevere
Spokane, WA 99218

Donald M. Ogden

TRI-CITIES:

1 **ARES Corporation**
636 Jadwin Ave., Suite B
Richland, WA 99352

3 **Washington State Department of Ecology**
1315 W. 4th Avenue
Kennewick, WA 99336-6018

Brenda Jentzen
Jeff Lyon
Nancy Uziemblo

1 Richard Welty
409 S. 41st Ave
W. Richland, WA 99353

1 **Tri-City Herald**
P.O. Box 2608
Tri-Cities, WA 99302

John Stang

1 Harry Babad
2540 Cordoba Ct.
Richland, WA 99352

1 **Vista Engineering Technologies**
8203 W. Quinault
Bldg. C, Suite 200
Kennewick, WA 99336

J. Pete Sederburg

ONSITE

1	<u>S. M. Stoller Corporation</u>	
	P. D. Henwood	B2-62
1	<u>General Accounting Office</u>	
	C. R. Abraham	A1-80
1	<u>Washington State Department of Ecology</u>	
	Library	B5-18
1	<u>U.S. Environmental Protection Agency</u>	
	David Bartus	B5-18
13	<u>U.S. Department of Energy</u>	
	C. J. Bosted	H6-60
	D. C. Bryson	H6-60
	M. B. Burandt	H6-60
	V. L. Callahan	H6-60
	S. H. Pfaff	H6-60
	D. H. Irby	H6-60
	Wen-Shou Liou	H6-60
	J. L. Polehn	H6-60
	M. J. Royack	H6-60
	R. W. Russell III	H6-60
	A. J. Stevens	H6-60
	D. J. Williams	H6-60
	Reading Room	H2-53
2	<u>Pacific National Northwest Laboratories</u>	
	F. L. Leverenz, Jr.	K6-04
	B. E. Opitz	K6-75
74	<u>CH2M HILL Hanford Group, Inc. and Affiliated Companies</u>	
	D. I. Allen	H6-03
	J. C. Allen-Floyd	H6-64
	D. B. Amerine	R2-50
	E. S. Aromi	H6-63
	J. J. Badden	S5-07
	S. F. Bobrowski	K7-28
	K. M. Bowen	R2-12
	V. C. Boyles	R2-11
	K. G. Carothers	R2-11
	D. B. Cartmell	H6-11
	R. J. Cash	S5-13
	J. M. Conner	R2-11
	W. L. Cowley	S4-44
	Q. R. Decker	R1-44
	C. DeFigh-Price	R2-58
	M. A. Fish	R3-83
	R. A. Dodd	S7-38
	J. G. Field	R2-12
	K. D. Fowler	S5-13


M. Frazier	R1-44
R. L. Frink	T4-08
J. R. Freeman-Pollard	S0-11
K. A. Gasper	H6-03
M. S. Gerber	B3-30
B. M. Hanlon (6)	R3-72
B. A. Higley	R3-73
T. M. Hohl	R3-73
J. Jacobs	R1-44
T. E. Jones	E6-35
M. R. Kembel	S7-70
N. W. Kirch	R3-73
M. A. Knight	R2-11
J. S. Konyu	S7-64
J. G. Kristofzski	H6-03
D. L. Kubie	S7-95
J. A. Lechelt	S5-13
R. H. Lipfert	S7-03
T. H. May	R2-11
J. A. McDonald Jr.	R2-50
V. E. Mehrer	S0-04
A. N. Naiknimbalkar	R2-12
R. Ni	H6-03
D. L. Parker	R2-37
R. S. Popielarczyk	H6-03
P. A. Powell	R1-51
B. J. Rabe	S5-07
R. E. Raymond	H6-22
W. E. Ross	H6-22
T. L. Sams	H6-22
D. J. Saueressig	S7-20
P. S. Schaus	R2-39
N. J. Scott-Proctor	S5-00
L. S. Sorenson	R1-44
G. A. Stanton, Jr.	S7-03
J. N. Strode	R3-73
R. R. Thompson	H6-22
D. T. Vladimiroff	S7-20
J. A. Voogd	R2-50
L. R. Webb (6)	R1-10
Central Files	B1-07
200 West Shift Office	T4-00
200 East Shift Office	S7-02
Environmental	
Data Mgmt Center (2)	H6-08
Environmental Library	R1-51

200 East Tank Waste Contents

A-Tank Farm- 1954-55

6 @ 1,000,000 GAL Tank Capacity, Single-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-A-101	4	424	0
241-A-102	0	37	3
241-A-103	2	364	5
241-A-104	28	0	0
241-A-105	37	0	0
241-A-106	50	29	0

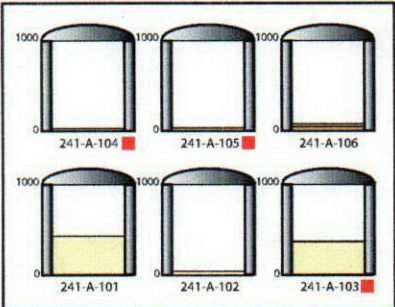

AZ-Tank Farm- 1975-76

2 @ 1,000,000 GAL Tank Capacity, Double-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AZ-101	52	0	938
241-AZ-102	105	0	882

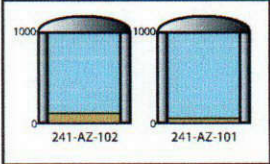

AN-Tank Farm- 1981

7 @ 1,160,000 GAL Tank Capacity, Double-Shell

Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AN-101	0	0	252
241-AN-102	0	134	944
241-AN-103	0	459	499
241-AN-104	0	445	608
241-AN-105	0	538	589
241-AN-106	0	17	147
241-AN-107	0	234	847

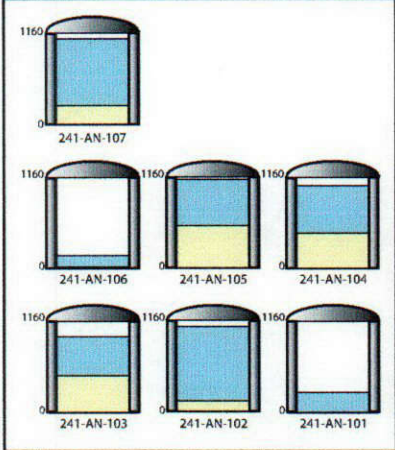


B-Tank Farm- 1945-47

12 @ 530,000 GAL Tank Capacity, Single-Shell

4 @ 55,000 GAL Tank Capacity, Single-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-B-101	28	81	0
241-B-102	0	28	4
241-B-103	1	55	0
241-B-104	309	65	0
241-B-105	28	262	0
241-B-106	121	0	1
241-B-107	86	75	0
241-B-108	27	64	0
241-B-109	50	75	0
241-B-110	244	0	1
241-B-111	241	0	1
241-B-112	15	17	3
241-B-201	30	0	0
241-B-202	29	0	0
241-B-203	51	0	1
241-B-204	50	0	1

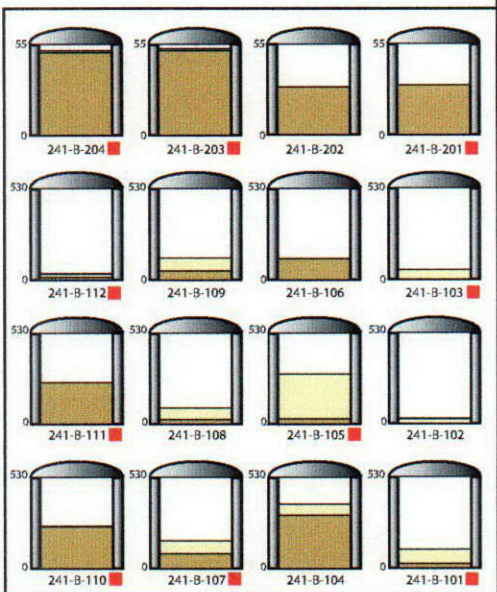

AP-Tank Farm- 1986

8 @ 1,160,000 GAL Tank Capacity, Double-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AP-101	0	0	1111
241-AP-102	23	0	160
241-AP-103	0	0	895
241-AP-104	0	0	1103
241-AP-105	0	89	1041
241-AP-106	0	0	1138
241-AP-107	0	0	233
241-AP-108	0	0	1140

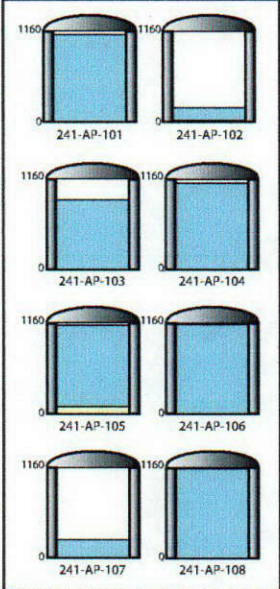

BX-Tank Farm- 1948-50

12 @ 530,000 GAL Tank Capacity, Single-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-BX-101	48	0	0
241-BX-102	112	0	0
241-BX-103	62	0	11
241-BX-104	97	0	3
241-BX-105	67	0	5
241-BX-106	38	0	0
241-BX-107	347	0	0
241-BX-108	31	0	0
241-BX-109	193	0	0
241-BX-110	65	139	1
241-BX-111	32	157	0
241-BX-112	163	0	1

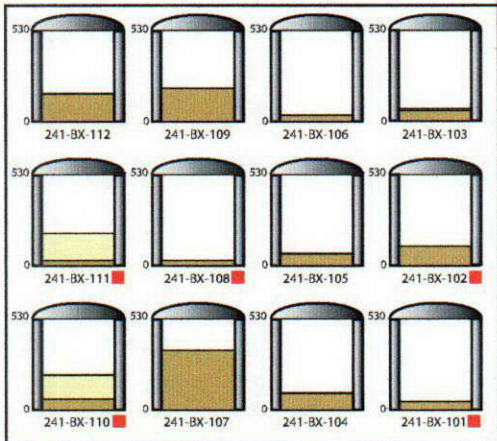

AW-Tank Farm- 1980

6 @ 1,160,000 GAL Tank Capacity, Double-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AW-101	0	396	731
241-AW-102	30	0	55
241-AW-103	273	40	787
241-AW-104	66	157	851
241-AW-105	263	0	159
241-AW-106	0	239	726

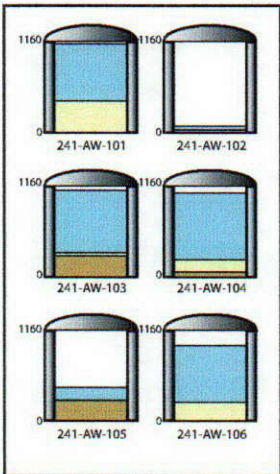

BY-Tank Farm- 1950-51

12 @ 758,000 GAL Tank Capacity, Single-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-BY-101	37	333	0
241-BY-102	0	277	0
241-BY-103	9	408	0
241-BY-104	45	313	0
241-BY-105	48	433	0
241-BY-106	32	458	0
241-BY-107	15	256	0
241-BY-108	40	182	0
241-BY-109	24	253	0
241-BY-110	43	323	0
241-BY-111	0	302	0
241-BY-112	2	284	0

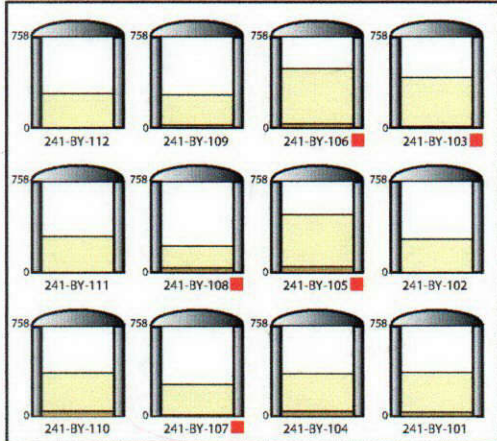

AX-Tank Farm- 1965-66

4 @ 1,000,000 GAL Tank Capacity, Single-Shell

Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AX-101	3	319	0
241-AX-102	6	24	0
241-AX-103	8	100	0
241-AX-104	7	0	0

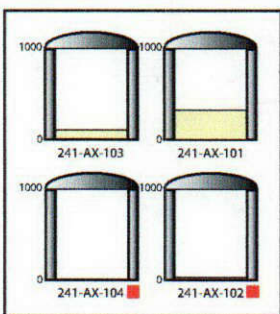


C-Tank Farm- 1946-53

12 @ 530,000 GAL Tank Capacity, Single-Shell

4 @ 55,000 GAL Tank Capacity, Single-Shell


Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-C-101	88	0	0
241-C-102	316	0	0
241-C-103	90	0	0
241-C-104	259	0	0
241-C-105	132	0	0
241-C-106	9	0	20
241-C-107	248	0	0
241-C-108	66	0	0
241-C-109	64	0	0
241-C-110	177	0	1
241-C-111	58	0	0
241-C-112	104	0	0
241-C-201	1	0	0
241-C-202	1	0	0
241-C-203	3	0	0
241-C-204	2	0	0

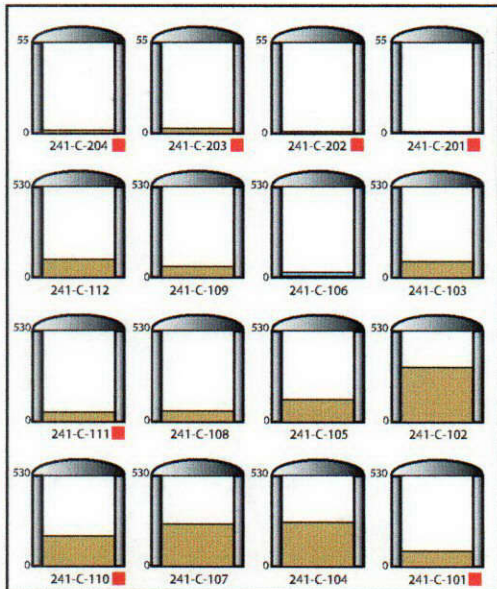

AY-Tank Farm- 1971-76

2 @ 1,000,000 GAL Tank Capacity, Double-Shell

Tank	Kgal		
	Sludge	Saltcake	Supernatant
241-AY-101	96	0	83
241-AY-102	171	0	516

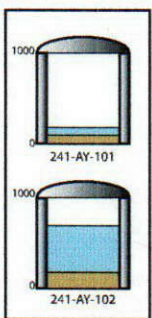

LEGEND

Sludge Saltcake Supernatant Available Space Assumed/Confirmed Leaker

Data Derived From Waste Tank Summary Report Dated 3/31/03

CH2M HILL


\\AP012\CHARDOS\All By Staff Member\Naikimbalkar\Tank Figures\200 East Tank Profile 033103.pdf

Figure E-4

200 West Tank Waste Contents


S-Tank Farm- 1950-51
12 @ 758,000 GAL Tank Capacity, Single-Shell
Kgal

Tank	Sludge	Saltcake	Supernatant
241-S-101	122	271	0
241-S-102	22	417	0
241-S-103	9	228	1
241-S-104	132	156	0
241-S-105	2	404	0
241-S-106	0	455	0
241-S-107	300	20	0
241-S-108	5	545	0
241-S-109	13	520	0
241-S-110	96	293	0
241-S-111	75	382	0
241-S-112	6	608	0

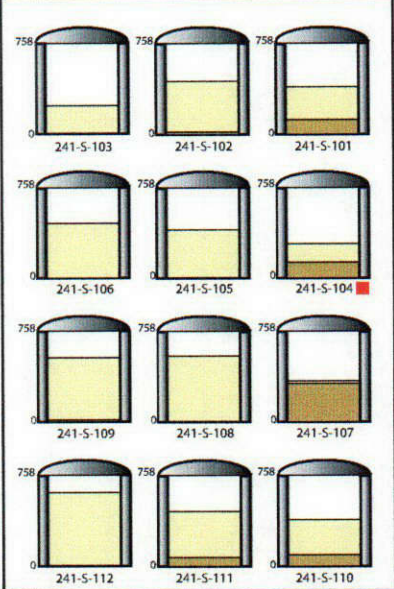


SX-Tank Farm- 1953-54
15 @ 1,000,000 GAL Tank Capacity, Single-Shell
Kgal

Tank	Sludge	Saltcake	Supernatant
241-SX-101	144	269	0
241-SX-102	55	374	0
241-SX-103	78	413	0
241-SX-104	136	310	0
241-SX-105	63	312	0
241-SX-106	0	396	0
241-SX-107	79	16	0
241-SX-108	73	0	0
241-SX-109	58	183	0
241-SX-110	29	27	0
241-SX-111	76	39	0
241-SX-112	56	19	0
241-SX-113	19	0	0
241-SX-114	41	114	0
241-SX-115	4	0	0

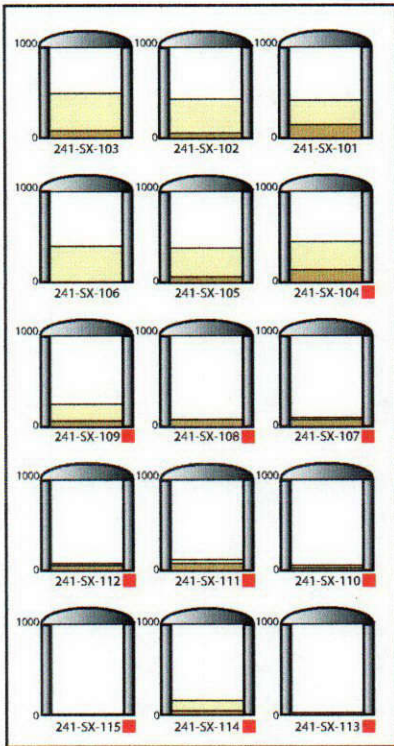


SY-Tank Farm- 1977
3 @ 1,160,000 GAL Tank Capacity, Double-Shell
Kgal

Tank	Sludge	Saltcake	Supernatant
241-SY-101	0	275	844
241-SY-102	145	0	701
241-SY-103	0	342	395

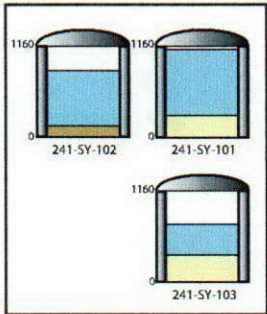


T-Tank Farm- 1943-44
12 @ 530,000 GAL Tank Capacity, Single-Shell
4 @ 55,000 GAL Tank Capacity, Single-Shell
Kgal

Tank	Sludge	Saltcake	Supernatant
241-T-101	37	63	0
241-T-102	19	0	13
241-T-103	23	0	4
241-T-104	317	0	0
241-T-105	98	0	0
241-T-106	22	0	0
241-T-107	173	0	0
241-T-108	5	11	0
241-T-109	0	62	0
241-T-110	369	0	1
241-T-111	447	0	0
241-T-112	60	0	7
241-T-201	29	0	2
241-T-202	21	0	0
241-T-203	37	0	0
241-T-204	37	0	0

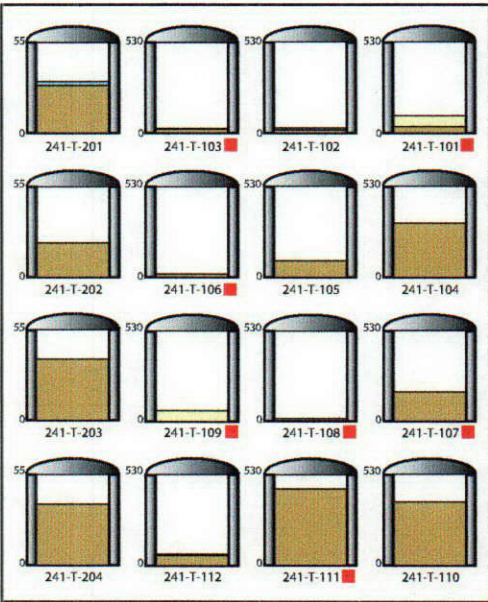


TX-Tank Farm- 1947-48
18 @ 758,000 GAL Tank Capacity, Single-Shell
Kgal

Tank	Sludge	Saltcake	Supernatant
241-TX-101	74	17	0
241-TX-102	2	215	0
241-TX-103	0	145	0
241-TX-104	34	32	2
241-TX-105	8	568	0
241-TX-106	5	343	0
241-TX-107	0	29	0
241-TX-108	6	123	0
241-TX-109	363	0	0
241-TX-110	37	430	0
241-TX-111	43	322	0
241-TX-112	0	634	0
241-TX-113	93	546	0
241-TX-114	4	528	0
241-TX-115	9	545	0
241-TX-116	66	532	0
241-TX-117	29	452	0
241-TX-118	0	256	0

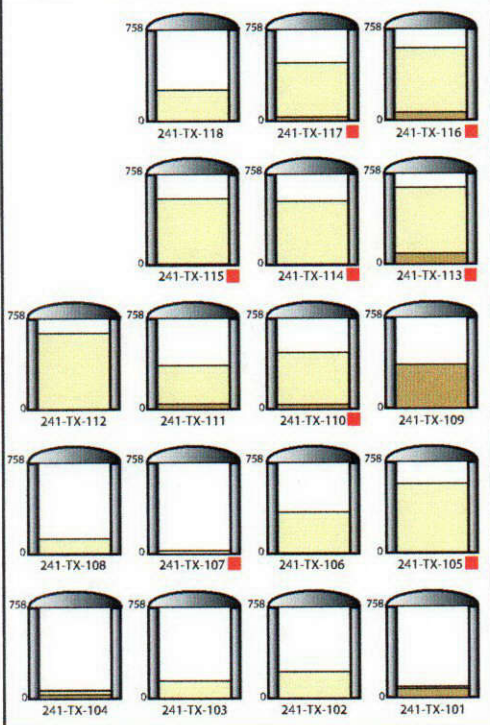


TY-Tank Farm- 1951-52
6 @ 758,000 GAL Tank Capacity, Single-Shell
Kgal

Tank	Sludge	Saltcake	Supernatant
241-TY-101	72	47	0
241-TY-102	0	69	0
241-TY-103	103	52	0
241-TY-104	43	0	1
241-TY-105	231	0	0
241-TY-106	16	0	0

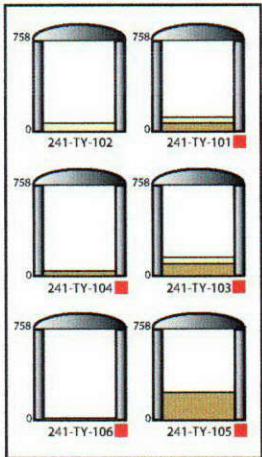

U-Tank Farm- 1946-49
12 @ 530,000 GAL Tank Capacity, Single-Shell
4 @ 55,000 GAL Tank Capacity, Single-Shell
Kgal

Tank	Sludge	Saltcake	Supernatant
241-U-101	24	0	0
241-U-102	43	283	1
241-U-103	11	405	1
241-U-104	122	0	0
241-U-105	32	321	0
241-U-106	0	169	3
241-U-107	15	294	0
241-U-108	29	376	0
241-U-109	35	366	0
241-U-110	176	0	0
241-U-111	25	229	0
241-U-112	45	0	0
241-U-201	4	0	1
241-U-202	4	0	1
241-U-203	4	0	1
241-U-204	3	0	1

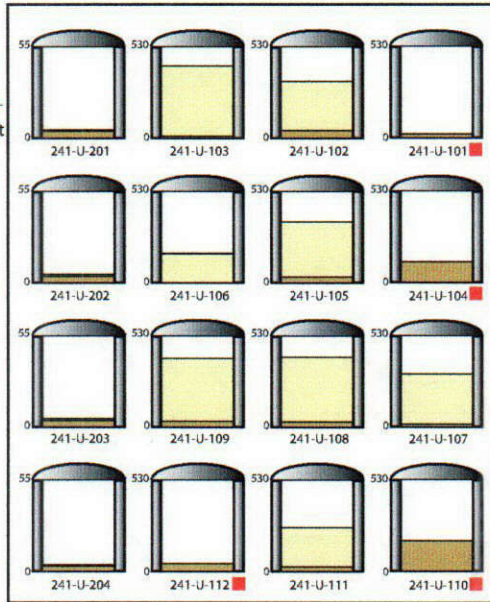

LEGEND

Sludge Saltcake Supernatant Available Space Assumed/Confirmed Leaker

Data Derived From Waste Tank Summary Report Dated 3/31/03





\\AP012\CHARD\CH2M\All By Staff Member\Nalnim\Balkar\Tank Figures\200 West Tank Profile 033103.pdf

Figure E-5

Hanford Tank Farm Facilities 200 East

Note:
All single-shell tanks were removed from service (not allowed to receive waste) on or before November 21, 1980

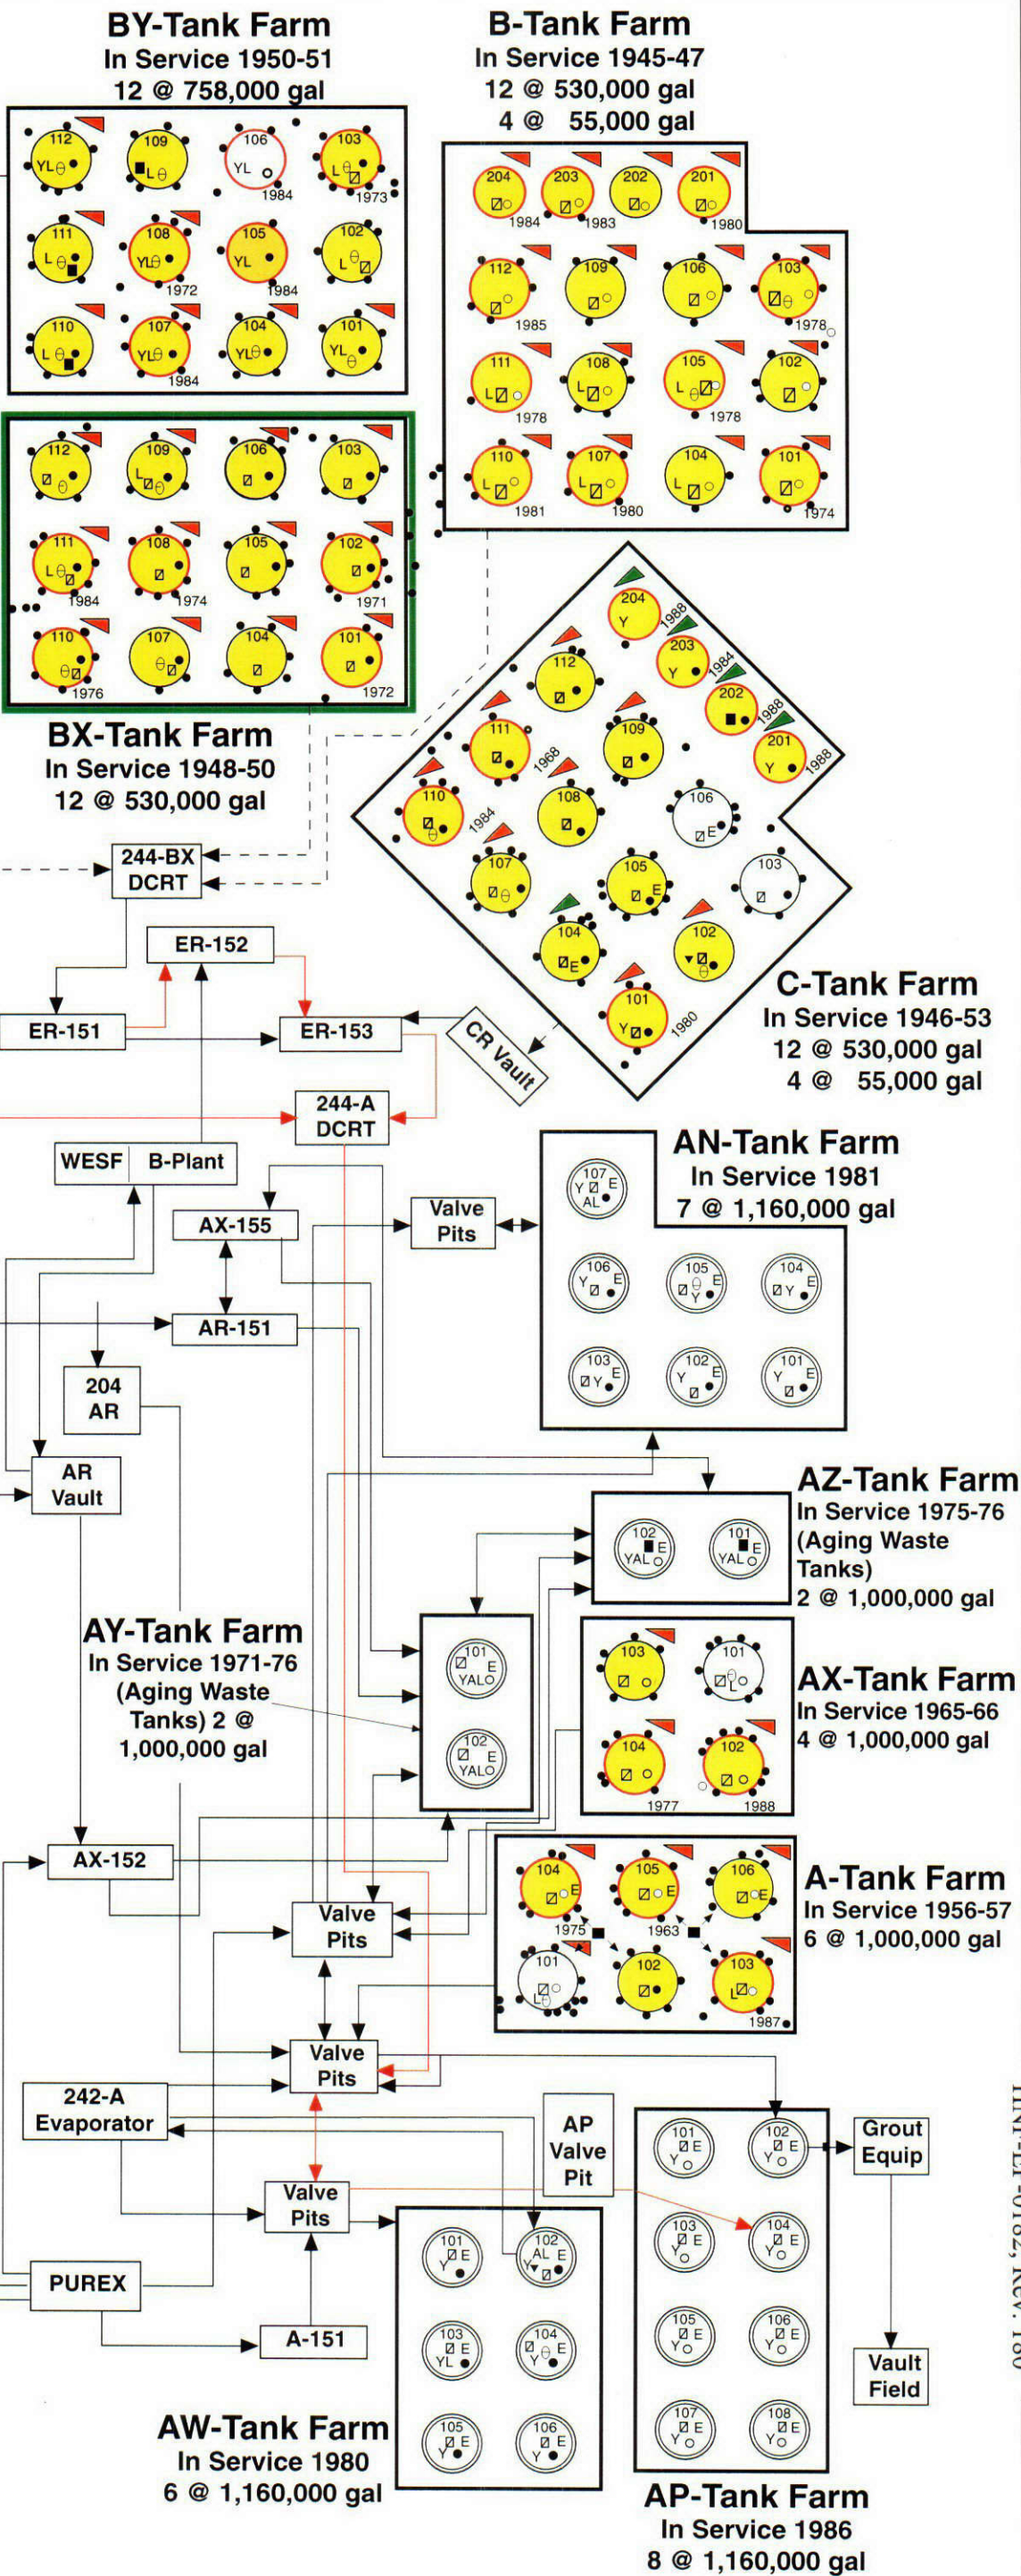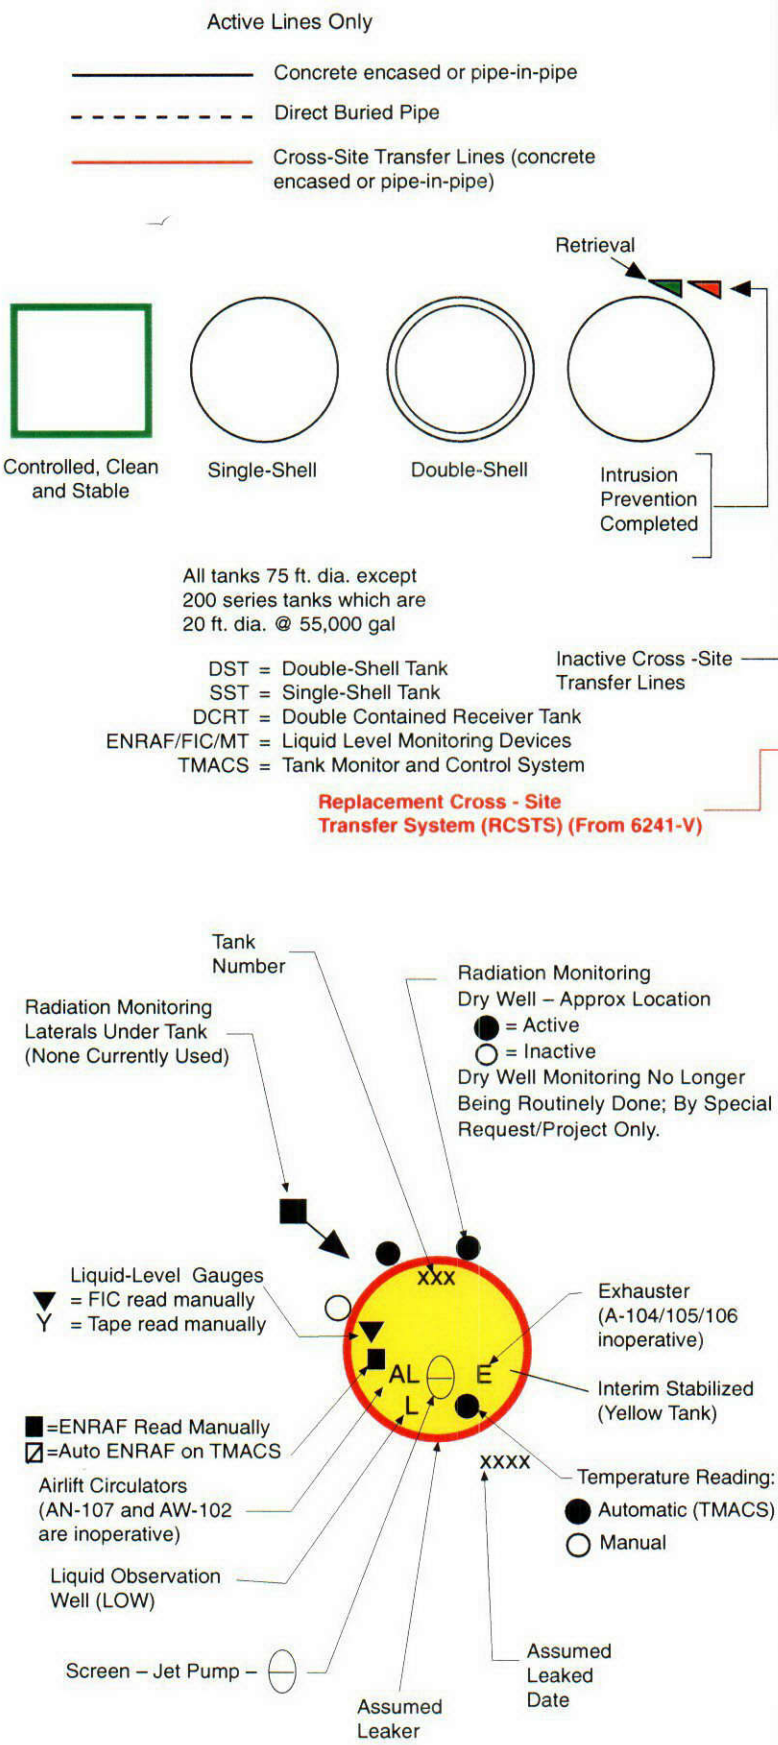

Status as of March 31, 2003
Updated Quarterly
Issued by River Protection Project

Figure E-6
(Schematic)

G03040066.E
03/31/03

HNF-EP-0182, Rev. 180

Hanford Tank Farm Facilities 200 West

Note:
All single-shell tanks were removed from service (not allowed to receive waste) on or before November 21, 1980


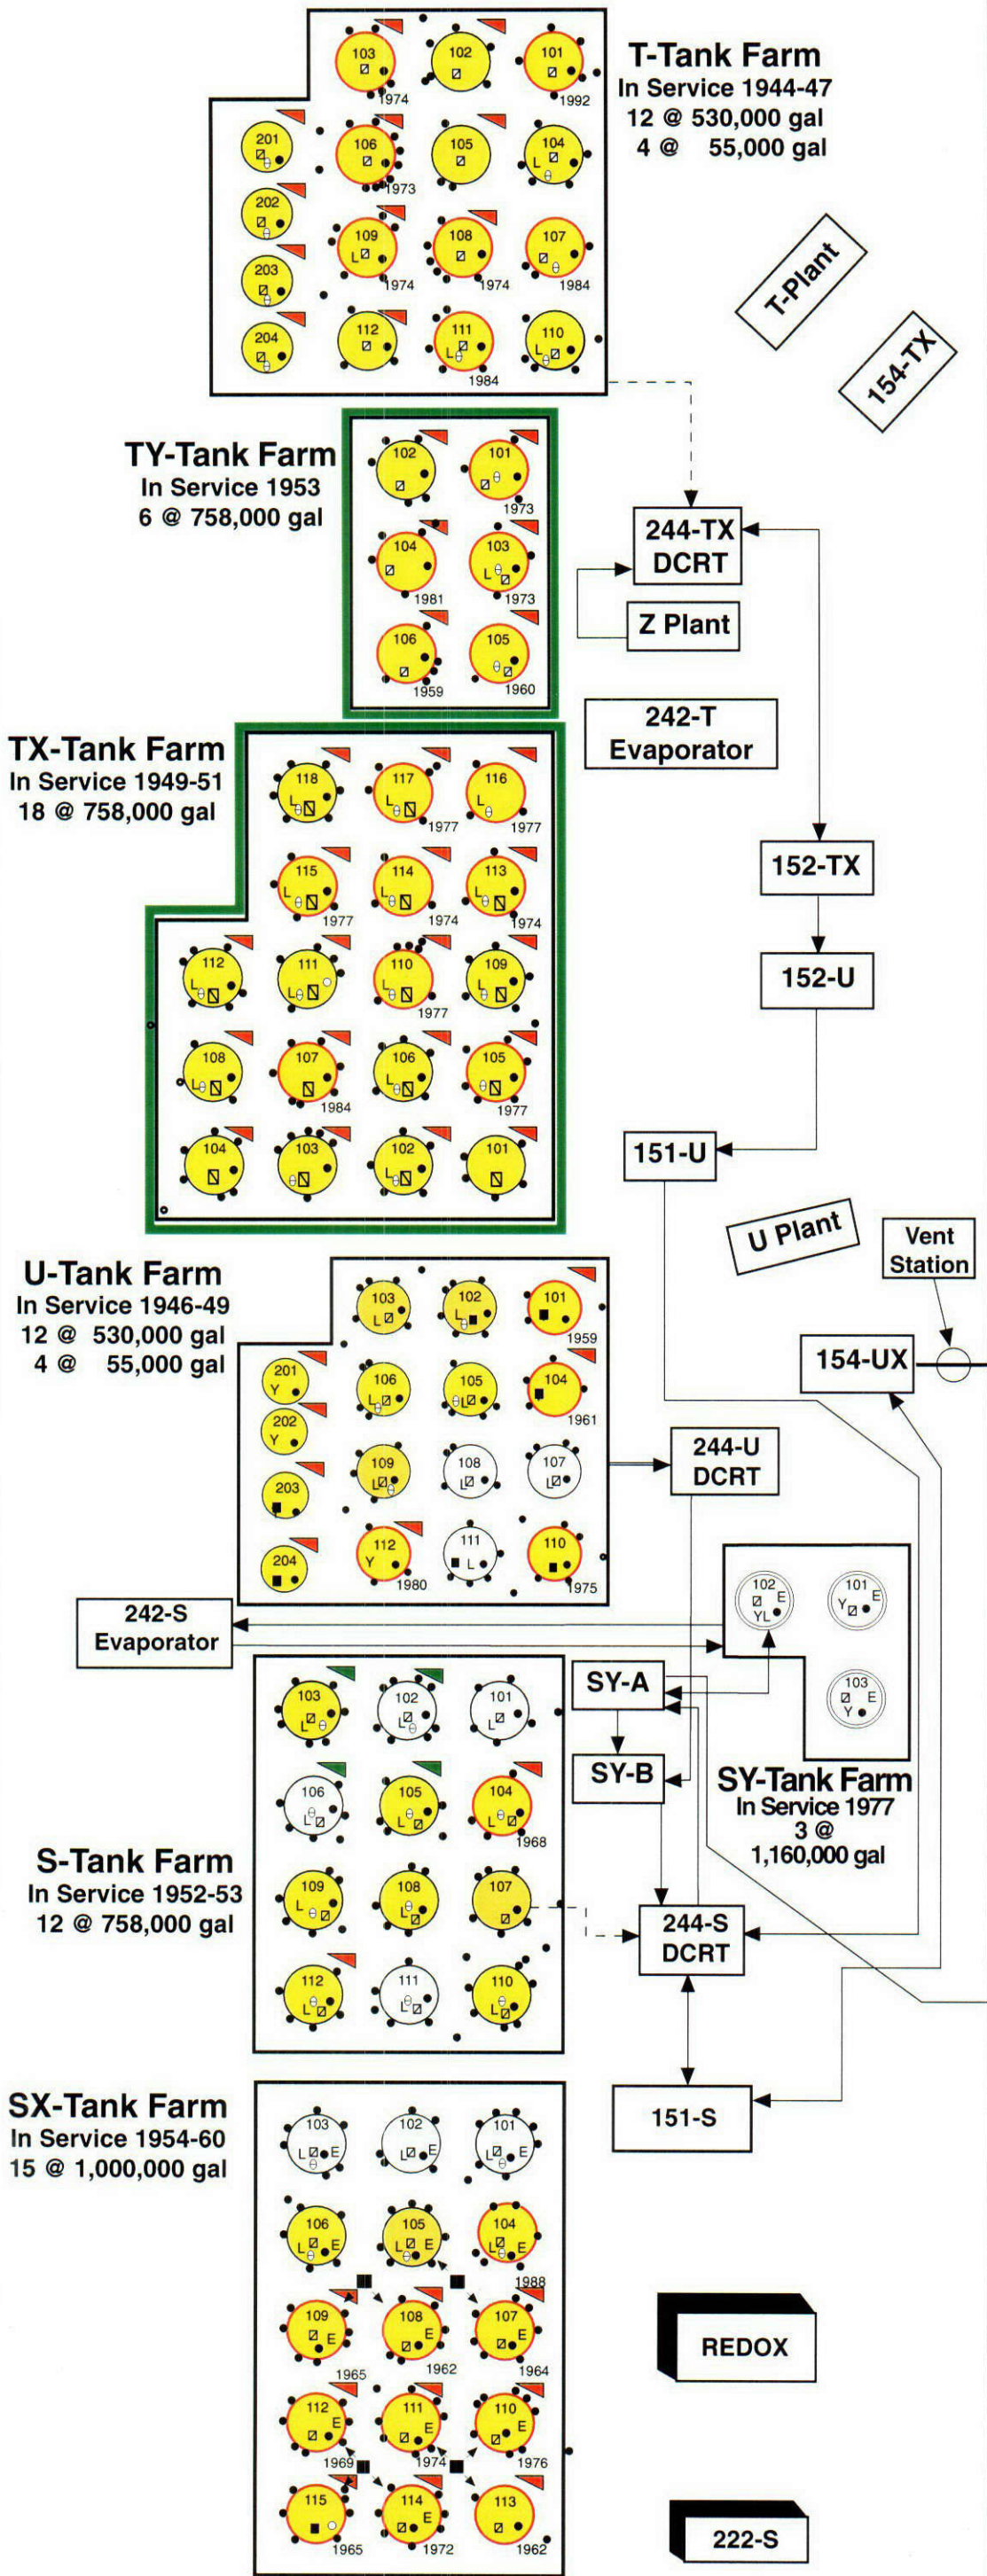


Figure E-7
(Schematic)

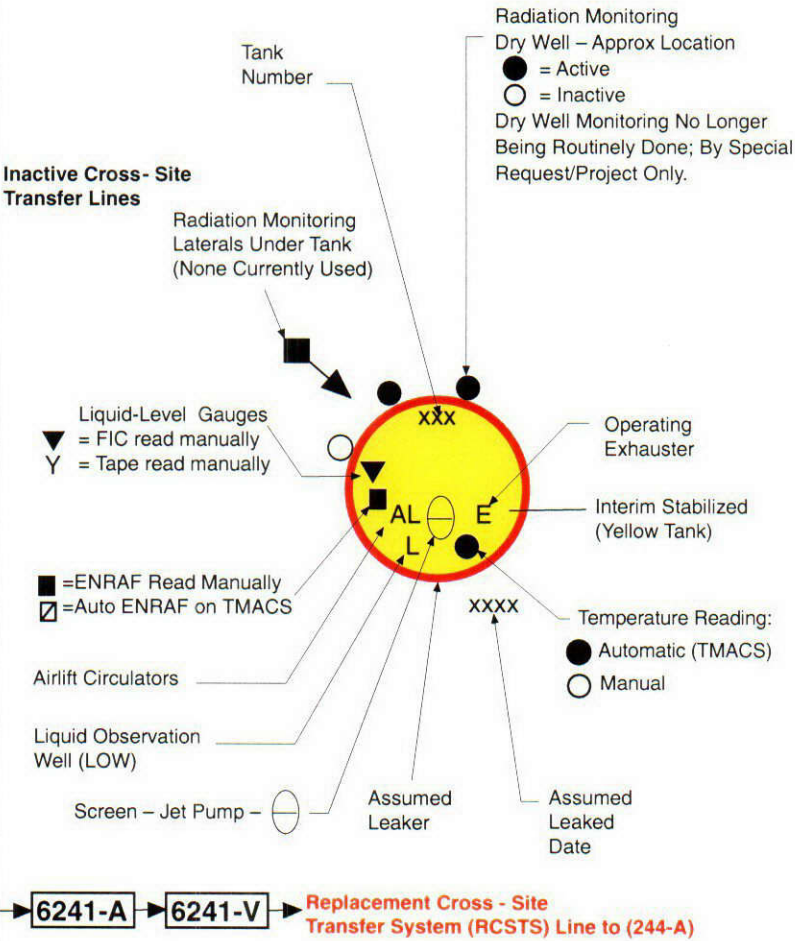

Status as of March 31, 2003
Updated Quarterly
Issued by River Protection Project